


Bearing installation and maintenance guide







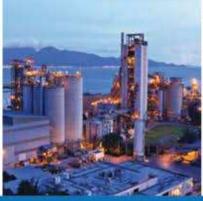



Bearing Installation and Maintenance Guide

Highlights of the new edition of the SKF Bearing Installation and Maintenance Guide.

- The mounting and dismounting section has been expanded to include:
 - Individual step-by-step instructions for mounting self-aligning ball bearings, spherical roller bearings, and CARB[®]. This expansion will allow the book to be used as a guide during actual mounting of bearings rather than just a reference.
 - Assembly, mounting and dismounting instructions for split pillow block housings, unit ball housings, and unit roller housings.
- The shaft and housing fit tables have been updated to include stainless steel
 bearings and reflect slightly different fit recommendations based on bearing
 size and style. These changes are the result of SKF's profound knowledge of
 our products and vast experience with OEM and end user customers.
- The lubrication section now includes the latest viscosity requirement guidelines as well as more specific guidelines for grease relubrication.
- The troubleshooting section is now more user-friendly.
- The bearing failure section now reflects the new ISO terminology and structure for bearing failures. It also features failure analysis service provided by SKF.

Table of contents

Bearing types	3
Bearing terminology	9
Mounting and dismounting of bearings	11
General information	
Bearing care prior to mounting	11
Where to mount	11
Preparations for mounting and dismounting	11
Bearing handling	12
Fitting practice	
Internal bearing clearance	
Mounting	
Mounting bearings with cylindrical (straight) bore	
Cold Mounting.	
Temperature (hot) mounting	
Heating the bearing	
Heating the housing	
Mounting bearings with tapered bore	
Mounting tapered bore double row self-aligning ball bearings	
Angular drive-up method	
Mounting tapered bore spherical roller bearings	
Radial clearance reduction method on adapter sleeves	
Radial clearance reduction method on solid tapered shaft	
Angular drive-up method on adapter sleeves	
Mounting of CARB® toroidal roller bearings	
Radial clearance reduction method on adapter sleeves	
Radial clearance reduction method on solid tapered shaft	
Angular drive-up method on adapter sleeves	
SKF hydraulic mounting method on adapter sleeves	
Assembly instructions for pillow block housings, SAF and SAFS	
Shaft tolerances	
Seals	
Grease charge	
Cap bolt tightening torques	
Misalignment limits	
Mounting instructions for collar mounted roller unit pillow blocks and flanged housings	
Mounting and dismounting instructions for Concentra mount roller unit pillow blocks and flanged housings	
Mounting and dismounting instructions for ball unit pillow blocks and flanged housings	
Mounting and dismounting instructions for Concentra ball unit pillow blocks and flanged housings	
Test running	
Dismounting methods	
Can the bearing be used again?	48

Table of contents (cont.)

Shaft and housing fits	51
Purpose of proper fits	
Selection of fit	
Shaft fit selection tables	
Housing fit selection tables	
Shaft tolerance limits for adapter mounting and pillow block seal seatings	
Fits for hollow shafts	
Fit tolerance tables	
Shaft tolerances for bearings mounted on metric sleeves	
Guidelines for surface roughness	
Accuracy of form and position	
Shaft and housing tolerance tables for inch size taper roller bearings	
Shaft and housing tolerances for metric and J-prefix inch series taper roller bearings	
Shaft and housing tolerances for Precision ABEC-5 deep groove ball bearings	85
Lubrication	27
Functions of a lubricant	
Selection of oil	
Viscosity Equivalents Chart.	
Methods of oil lubrication.	
Grease lubrication	
Grease relubrication	
Relubrication intervals	
Relubrication interval adjustments	
Grease relubrication procedures	
SKF solid oil	
Troubleshooting	
Common bearing symptoms	
Trouble conditions and their solutions	107
Bearing damages and their causes	
Damage mode classification	
Definitions	
Loading patterns for bearings	
Pre-operational damage mode causes	
Operational damage mode causes	
SKF failure analysis service	133
Additional resources	
Maintenance and lubrication products	
SKF Training Solutions	136
Reliability and services	
The Asset Efficiency Optimization™ (AEO) concept	
SKF technology and service solutions	138

Bearing types

Each type of bearing has characteristic properties which make it particularly suitable for certain applications. The main factors to be considered when selecting the correct type are:


- Available space
- Magnitude and direction of load (radial, axial, or combined)
- Speed
- Misalignment
- Mounting and dismounting procedures
- Precision required
- Noise factor
- Internal clearance
- Materials and cage design
- Bearing arrangement
- Seals



Radial bearings

Deep groove ball bearings

single row, with or without filling slots open basic design (1) with shields with contact seals (2) with a snap ring groove, with or without a snap ring

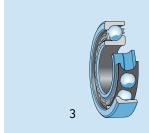



Angular contact ball bearings

single row


basic design for single mounting design for universal matching (3) single row high-precision basic design for single mounting (4) design for universal matching matched bearing sets





double row


with a one-piece inner ring (5)
open basic design
with shields
with contact seals
with a two-piece inner ring
Four-point contact ball bearing (6)

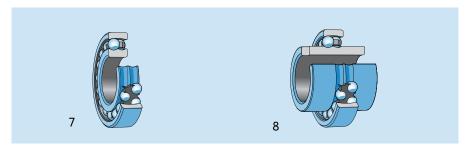

Radial bearings


Self-aligning ball bearings

with a cylindrical or tapered bore open basic design (7) with contact seals with an extended inner ring (8)

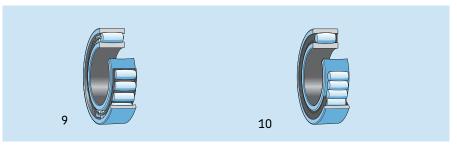


CARB® toroidal roller bearings

with a cylindrical or tapered bore open basic designs with a cage-guided roller set (9) with a full complement roller set with contact seals (10)

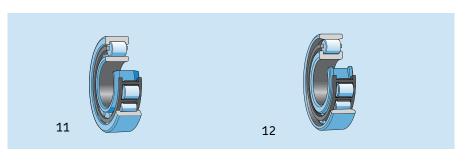


Cylindrical roller bearings

single row NU type (11) N type (12))

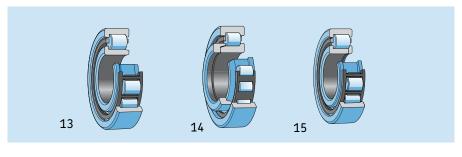


NJ type (13) NJ type with HJ angle ring (14) NUP type (15)

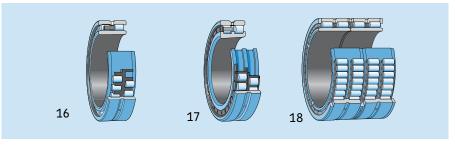

double row, cylindrical or tapered bore NNU type (16) NN type (17)

four-row

with cylindrical (18) or tapered bore

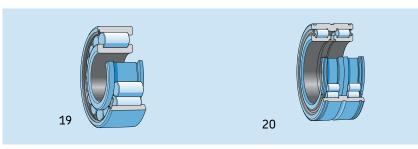


Full complement cylindrical roller bearings single row

NCF design (19)

double row

with integral flanges on the inner ring with integral flanges on the inner and outer rings with contact seals (20)

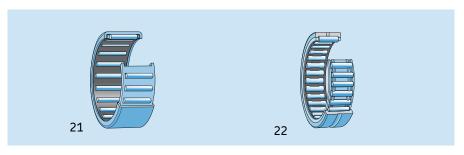


23

Radial bearings


Needle roller bearings

drawn cup needle roller bearings open basic design (21) with contact seals needle roller bearings with flanges without an inner ring (22) with an inner ring open basic design with contact seals


Needle roller and cage assemblies single row (23) double row (24)

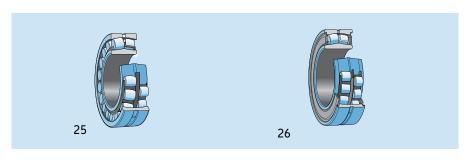


Spherical roller bearings with cylindrical or tapered bore open design (25) with contact seals (26)

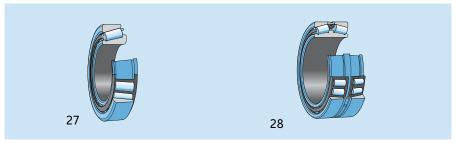


Taper roller bearings single row (27) double row, matched sets (28) TDO (back-to-back) TDI (face-to-face)

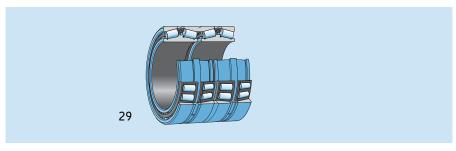



four row (29) TQO configuration TQI configuration

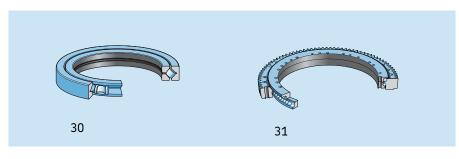



Cross taper roller bearings (29) Slewing bearings (31) with or without gears

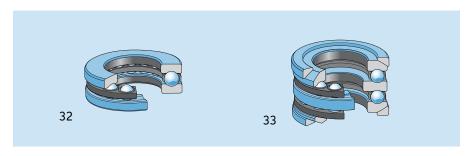


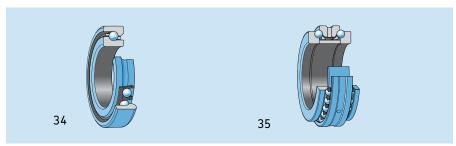

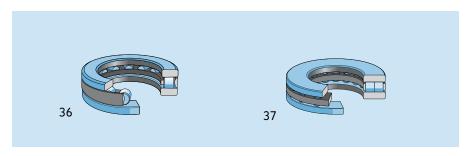

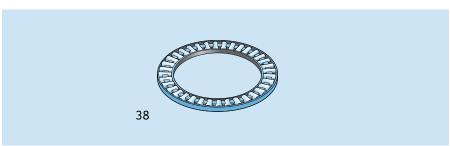

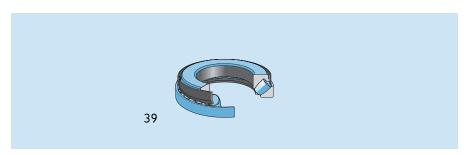

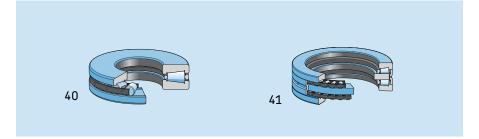

Thrust bearings

Thrust ball bearings

single direction with flat housing washer (32) with sphered housing washer and seating washer double direction

with flat housing washers with sphered housing washers and seating rings (33) without seating rings

Angular contact thrust ball bearings

high-precision bearings single direction basic design for single mounting (34) design for universal matching matched bearing sets double direction standard design (35) high speed design

Cylindrical roller thrust bearings


single direction single row (36) double row (37) components cylindrical roller and cage thrust assemblies shaft and housing washers

Needle roller thrust bearings


single direction needle roller and cage thrust assemblies (38) raceway washers thrust washers


Spherical roller thrust bearings single direction (39)


Taper roller thrust bearings single direction with or without (40) a cover screw down bearings double direction (41)

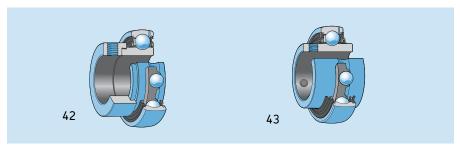

44

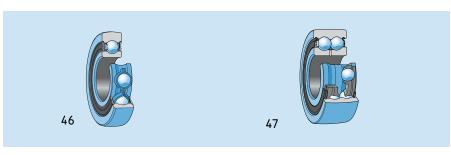

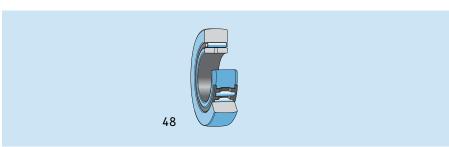

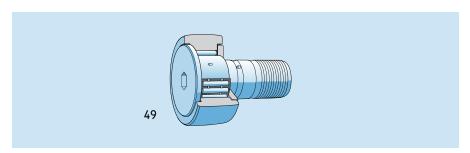

Y-bearings

Y-bearings (Insert bearings)

with an eccentric locking collar inner ring extended on one side (42) inner ring extended on both sides with setscrews

inner ring extended on one side inner ring extended on both sides (43)

with a tapered bore for adapter sleeve mounting (44)

with a standard inner ring for locating by interference fit on the shaft (45)

Track runner bearings

Cam rollers

single row ball bearing cam roller narrow design

with crowned runner surface (46) double row ball bearing cam roller wide design with crowned runner surface (47) with cylindrical runner surface

Support rollers

without an axial guidance
with crowned or cylindrical runner surface
with or without contact seals
without an inner ring
with an inner ring (48)

Cam followers

with an axial guidance by thrust plate
with crowned or cylindrical runner surface
with or without contact seals
with a concentric seating (49)
with an eccentric seating collar
with a cage-guided needle roller set
with a full complement needle roller set


Bearing terminology

The illustrations below identify the bearing parts of eight SKF basic bearing types. The terms used conform with the terminology section of the American Bearing Manufacturers Association, Inc. (ABMA) standards, and are generally accepted by anti-friction bearing manufacturers.

- 1. Inner ring
- 2. Inner ring corner
- 3. Inner ring land
- 4. Outer ring land
- 5. Outer ring
- 6. Ball
- 7. Counter bore

- 8. Thrust face
- 9. Outer ring raceway
- 10. Inner ring raceway
- 11. Outer ring corner
- 12. Spherical roller
- 13. Lubrication feature (holes and groove) (W33)
- 14 Spherical outer ring raceway
- 15. Floating guide ring
- 16. Inner ring side face
- 17. Outer ring side face
- 18. Cylindrical roller
- 19. Outer ring flange
- 20. Cone front face

- 21. Cone front face flange
- 22. Cup (outer ring)
- 23. Tapered roller
- 24. Cone back face flange
- 25. Cone back face
- 26. Cone (inner ring)
- 27. Undercut
- 28. Cage
- 29. Face
- 30. Shaft washer (inner ring)
- 31. Housing washer (outer ring)
- 32. Seals
- 33. Toroidal roller

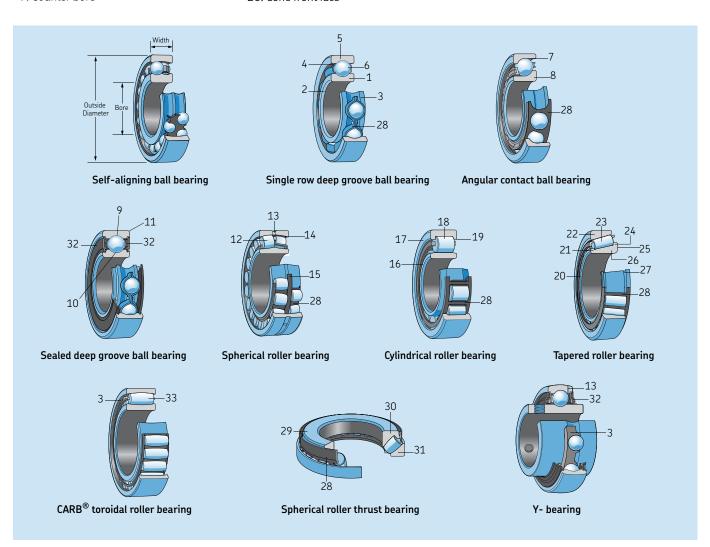

Mounting and dismounting of bearings

General information

To provide proper bearing performance and prevent premature failure, skill and cleanliness when mounting ball and roller bearings are necessary. As precision components, rolling bearings should be handled carefully when mounting. It is also important to choose the correct method of mounting and to use the correct tools for the iob.

See the SKF Bearing Maintenance Tools Catalog (711-639) or www.mapro.skf.com.

Bearing care prior to mounting

Proper care begins in the stock room. Store bearings in their original unopened packages, in a dry place. The bearing number is plainly shown on the box or wrapping. Before packaging, the manufacturer protected the bearing with a rust preventive slush compound. An unopened package means continued protection. The bearings need to be left in their original packages until immediately before mounting so they will not be exposed to any contaminants, especially dirt. Handle the bearing with clean, dry hands and with clean rags. Lay the bearing on clean paper and keep it covered. Never expose the bearing on a dirty bench or floor. Never use a bearing as a gauge to check either the housing bore or the shaft fit.

Don't wash a new bearing – it is already clean.

Normally, the preservative with which new bearings are coated before leaving the factory does not need to be removed; it is only necessary to wipe off the outside cylindrical surface and bore. If, however, the bearing is to be grease lubricated and used at very high or very low temperatures, or if the grease is not compatible with the preservative, it is necessary to wash and carefully dry the bearing. This is to avoid any detrimental effect on the lubricating properties of the

grease. Old grease can be washed from a used bearing with a solvent but the fluid and container must be clean. After this cleaning, wash the bearing out thoroughly with light oil and then relubricate. (See pages 48 and 49).

Bearings should be washed and dried before mounting if there is a risk that they have become contaminated because of improper handling (damaged packaging, etc.). When taken from its original packaging, any bearing that is covered by a relatively thick, greasy layer of preservative should also be washed and dried. This might be the case for some large bearings with an outside diameter larger than 420 mm. Suitable agents for washing rolling bearings include white spirit and paraffin. Bearings that are supplied ready greased and which have integral seals or shields on both sides should not be washed before mounting.

Where to mount


Bearings should be installed in a dry, dust-free room away from metalworking or other machines producing swarf and dust. When bearings have to be mounted in an unprotected area, which is often the case with large bearings, steps need to be taken to protect the bearing and mounting position from contamination by dust, dirt and moisture until installation has been completed. This can be done by covering or wrapping bearings, machine components etc. with waxed paper or foil.

Preparations for mounting and dismounting

Before mounting, all the necessary parts, tools, equipment and data need to be at hand. It is also recommended that any drawings or instructions be studied to determine the correct order in which to assemble the various components. Housings, shafts, seals and other components of the bearing arrangement need to be checked to make sure that they are clean, particularly any threaded holes, leads or grooves where remnants of previous machining operations might have collected. The unmachined surfaces of cast housings need to be free of core sand and any burrs need to be removed.

Support the shaft firmly in a clean place; if in a vise, protect it from vise jaws. Protectors can be soft metal, wood, cardboard or paper. The dimensional and form accuracy of all components of the bearing arrangement need to be checked. If a shaft is too worn to properly seat a bearing – don't use it! The bearings will only perform satisfactorily if the associated components have the requisite accuracy and if the prescribed tolerances are adhered to. The diameter of cylindrical shaft and housing seatings are usually checked using a stirrup or internal gauge at two cross-sections and in four directions (**Figure 1**).

Tapered bearing seatings are checked using ring gauges, special taper gauges or sine bars. It is advisable to keep a record of the measurements.

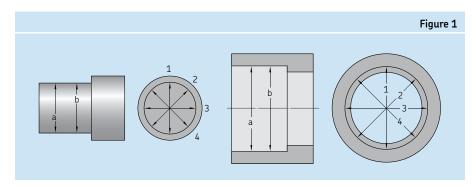

When measuring, it is important that the components being measured and the measuring instruments are approximately the same temperature. This means that it is necessary to leave the components and measuring equipment together in the same place long enough for them to reach the same temperature. This is particularly important where large bearings and their associated components, which are correspondingly large and heavy, are concerned.

Bearing handling

It is generally a good idea to use gloves as well as carrying and lifting tools, which have been specially designed for mounting and dismounting bearings. This will save not only time and money but the work will also be less tiring and less risky. For these reasons, the use of heat and oil resistant gloves is recommended when handling hot or oily bearings. These gloves should have a durable outside and a soft non-allergenic inside, as for example, SKF TMBA gloves.

Heated and/or larger or heavier bearings often cause problems because they cannot be handled in a safe and efficient manner by one or two persons. Satisfactory arrangements for carrying and lifting these bearings can be made on site in a workshop. The bearing handling tool TMMH from SKF (Figure 2) solves most of the problems and facilitates handling, mounting and dismounting bearings on shafts.




If large, heavy bearings are to be moved or held in position using lifting tackle they should not be suspended at a single point but a steel band or fabric belt should be used (Figure 3). A spring between the hook of the lifting tackle and the belt facilitates positioning the bearing when it is to be pushed onto a shaft.



To ease lifting, large bearings can be provided on request with threaded holes in the ring side faces to accommodate eye bolts. The hole size is limited by the ring thickness. It is therefore only permissible to lift the bearing itself or the individual ring by the bolts. Also, make sure that the eye bolts are only subjected to load in the direction of the shank axis (**Figure 4**). If the load is to be applied at an angle, suitable adjustable attachments are required.

When mounting a large housing over a bearing that is already in position on a shaft,

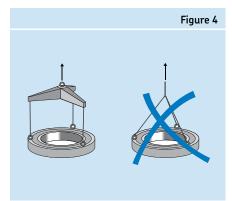

it is advisable to provide three-point suspension for the housing, and for the length of one sling to be adjustable. This enables the housing bore to be exactly aligned with the bearing.

Fitting practice

A ball or roller bearing has precision component parts which fit together with very close tolerances. The inner ring bore and the outer ring outside diameter are manufactured

within close limits to fit their respective supporting members—the shaft and housing. It follows that the shaft and the housing must also be machined to similar close limits. Only then will the required fitting be obtained when the bearing is mounted.

For a rotating shaft load the inner ring will creep on the shaft if a loose fit is used. This will result in overheating, excessive wear and contact erosion between the shaft and inner ring. Creep is described as the relative circumferential movement between the bearing ring and its seat, whether it be the shaft or housing. Therefore a preventive measure must be taken to eliminate creeping and its harmful results. Mount the bearing ring with a sufficient press fit. This will help ensure that both the bearing ring and seat act as a unit and rotate at the same speed. It is also desirable to use a clamping device, i.e. locknut or end plate, to clamp the ring against the shoulder.

If the applied load is of a rotating nature (for example, vibrating screens where unbalanced weights are attached to the shaft), then the outer ring becomes the critical member. In order to eliminate creeping in this case, the outer ring must be mounted with a press fit in the housing. The rotating inner ring, when subjected to a stationary load, can be mounted with a slip fit on the shaft. When the ring rotates in relation to the load a tight fit is required. For specific fit information, shaft and housing fit tables are provided in a separate chapter beginning on page 51.

Internal bearing clearance


A press (or interference) fit on a shaft will expand the inner ring. This holds true when mounting the bearing directly on the shaft or by means of an adapter sleeve. Thus, there will be a tendency when mounted to have reduced internal clearance from the unmounted clearance.

However, bearings are designed in such a way that if the recommended shaft fits are used and operating temperatures have been taken into account, the internal clearance remaining after mounting the bearing will be sufficient for proper operation.


Mounting

Nearly all rolling bearing applications require the use of an interference fit on at




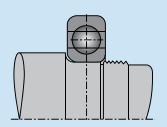


1. Shaft fillet too large

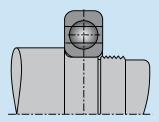


2. Correct shaft fillet

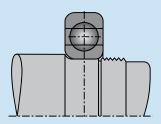

3. Shaft shoulder too small

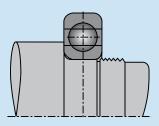

4. Shaft shoulder too large

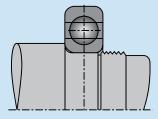

5. Correct shaft shoulder diam-

least one of the bearing rings, usually the inner. Consequently, all mounting methods are based on obtaining the necessary interference without undue effort, and with no risk of damage to the bearing. Depending on the bearing type and size, mechanical, thermal or hydraulic methods are used for mounting. In all cases it is important that the bearing rings, cages and rolling elements or seals do not receive direct blows, and that the mounting force must never be directed through the rolling elements. Three basic mounting methods are used, the choice depending on factors such as the number of mountings, bearing type and size, magnitude of the interferences and, possibly, the available tools. SKF supplies tools for all mounting methods described here. For more details, see the SKF Bearing Maintenance Tools Catalog (711-639) or www.mapro.skf.com.

Mounting bearings with a cylindrical (straight) bore

With non-separable bearings, the ring that is to have the tighter fit should generally be mounted first. The seating surface should be lightly oiled with thin oil before mounting. The inner ring should be located against a shaft shoulder of proper height (Figure 5). This shoulder must be machined square with the bearing seat and a shaft fillet should be used. The radius of the fillet must clear the corner radius of the inner ring. Specific values can be found in the SKF Interactive Engineering Catalog located at www.skf.com or the SKF General Catalog.


Cold mounting

Mounting a bearing without heating is the most basic and direct mounting method. If the fit is not too tight, small bearings may be driven into position by applying light hammer blows to a sleeve placed against the bearing ring face having the interference fit. The blows should be evenly distributed around the ring to prevent the bearing from tilting or skewing.

Cold mounting is suitable for cylindrical bore bearings with an outside diameter up to 4 inches. In some cases, if the interference specified for a cylindrical bore bearing is great enough, the use of one of the other mounting methods is warranted. Three other situations may make it impractical or inadvisable to cold-mount a bearing:


- When the bearing face against which the pressing force is to be applied, either directly or through an adjacent part, is inaccessible.
- When the distance through which the bearing must be displaced in order to seat is too great.
- When the shaft or housing seating material is so soft that there is risk of permanently deforming it during the mounting process.

If a non-separable bearing is to be pressed onto the shaft and into the housing bore at the same time, the mounting force has to be applied equally to both rings at the same time and the abutment surfaces of the mounting tool must lie in the same plane. In this case a bearing fitting tool should be used, where an impact ring abuts the side faces of the inner and outer rings and the sleeve enables the mounting forces to be applied centrally (**Figure 6**)

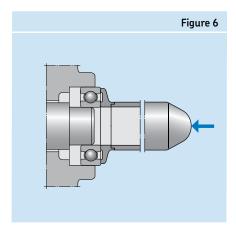

With separable bearings, the inner ring can be mounted independently of the outer ring, which simplifies mounting, particularly where both rings are to have an interference fit. When installing the shaft, with the inner ring already in position, into the housing containing the outer ring, make sure that they are correctly aligned to avoid scoring the raceways and rolling elements.

When mounting cylindrical and needle roller bearings with an inner ring without flanges or a flange at one side, SKF recommends using a mounting sleeve (Figure 7). The outside diameter of the sleeve should be equal to the raceway diameter of the inner ring and should be machined to a d10 tolerance.

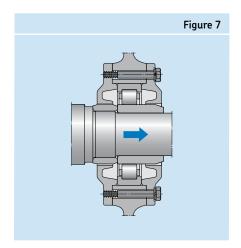

Temperature (Hot) mounting

It is generally not possible to mount larger bearings in the cold state, as the force required to mount a bearing increases considerably with increasing bearing size. The bearings, the inner rings or the housings (e.g. hubs) are therefore heated prior to mounting. Temperature mounting is the technique of obtaining an interference fit by first introducing a temperature differential between the parts to be fitted, thus facilitating their assembly. The necessary temperature differential can be obtained in one of three ways:

- Heating one part (most common)
- · Cooling one part
- Simultaneously heating one part and cooling the other

The requisite difference in temperature between the bearing ring and shaft or housing depends on the degree of interference and the diameter of the bearing seating.

Heating the bearing

Heat mounting is suitable for all medium and large size straight bore bearings, and for small bearings with cylindrical seating arrangements. Normally a bearing temperature increase of 150° F above the shaft temperature provides sufficient expansion for mounting. As the bearing cools, it contracts and tightly grips the shaft. It's impor-

tant to heat the bearing uniformly and to regulate heat accurately. Bearings should not be heated above 250° F, as excess heat can destroy a bearing's metallurgical properties, softening the bearing and potentially changing its dimensions permanently. Standard ball bearings fitted with shields or seals should not be heated above 210° F because of their grease fill or seal material. If a nonstandard grease is in the bearing, the grease limits should be checked before heating the bearing. Never heat a bearing using an open flame such as a blowtorch.

Localized overheating must be avoided. To heat bearings evenly, SKF induction heaters (Figure 8) are recommended. If hotplates are used, the bearing must be turned over a number of times. Hotplates should not be used for heating sealed bearings.



Heat mounting reduces the risk of bearing or shaft damage during installation because the bearing can be easily slid onto the shaft. Appropriate electric-heat bearing mounting devices include induction heaters, ovens, hot plates and heating cones. Of these, induction heaters and ovens are the most convenient and are the fastest devices to use. Hot oil baths have traditionally been used to heat bearings, but are no longer recommended except when unavoidable. In addition to health and safety considerations are the environmental issues about oil disposal, which can become costly. The risk of contamination to the bearing is also much greater.

If hot oil bath is used, both the oil and the container must be absolutely clean. Oil previously used for some other purpose should be thoroughly filtered. Quenching oil having a minimum flash point of 300° F, transformer oil, or 10% to 15% water soluble oil, are satisfactory heating mediums. When using an oil bath, temperature monitoring is

important not only to prevent bearing damage, but also to prevent the oil from reaching flash point. The quantity of oil used in a bath should be plentiful in relation to the volume of the bearing. An insufficient guantity heats and cools too rapidly, introducing the risk of inadequately or unevenly heating the bearing. It is also difficult in such a case to determine when and if the bearing has reached the same temperature as the oil. To avoid hot spots on the bearing, it is good practice to install a rack at the bottom of the bath. Sufficient time should be allowed for the entire bearing to reach the correct temperature. The bath should completely cover the bearing.

Heating the housing

The bearing housing may require heating in cases where the bearing outer ring is mounted with an interference fit. Since the outer ring is usually mounted with a lighter interference fit, the temperature difference required is usually less than that required for an inner ring. A bearing housing may be heated in several ways. If the size of the housing bore permits, an inspection lamp can be inserted. The heat from the lamp usually is sufficient to produce the desired expansion. In some cases the shape and size of the housing allow the use of an electric furnace, but in other cases a hot oil bath is necessary.

Mounting bearings with a tapered bore

Tapered bore bearings, such as double row self-aligning ball bearings, CARB® toroidal roller bearings, spherical roller bearings, and high-precision cylindrical roller bearings, will always be mounted with an interference fit. The degree of interference is not determined by the chosen shaft tolerance, as with bearings having a cylindrical bore, but by how far the bearing is driven up onto the tapered seat, i.e onto the shaft, adapter, or withdrawal sleeve.

As the bearing is driven up the tapered seat, its inner ring expands and its radial internal clearance is reduced. During the mounting procedure, the reduction in radial internal clearance or the axial drive-up onto the tapered seating is determined and used as a measure of the degree of interference and the proper fit.

Drive-up is achieved with a force of sufficient magnitude applied directly to the face

of the inner ring. This force is generated with one of the following devices:

- 1. Threaded lock nut
- 2. Bolted end plate
- 3. Hydraulic nut
- 4. Mounting sleeve

Cold Mounting

The mounting of any tapered bore bearing is affected by driving the bearing on its seat a suitable amount. Since the amount of drive-up is critical to determining the amount of interference, cold mounting is typically the most common method used for mounting tapered bore bearings. Accurately controlling the axial position of the inner ring is very difficult with hot mounting.

Oil-injection (hydraulic) mounting

This is a refined method for cold mounting a tapered bore bearing. It is based on the injection of oil between the interfering surfaces, thus greatly reducing the required axial mounting force. The pressure is generally supplied with a manually-operated reciprocating pump. The required pressure seldom exceeds 10,000 psi, and is usually much less. The oil used for oil-injection mounting should be neither too thin nor too viscous. It is difficult to build up pressures with excessively thin oils, while thick oils do not readily drain from between the fitting surfaces and require a little more axial force for positioning the bearing. This method cannot be used unless provided for in the design of the mounting. (Contact SKF for retrofitting details.)

Mounting tapered bore double row self-aligning ball bearings


Most tapered bore self-aligning ball bearings are mounted with the use of adapter sleeves. Therefore, this instruction will be limited to adapter sleeves only.

Precautions

For hollow shafts, please consult SKF Applications Engineering. The bearings should be left in their original packages until immediately before mounting so they do not become dirty. The dimensional and form accuracy of all components, which will be in contact with the bearing, should be checked.

Step 1

Remove any burrs or rust on the shaft with an emery cloth or a fine file.

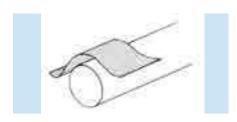

Step 2
Wipe the shaft with a clean cloth.




Step 3
Measure the shaft diameter.

Shaft tolerance limits for adapter mounting seatings

Nor inch ove		Tolerance limits inch
1/ 1 2 4 6	2 1 2 4 6	0.000 / -0.002 0.000 / -0.003 0.000 / -0.004 0.000 / -0.005 0.000 / -0.006

Step 4

Screw off the nut from the adapter sleeve assembly and remove the locking washer.

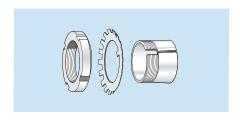


Step 5

Wipe preservative from the adapter 0. D. and bore. Remove oil from the shaft to prevent transfer of oil to the bore of the adapter sleeve.



Step 6

Position the adapter sleeve on the shaft, threads outboard as indicated, to the approximate location with respect to required bearing centerline. For easier positioning of the sleeve, a screwdriver can be placed in the slit to open the sleeve. Applying a light oil to the sleeve outside diameter surface results in easier bearing mounting and removal.

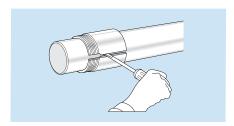


Step 7

Wipe the preservative from the bore of the bearing. It may not be necessary to remove the preservative from the internal components of the bearing unless the bearing will be lubricated by a circulating oil or oil mist system.



Step 8

Place the bearing on the adapter sleeve, leading with the large bore of the inner ring to match the taper of the adapter. Apply the locknut with its chamfer facing the bearing (DO NOT apply locking washer at this time because the drive-up procedure may damage the locking washer). Applying a light coating of oil to the chamfered face of the lock nut will make mounting easier.

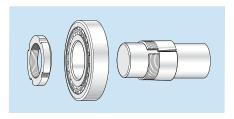

Step 9

Using a spanner wrench, hand-tighten the locknut so that the sleeve grips the shaft and the adapter sleeve can neither be moved axially, nor rotated on the shaft. With the bearing hand tight on the adapter, locate the bearing to the proper axial position on the shaft. A method for checking if the bearing and sleeve are properly clamped is to place a screwdriver in the adapter sleeve split on the large end of the sleeve. Applying pressure to the screwdriver to attempt to turn the sleeve around the shaft is a good check to determine if the sleeve is clamped down properly. If the sleeve no longer turns on the shaft, then the zero point has been reached. Do not drive the bearing up any further.




Step 10

Place a reference mark on the locknut face and shaft, preferably in the 12 o'clock position, to use when measuring the tightening angle.


Step 11

Identify the specific locknut part number on the adapter sleeve to determine if it is an inch or metric assembly and reference either **Table 1** or **Table 2** on page 17. Locate the specific bearing series column and bearing bore diameter row in the applicable table. Select the corresponding tightening angle.

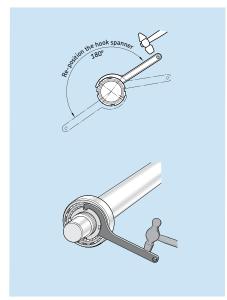


Step 12

Remove the locknut and install the locking washer on the adapter sleeve. The inner prong of the locking washer should face the bearing and be located in the slot of the adapter sleeve. Reapply the locknut until tight. (DO NOT drive the bearing further up the taper, as this will reduce the radial internal clearance further).

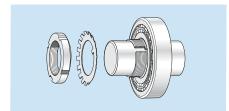


Step 13


Find the locking washer tang that is nearest a locknut slot. If the slot is slightly past the tang don't loosen the nut, but instead tighten it to meet the closest locking washer tang. Do not bend the locking tab to the bottom of the locknut slot.

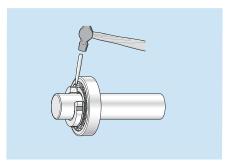

Step 14

Check that the shaft and outer ring can be rotated easily by hand.

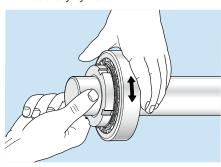

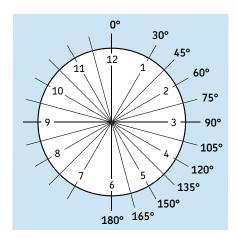

The angles of degree correlate to the hours on a clock. Use this guide to help visualize the turning angles shown on Tables 1 and 2.

									Ta
Angular driv	ve-up for self-aligning	ball bearings (n	netric nut)						
Bearing bore diameter d	Metric nut designation	Axial drive bearing se 12 K s		22 K s	23 K s	Turning a bearing s 12 K		22 K	23 K
(mm)		(mm)	(mm)	(mm)	(mm)	(deg)	(deg)	(deg)	(deg)
25	KM(FE) 5	0.22	0.23	0.22	0.23	55	55	55	55
30	KM(FE) 6	0.22	0.23	0.22	0.23	55	55	55	55
35	KM(FE) 7	0.30	0.30	0.30	0.30	70	70	70	70
40	KM(FE) 8	0.30	0.30	0.30	0.30	70	70	70	70
45	KM(FE) 9	0.31	0.34	0.31	0.33	75	80	75	80
50	KM(FE) 10	0.31	0.34	0.31	0.33	75	80	75	80
55	KM(FE) 11	0.40	0.41	0.39	0.40	70	75	70	75
60	KM(FE) 12	0.40	0.41	0.39	0.40	70	75	70	75
65	KM(FE) 13	0.40	0.41	0.39	0.40	70	75	70	75
70	KM(FE) 14	-	-	-	-	-	-	-	-
75	KM(FE) 15	0.45	0.47	0.43	0.46	80	85	75	85
80	KM(FE) 16	0.45	0.47	0.43	0.60	80	85	75	85
85	KM(FE) 17	0.58	0.60	0.54	0.59	105	110	95	110
90	KM(FE) 18	0.58	0.60	0.54	0.59	105	110	95	110
95	KM(FE) 19	0.58	0.60	0.54	-	105	110	95	105
100	KM(FE) 20	0.58	0.60	0.54	0.59	105	110	95	110
105	KM(FE) 21	-	-	-	-	-	-	-	_
110	KM(FE) 22	0.67	0.70	0.66	0.69	120	125	120	125

bore	Inch nut designation	Threads per inch	Axial drive-up bearing series	42.14	22.14	22.14	Turning a bearing s	eries	22.14	22
diameter d			12 K	13 K s	22 K s	23 K s	12 K	13 K	22 K	23
(mm)			(inch)	(inch)	(inch)	(inch)	(deg)	(deg)	(deg)	(de
25	N 05	32	0.009	0.009	0.009	0.009	100	100	100	100
30	N 06	18	0.009	0.009	0.009	0.009	55	55	55	55
35	N 07	18	0.012	0.012	0.012	0.012	75	75	75	75
40	N 08	18	0.012	0.012	0.012	0.012	75	75	75	75
45	N 09	18	0.012	0.013	0.012	0.013	80	85	80	85
50	N 10	18	0.012	0.013	0.012	0.013	80	85	80	85
55	N 11	18	0.016	0.016	0.015	0.016	100	85	80	85
60	N 12	18	0.016	0.016	0.015	0.016	100	105	100	105
65	N 13	18	0.016	0.016	0.015	0.016	100	105	100	105
70	N 14	-	-	-	-	-	-	-	-	-
75	AN 15	12	0.018	0.019	0.017	0.018	75	85	75	85
80	AN 16	12	0.018	0.019	0.017	0.024	75	85	75	85
85	AN 17	12	0.023	0.024	0.021	0.023	100	100	90	100
90	AN 18	12	0.023	0.024	0.021	0.023	100	100	90	100
95	AN 19	12	0.023	0.024	0.021	0.023	100	100	90	-
100	AN 20	12	0.023	0.024	0.021	0.023	100	100	90	100
105	AN 21	-	_	-	-	_	-	-	-	-

Mounting tapered bore spherical roller bearings

Tapered bore spherical roller bearings can be mounted using one of three methods: radial clearance reduction, angular drive-up, or axial / SKF hydraulic drive-up. All three methods require the inner ring to be driven up a tapered seat in order to achieve the proper interference fit. The specific method selected by the end user will be dependent upon the size of the bearing, the number of bearings to be mounted, and the space constraints in the area surrounding the bearing.


Radial clearance reduction method for mounting tapered bore (1:12) spherical roller bearings on adapter sleeves

Precautions

For hollow shafts, please consult SKF Applications Engineering. The bearings should be left in their original packages until immediately before mounting so they do not become dirty. The dimensional and form accuracy of all components, which will be in contact with the bearing, should be checked.

Step 1

Remove any burrs or rust on the shaft with an emery cloth or a fine file.

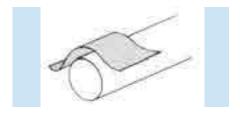

Step 2
Wipe the shaft with a clean cloth.



Step 3


Measure the shaft diameter.

Shaft tolerance limits for adapter mounting seatings

Nominal diameter inch over including 1/2 1 0.000 / -0.002 1 2 0.000 / -0.003 2 4 0.000 / -0.004			
1 2 0.000/-0.003	inch		
4 6 0.000 / -0.005 6 - 0.000 / -0.006	1 2 4	2 4	0.000 / -0.003 0.000 / -0.004 0.000 / -0.005


Step 4

Screw off the nut from the adapter sleeve assembly and remove the locking washer.

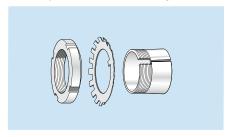


Step 5

Wipe preservative from the adapter O. D. and bore. Remove oil from the shaft to prevent transfer of oil to the bore of the adapter sleeve.

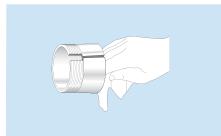

Step 6

Position the adapter sleeve on the shaft, threads outboard as indicated, to the approximate location with respect to required bearing centerline. For easier positioning of the sleeve, a screwdriver can be placed in the slit to open the sleeve. Applying a light oil to the sleeve outside diameter surface results in easier bearing mounting and removal.

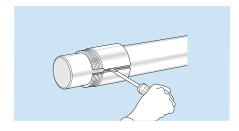

Step 7

Wipe the preservative from the bore of the bearing. It may not be necessary to remove the preservative from the internal components of the bearing unless the bearing will be lubricated by a circulating oil or oil mist system.




Step 8

Measure the unmounted radial internal clearance in the bearing. The values for unmounted internal clearance for tapered bore spherical roller bearings are provided in **Table 3** on page 20.


Oscillate the inner ring in a circumferential direction to properly seat the rollers. Measure the radial internal clearance in the bearing by inserting progressively larger feeler blades the full length of the roller between the most unloaded roller and the outer ring sphere. **NOTE:** Do not roll completely over a pinched feeler blade, slide through the clearance. It is permissible to rotate a roller up onto the feeler blade but be sure it slides out of the contact area with a slight resistance. Record the measurement on the largest size blade that will slide through. This is the unmounted radial internal clearance.

Repeat this procedure in two or three other locations by resting the bearing on a different spot on its O.D. and measuring over different rollers in one row. Repeat the above procedure for the other row of rollers or measure each row alternately in the procedure described above.

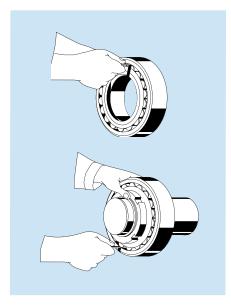

Step 9

Place the bearing on the adapter sleeve, leading with the large bore of the inner ring to match the taper of the adapter. Apply the locknut with its chamfer facing the bearing (DO NOT apply the locking washer at this time because the drive-up procedure may damage the locking washer). Applying a light coating of oil to the chamfered face of the lock nut will make mounting easier.

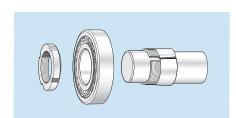


Step 10

Using a spanner wrench, hand-tighten the locknut so that the sleeve grips the shaft and the adapter sleeve can neither be moved axially nor rotated on the shaft. With the bearing hand tight on the adapter, locate the bearing to the proper axial position on the shaft.




Step 11

Select the proper radial internal clearance reduction range from **Table 3** on page 20. Using a hammer and a spanner wrench or just a hydraulic nut, begin tightening the nut in order to drive the inner ring up the tapered seat until the appropriate clearance reduction is achieved. NOTE: LARGE SIZE BEARINGS WILL REQUIRE A HEAVY DUTY IMPACT SPANNER WRENCH AND SLEDGE HAMMER TO OBTAIN THE REQUIRED REDUCTION IN RADIAL INTERNAL CLEAR-ANCE. AN SKF HYDRAULIC NUT MAKES MOUNTING OF LARGE SIZE BEARINGS EASIER. Do not attempt to tighten the locknut with hammer and drift. The locknut will be damaged and chips can enter the bearing.

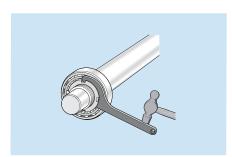


Step 12

Remove the locknut and install the locking washer on the adapter sleeve. The inner prong of the locking washer should face the bearing and be located in the slot of the adapter sleeve. Reapply the locknut until tight. (DO NOT drive the bearing further up the taper, as this will reduce the radial internal clearance further).

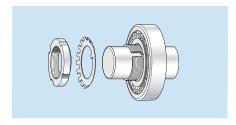


Step 13

Find the locking washer tang that is nearest a locknut slot. If the slot is slightly past the tang don't loosen the nut, but instead tighten it to meet the closest locking washer tang. Do not bend the locking tab to the bottom of the locknut slot.

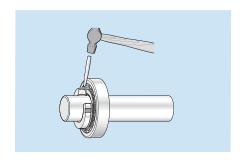

Step 14 Check that the shaft and outer ring can be

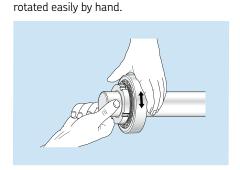

Bore diameter range (mm) 24	Normal (in.) min 0.0012 0.0014 0.0018 0.0022 0.0028 0.0031 0.0039 0.0047 0.0051 0.0055 0.0063 0.0071	0.0016 0.0020 0.0024 0.0030 0.0037 0.0043 0.0053 0.0063 0.0071 0.0079 0.0087	C3 (in.) min 0.0016 0.002 0.0024 0.003 0,0037 0.0043 0.0053 0.0063 0.0071 0.0079 0.0087	0.0022 0.0026 0.0031 0.0037 0.0047 0.0055 0.0067 0.0079 0.0091 0.0102 0.0114	C4 (in.) min 0.0022 0.0026 0.0031 0.0037 0.0047 0.0055 0.0067 0.0079 0.0091 0.0102 0.0114	0.0030 0.0033 0.0039 0.0047 0.0059 0.0071 0.0087 0.0102 0.0118 0.0134 0.0146	(in.) min 0.0004 0.0006 0.0008 0.0010 0.0014 0.0016 0.0020 0.0025 0.0030 0.0030	0.0006 0.0008 0.0010 0.0014 0.0016 0.0020 0.0025 0.0035 0.0040
24 30 31 40 41 50 51 65 66 80 81 100 101 120 121 140 141 160 161 180 181 200 201 225 226 250 251 280 281 315	0.0012 0.0014 0.0018 0.0022 0.0028 0.0031 0.0039 0.0047 0.0051 0.0055 0.0063	0.0016 0.0020 0.0024 0.0030 0.0037 0.0043 0.0053 0.0063 0.0071 0.0079 0.0087	0.0016 0.002 0.0024 0.003 0,0037 0.0043 0.0053 0.0063 0.0071 0.0079	0.0022 0.0026 0.0031 0.0037 0.0047 0.0055 0.0067 0.0079 0.0091 0.0102	0.0022 0.0026 0.0031 0.0037 0.0047 0.0055 0.0067 0.0079 0.0091	0.0030 0.0033 0.0039 0.0047 0.0059 0.0071 0.0087 0.0102 0.0118 0.0134	0.0004 0.0006 0.0008 0.0010 0.0014 0.0016 0.0020 0.0025 0.0030 0.0030	0.0006 0.0008 0.0010 0.0014 0.0016 0.0020 0.0025 0.0035
31 40 41 50 51 65 66 80 81 100 101 120 121 140 141 160 161 180 181 200 201 225 226 250 251 280 281 315	0.0014 0.0018 0.0022 0.0028 0.0031 0.0039 0.0047 0.0051 0.0055 0.0063	0.0020 0.0024 0.0030 0.0037 0.0043 0.0053 0.0063 0.0071 0.0079 0.0087	0.002 0.0024 0.003 0,0037 0.0043 0.0053 0.0063 0.0071	0.0026 0.0031 0.0037 0.0047 0.0055 0.0067 0.0079 0.0091 0.0102	0.0026 0.0031 0.0037 0.0047 0.0055 0.0067 0.0079 0.0091 0.0102	0.0033 0.0039 0.0047 0.0059 0.0071 0.0087 0.0102 0.0118 0.0134	0.0006 0.0008 0.0010 0.0014 0.0016 0.0020 0.0025 0.0030 0.0030	0.0008 0.0010 0.0014 0.0016 0.0020 0.0025 0.0030 0.0035
41 50 51 65 66 80 81 100 101 120 121 140 141 160 161 180 181 200 201 225 226 250 251 280 281 315	0.0018 0.0022 0.0028 0.0031 0.0039 0.0047 0.0051 0.0055 0.0063	0.0024 0.0030 0.0037 0.0043 0.0053 0.0063 0.0071 0.0079 0.0087	0.0024 0.003 0,0037 0.0043 0.0053 0.0063 0.0071 0.0079	0.0031 0.0037 0.0047 0.0055 0.0067 0.0079 0.0091 0.0102	0.0031 0.0037 0.0047 0.0055 0.0067 0.0079 0.0091 0.0102	0.0039 0.0047 0.0059 0.0071 0.0087 0.0102 0.0118 0.0134	0.0008 0.0010 0.0014 0.0016 0.0020 0.0025 0.0030	0.0010 0.0014 0.0016 0.0020 0.0025 0.0030 0.0035
51 65 66 80 81 100 101 120 121 140 141 160 161 180 181 200 201 225 226 250 251 280 281 315	0.0022 0.0028 0.0031 0.0039 0.0047 0.0051 0.0055 0.0063	0.0030 0.0037 0.0043 0.0053 0.0063 0.0071 0.0079 0.0087	0.003 0,0037 0.0043 0.0053 0.0063 0.0071 0.0079	0.0037 0.0047 0.0055 0.0067 0.0079 0.0091 0.0102	0.0037 0.0047 0.0055 0.0067 0.0079 0.0091 0.0102	0.0047 0.0059 0.0071 0.0087 0.0102 0.0118 0.0134	0.0010 0.0014 0.0016 0.0020 0.0025 0.0030 0.0030	0.0014 0.0016 0.0020 0.0025 0.0030 0.0035
66 80 81 100 101 120 121 140 141 160 161 180 181 200 201 225 226 250 251 280 281 315	0.0028 0.0031 0.0039 0.0047 0.0051 0.0055 0.0063	0.0037 0.0043 0.0053 0.0063 0.0071 0.0079 0.0087	0,0037 0.0043 0.0053 0.0063 0.0071 0.0079	0.0047 0.0055 0.0067 0.0079 0.0091 0.0102	0.0047 0.0055 0.0067 0.0079 0.0091 0.0102	0.0059 0.0071 0.0087 0.0102 0.0118 0.0134	0.0014 0.0016 0.0020 0.0025 0.0030 0.0030	0.0016 0.0020 0.0025 0.0030 0.0035
81 100 101 120 121 140 141 160 161 180 181 200 201 225 226 250 251 280 281 315	0.0031 0.0039 0.0047 0.0051 0.0055 0.0063	0.0043 0.0053 0.0063 0.0071 0.0079 0.0087	0.0043 0.0053 0.0063 0.0071 0.0079	0.0055 0.0067 0.0079 0.0091 0.0102	0.0055 0.0067 0.0079 0.0091 0.0102	0.0071 0.0087 0.0102 0.0118 0.0134	0.0016 0.0020 0.0025 0.0030 0.0030	0.0020 0.0025 0.0030 0.0035
101 120 121 140 141 160 161 180 181 200 201 225 226 250 251 280 281 315	0.0039 0.0047 0.0051 0.0055 0.0063 0.0071	0.0053 0.0063 0.0071 0.0079 0.0087	0.0053 0.0063 0.0071 0.0079	0.0067 0.0079 0.0091 0.0102	0.0067 0.0079 0.0091 0.0102	0.0087 0.0102 0.0118 0.0134	0.0020 0.0025 0.0030 0.0030	0.0025 0.0030 0.0035
121 140 141 160 161 180 181 200 201 225 226 250 251 280 281 315	0.0047 0.0051 0.0055 0.0063 0.0071	0.0063 0.0071 0.0079 0.0087	0.0063 0.0071 0.0079	0.0079 0.0091 0.0102	0.0079 0.0091 0.0102	0.0102 0.0118 0.0134	0.0025 0.0030 0.0030	0.0030 0.0035
141 160 161 180 181 200 201 225 226 250 251 280 281 315	0.0051 0.0055 0.0063 0.0071	0.0071 0.0079 0.0087	0.0071 0.0079	0.0091 0.0102	0.0091 0.0102	0.0118 0.0134	0.0030 0.0030	0.0035
161 180 181 200 201 225 226 250 251 280 281 315	0.0055 0.0063 0.0071	0.0079 0.0087	0.0079	0.0102	0.0102	0.0134	0.0030	
181 200 201 225 226 250 251 280 281 315	0.0063 0.0071	0.0087						0.0040
201 225 226 250 251 280 281 315	0.0071		0.0087	0.0114	0.0114	0.0146	0.0005	
226 250 251 280 281 315		0.0098				0.0140	0.0035	0.0045
251 280 281 315			0.0098	0.0126	0.0126	0.0161	0.0040	0.0050
281 315	0.0079	0.0106	0.0106	0.0138	0.0138	0.0177	0.0040	0.0050
	0.0087	0.0118	0.0118	0.0154	0.0154	0.0193	0.0050	0.0060
316 355	0.0094	0.0130	0.013	0.0169	0.0169	0.0213	0.0055	0.0065
	0.0106	0.0142	0.0142	0.0185	0.0185	0.0232	0.0060	0.0070
356 400	0.0118	0.0157	0.0157	0.0205	0.0205	0.0256	0.0070	0.0080
401 450	0.0130	0.0173	0.0173	0.0224	0.0224	0.0283	0.0080	0.0090
451 500	0.0146	0.0193	0.0193	0.0248	0.0248	0.0311	0.0085	0.0105
501 560	0.0161	0.0213	0.0213	0.0268	0.0268	0.0343	0.0100	0.0120
561 630	0.0181	0.0236	0.0236	0.0299	0.0299	0.0386	0.0110	0.0130
631 710	0.0201	0.0264	0.0264	0.0335	0.0335	0.0429	0.0120	0.0150
711 800	0.0224	0.0295	0.0295	0.0378	0.0378	0.0480	0.0140	0.0170
801 900	0.0252	0.0331	0.0331	0.0421	0.0421	0.0539	0.0160	0.0190
901 1000			0.0366	0.0469	0.0469	0.0598	0.0170	0.0210
1001 1120			0.0406	0.0512	0.0512	0.0657	0.0190	0.0235
1121 1250			0.0441	0.0559	0.0559	0.0720	0.0220	0.0265

^{1.} CAUTION: Do not use the maximum reduction of radial internal clearance when the initial unmounted radial internal clearance is in the lower half of the tolerance range or where large temperature differentials between the bearing rings can occur in operation.

NOTE: If a different taper angle or shaft system is encountered, the following guidelines can be used. The axial drive-up "S" is approximately:

• 16 times the reduction on 1:12 solid tapered steel shafts

• 18 times the reduction on 1:30 solid tapered steel shafts

• 39 times the reduction on 1:30 solid tapered steel shafts


• 42 times the reduction on 1:30 taper for sleeve mounting

Radial clearance reduction method for mounting tapered bore (1:12) spherical roller bearings onto a solid tapered shaft

Precautions

For hollow shafts, please consult SKF Applications Engineering. The bearings should be left in their original packages until immediately before mounting so they do not become dirty. The dimensional and form accuracy of all components, which will be in contact with the bearing, should be checked.


Step 1Remove any burrs or rust on the shaft with an emery cloth or a fine file.

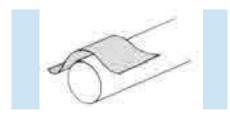

Step 2
Wipe the shaft with a clean cloth.



Step 3Measure the shaft taper for geometry and contact using taper gauges.

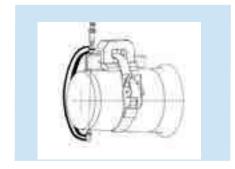

Step 4

Wipe the preservative from the bore of the bearing. It may not be necessary to remove the preservative from the internal components of the bearing unless the bearing will be lubricated by a circulating oil or oil mist system.




Step 5

Measure the unmounted radial internal clearance in the bearing. The values for unmounted internal clearance for tapered bore spherical roller bearings are provided in **Table 3** on page 20.


Oscillate the inner ring in a circumferential direction to properly seat the rollers. Measure the radial internal clearance in the bearing by inserting progressively larger feeler blades the full length of the roller between the most unloaded roller and the outer ring sphere. NOTE: Do not roll completely over a pinched feeler blade, slide through the clearance. It is permissible to rotate a roller up onto the feeler blade but be sure it slides out of the contact area with a slight resistance. Record the measurement on the largest size blade that will slide through. This is the unmounted radial internal clearance.

Repeat this procedure in two or three other locations by resting the bearing on a different spot on its O.D. and measuring over different rollers in one row. Repeat the above procedure for the other row of rollers or measure each row alternately in the procedure described above.

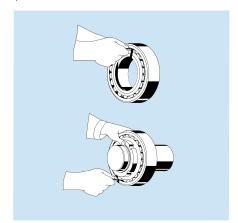


Step 6

Place the bearing on the tapered shaft, leading with the large bore of the inner ring to match the taper of the shaft. Apply the locknut with its chamfer facing the bearing (DO NOT apply the locking washer at this time because the drive-up procedure may damage the locking washer). Applying a light coating of oil to the chamfered face of the lock nut will make mounting easier.

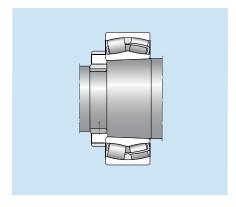


Step 7

Select the proper radial internal clearance reduction range from **Table 3** on page 20. Using a hammer and a spanner wrench or just a hydraulic nut, begin tightening the nut in order to drive the inner ring up the tapered shaft until the appropriate clearance reduction is achieved. NOTE: LARGE SIZE BEARINGS WILL REQUIRE A HEAVY DUTY IMPACT SPANNER WRENCH AND SLEDGE HAMMER TO OBTAIN THE REQUIRED REDUCTION IN RADIAL INTER-NAL CLEARANCE. AN SKF HYDRAULIC NUT MAKES MOUNTING OF LARGE SIZE BEAR-INGS EASIER. Do not attempt to tighten the locknut with a hammer and drift. The locknut will be damaged and chips can enter the bearing.

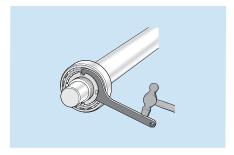


Step 8

Remove the locknut and install the locking washer on the shaft. The inner prong of the locking washer should face the bearing and be located in the keyway. Reapply the locknut until tight. (DO NOT drive the bearing further up the taper, as this will reduce the radial internal clearance further).

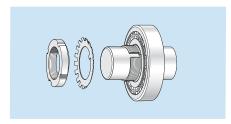


Step 9

Find the locking washer tang that is nearest a locknut slot. If the slot is slightly past the tang don't loosen the nut, but instead tighten it to meet the closest locking washer tang. Do not bend the locking tab to the bottom of the locknut slot.

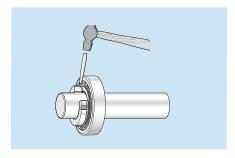

Step 10 Check that the shaft and outer ring can be

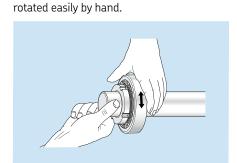

Angular drive-up method for mounting tapered bore (1:12) spherical roller bearings on an adapter sleeve


The angular drive-up method simplifies the mounting process by equating axial drive up to the rotation of a locknut. By knowing the threads per inch of a locknut, the number of rotations to achieve a specific axial movement can be determined. In order to make this mounting method work properly, the starting point is important since that is the reference point to determine when to start counting the rotation of the locknut.

Precautions

The bearings should be left in their original packages until immediately before mounting so they do not become dirty. The dimensional and form accuracy of all components, which will be in contact with the bearing, should be checked.

Step 1

Remove any burrs or rust on the shaft with an emery cloth or a fine file.

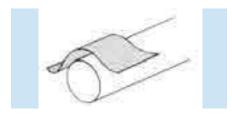

Step 2
Wipe the shaft with a clean cloth.



Step 3


Measure the shaft diameter.

Shaft tolerance limits for adapter mounting seatings

Nomin inch over	al diameter	Tolerance limits inch
1/2 1 2 4 6	1 2 4 6	0.000 / -0.002 0.000 / -0.003 0.000 / -0.004 0.000 / -0.005 0.000 / -0.006

Step 4

Screw off the nut from the adapter sleeve assembly and remove the locking washer.

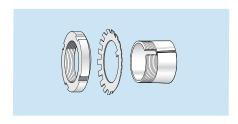


Step 5

Wipe preservative from the adapter O. D. and bore. Remove oil from the shaft to prevent transfer of oil to the bore of the adapter sleeve.



Step 6

Position the adapter sleeve on the shaft, threads outboard as indicated, to the approximate location with respect to required bearing centerline. For easier positioning of the sleeve, a screwdriver can be placed in the slit to open the sleeve. Applying a light oil to the sleeve outside diameter surface results in easier bearing mounting and removal.

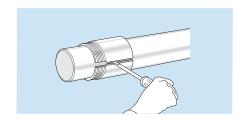


Step 7

Wipe the preservative from the bore of the bearing. It may not be necessary to remove the preservatives from the internal components of the bearing unless the bearing will be lubricated by a circulating oil or oil mist system.



Step 8

Place the bearing on the adapter sleeve, leading with the large bore of the inner ring to match the taper of the adapter. Apply the locknut with its chamfer facing the bearing (DO NOT apply the locking washer at this time because the drive-up procedure may damage the locking washer). Applying a light coating of oil to the chamfered face of the lock nut will make mounting easier.

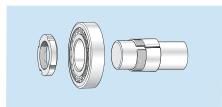

Step 9

Using a spanner wrench, hand-tighten the locknut so that the sleeve grips the shaft and the adapter sleeve can neither be moved axially, nor rotated on the shaft. With the bearing hand tight on the adapter, locate the bearing to the proper axial position on the shaft. A method for checking if the bearing and sleeve are properly clamped is to place a screwdriver in the adapter sleeve split on the large end of the sleeve. Applying pressure to the screwdriver to attempt to turn the sleeve around the shaft is a good check to determine if the sleeve is clamped down properly. If the sleeve no longer turns on the shaft, then the zero point has been reached. Do not drive the bearing up any further.



Step 10


Place a reference mark on the locknut face and shaft, preferably in the 12 o'clock position, to use when measuring the tightening angle.

Step 11

Locate the specific bearing part number in **Table 4** on page 24. Note the specific lock nut part number on the adapter sleeve to determine if it is an inch or metric assembly. Once the appropriate locknut part number has been obtained, select the corresponding tightening angle from **Table 4**.


Step 12

Using a hammer and a spanner wrench, begin tightening the locknut the corresponding tightening angle. **NOTE:** LARGE SIZE BEARINGS WILL REQUIRE A HEAVY DUTY IMPACT SPANNER WRENCH AND SLEDGE HAMMER TO OBTAIN THE REQUIRED REDUCTION IN RADIAL INTERNAL CLEARANCE. Do not attempt to tighten the locknut with hammer and drift. The locknut will be damaged and chips can enter the bearing.

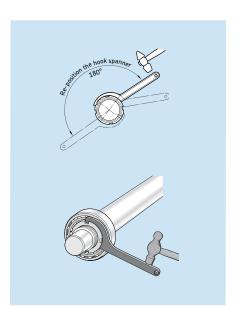


Step 13

Remove the locknut and install the locking washer on the adapter sleeve. The inner prong of the locking washer should face the bearing and be located in the slot of the adapter sleeve. Reapply the locknut until tight. (DO NOT drive the bearing further up the taper, as this will reduce the radial internal clearance further).

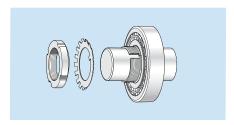

Step 14

Find the locking washer tang that is nearest a locknut slot. If the slot is slightly past the tang don't loosen the nut, but instead tighten it to meet the closest locking washer tang. Do not bend the locking tab to the bottom of the locknut slot.

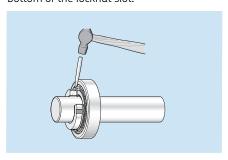

Step 15 Check that the shaft and outer ring can be rotated easily by hand.


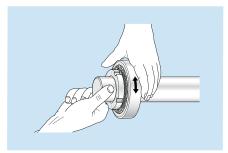


Table 4

Angular drive-up for spherical roller bearings (metric and inch nuts)

Bearing designation	Bearing bore diameter	Axial drive-up	Metric nut designation	Turning angle	Inch i desig	nut nation	Turning angle	
	d	S		a			a	
	(mm)	(mm)		(degrees)			(degrees)	
222xx series								
22206 K	30	0.30	KM(FE) 6	110	Ν	06	115	
22207 K	35	0.35	KM(FE) 7	115	Ν	07	120	
22208 K	40	0.35	KM(FE) 8	125	Ν	08	135	
22209 K	45	0.40	KM(FE) 9	130	Ν	09	140	
22210 K	50	0.40	KM(FE) 10	140	Ν	10	150	
22211 K	55	0.45	KM(FE) 11	110	Ν	11	155	
22212 K	60	0.45	KM(FE) 12	115	Ν	12	165	
22213 K	65	0.45	KM(FE) 13	120	Ν	13	170	
22214 K	70	0.60	KM(FE) 14	130	Ν	14	175	
22215 K	75	0.60	KM(FE) 15	135	AN	15	120	
22216 K	80	0.60	KM(FE) 16	140	AN	16	130	
22217 K	85	0.70	KM(FE) 17	145	AN	17	135	
22218 K	90	0.70	KM(FE) 18	150	AN	18	145	
22219 K	95	0.70	KM(FE) 19	155	AN	19	145	
22220 K	100	0.70	KM(FE) 20	160	AN	20	150	
22222 K	110	0.75	KM(FE) 22	175	AN	22	160	
22224 K	120	0.75	KM 24	185	AN	24	170	
223xx series								
22308 K	40	0.35	KM(FE) 8	125	Ν	08	135	
22309 K	45	0.40	KM(FE) 9	135	Ν	09	140	
22310 K	50	0.40	KM(FE) 10	145	Ν	10	150	
22311 K	55	0.45	KM(FE) 11	115	Ν	11	155	
22312 K	60	0.45	KM(FE) 12	120	Ν	12	165	
22313 K	65	0.45	KM(FE) 13	125	Ν	13	170	
22314 K	70	0.60	KM(FE) 14	135	Ν	14	175	
22315 K	75	0.60	KM(FE) 15	135	AN	15	120	
22316 K	80	0.60	KM(FE) 16	145	AN	16	130	
22317 K	85	0.70	KM(FE) 17	150	AN	17	135	
22318 K	90	0.70	KM(FE) 18	155	AN	18	145	
22319 K	95	0.70	KM(FE) 19	165	AN	19	145	
22320 K	100	0.70	KM(FE) 20	170	AN	20	150	
22322 K	110	0.75	KM(FE) 22	185	AN	22	160	
22324 K	120	0.75	KM 24	195	AN	24	170	

Drive up and angular rotation values are the same for both CC and E design SKF spherical roller bearings. For sizes greater than those shown above we recommend the use of the SKF Hydraulic drive-up method. For threads per inch see **Table 2** (page 17).

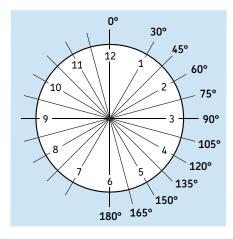

The angles of degree correlate to the hours on a clock. Use this guide to help visualize the turning angles shown on Table 4.

SKF hydraulic (axial) drive-up method for tapered bore (1:12) spherical roller bearings on an adapter sleeve

The axial drive-up method relies on the bearing being driven up a tapered seat a specific amount to ensure the inner ring is expanded enough to provide proper clamping force on the shaft or sleeve. In order for this method to work properly, the starting point is important since that is the reference point to determine when the bearing has been driven up enough. A new method of accurately achieving this starting point has been developed by SKF and is now available. The method incorporates the use of a hydraulic nut fitted with a dial indicator, and a specially calibrated pressure gauge, mounted on the selected pump.

A special hydraulic pressure table providing the required psi pressures must be used for each bearing type (see **Table 5** on page 26). This enables accurate positioning of the bearing at the starting point, where the axial drive-up is measured. This method provides:


- 1. Reduced time to mount bearings.
- 2. A reliable, safe and accurate method of clearance adjustment.
- 3. Ideal way to mount sealed spherical roller bearings.

Precautions

For hollow shafts, please consult SKF Applications Engineering. The bearings should be left in their original packages until immediately before mounting so they do not become dirty. The dimensional and form accuracy of all components, which will be in contact with the bearing, should be checked.

Step 1

Remove any burrs or rust on the shaft with an emery cloth or a fine file.

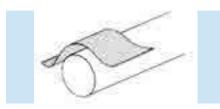

Step 2
Wipe the shaft with a clean cloth.




Step 3 Measure the shaft diameter.

Shaft tolerance limits for adapter mounting seatings

Nomini inch over	nal diameter including	Tolerance limits inch
1/2 1 2 4 6	1 2 4 6	0.000 / -0.002 0.000 / -0.003 0.000 / -0.004 0.000 / -0.005 0.000 / -0.006


Step 4

Remove the locknut and locking washer from the adapter sleeve assembly.

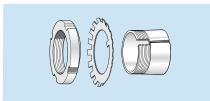


Step 5

Wipe preservative from the adapter O. D. and bore. Remove oil from the shaft to prevent transfer of oil to the bore of the adapter sleeve.

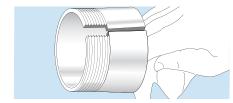

Step 6

Position the adapter sleeve on the shaft, threads outboard as indicated, to the approximate location with respect to required bearing centerline. For easier positioning of the sleeve, a screwdriver can be placed in the slit to open the sleeve.

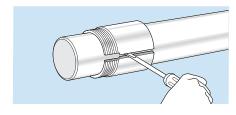


Step 7

Applying a light oil to the sleeve outside diameter surface results in easier bearing mounting and removal. Wipe the preservative from the bore of the bearing. It may not be necessary to remove the preservative from the internal components of the bearing unless the bearing will be lubricated by a circulating oil or oil mist system.




Step 8

Place the bearing on the adapter sleeve, leading with the large bore of the inner ring to match the taper of the adapter. Apply the hydraulic nut (DO NOT apply the locking washer at this time). Ensure that the bearing bore size is equal to the hydraulic nut. Otherwise, the pressure in the table must be adjusted. Drive the bearing up to the starting position by applying the hydraulic pressure listed in Starting Position 1* in **Table 5** for the specific bearing size being mounted. Monitor the pressure by the gauge on the selected pump. As an alternative, SKF mounting gauge TMJG 100D can be screwed directly into the hydraulic nut.

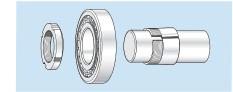


Step 9

Drive the bearing up the adapter sleeve the required distance S_s shown under column heading 1*** of **Table 5**. The axial drive-up is best monitored by a dial indicator.

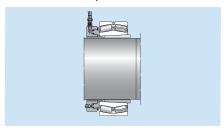


Step 10

Remove the hydraulic nut and install the locking washer on the adapter sleeve. The inner prong of the locking washer should face the bearing and be located in the slot of the adapter sleeve. Reapply the locknut until tight. (DO NOT drive the bearing further up the taper, as this will reduce the radial internal clearance further).

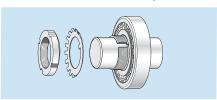

Step 11

Find the locking washer tang that is nearest a locknut slot. If the slot is slightly past the tang don't loosen the nut, but instead tighten it to meet the closest locking washer tang. Do not bend the locking tab to the bottom of the locknut slot.

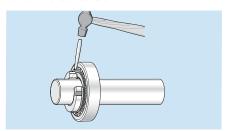

Step 12

Check that the shaft and outer ring can be rotated easily by hand.

Note: For bearings with a bore diameter greater than 200mm, hydraulic assist is recommended in addition to using the hydraulic nut.



Pressure and axial drive-up for spherical roller bearings

3xx series 310 EK 311 EK	1* (psi)		reduction from zero position	from starting position S _s	ng	
310 EK	- ()	2** (psi)	(in.)	1*** (in.)	2**** (in.)	
311 EK	286	-	0.0009	0.0146	_	Zero Starting Final
	215	365	0.0010	0.0154	0.0181	
312 EK	351	600	0.0011	0.0177	0.0205	position position position
313 EK	365	625	0.0012	0.0185	0.0213	
314 EK	386	658	0.0012	0.0205	0.0232	e
315 EK	318	542	0.0013	0.0201	0.0229	S _s
316 EK	319	545	0.0014	0.0209	0.0236	S
317 EK	254	434	0.0015	0.0205	0.0236	4 3
318 EK	270	460	0.0016	0.0225	0.0252	
319 EK	278	476	0.0017	0.0223	0.0260	
320 EK	216	368	0.0017	0.0232	0.0256	
2xx series	210	555	5.0010	3.0227	3.0230	a
210 EK	102	191	0.0009	0.0126	0.0154	u
210 LK 211 EK	104	194	0.0009	0.0120	0.0154	
211 EK 212 EK	139	248	0.0010	0.0142	0.0189	
212 EK 213 EK	168	313	0.0011	0.0154	0.0181	
214 EK	135	244	0.0013	0.0173	0.0201	
215 EK	126	225	0.0013	0.0177	0.0209	
216 EK	146	262	0.0014	0.0189	0.0217	1
217 EK	168	300	0.0015	0.0197	0.0229	b
218 EK	174	318	0.0016	0.0213	0.0240	
219 EK	199	354	0.0017	0.0221	0.0248	
220 EK	212	376	0.0018	0.0229	0.0256	
222 EK	251	452	0.0019	0.0248	0.0276	
224 EK	267	471	0.0021	0.0268	0.0299	
226 EK	284	502	0.0023	0.0284	0.0311	
228 CCK/W33	338	595	0.0025	0.0311	0.0339	
230 CCK/W33	361	634	0.0027	0.0335	0.0362	С
232 CCK/W33	373	731	0.0028	0.0355	0.0382	
234 CCK/W33	402	751	0.0030	0.0374	0.0402	
236 CCK/W33	361	676	0.0032	0.0390	0.0422	
238 CCK/W33	371	706	0.0033	0.0410	0.0437	
240 CCK/W33	389	722	0.0035	0.0433	0.0461	
244 CCK/W33	426	838	0.0039	0.0477	0.0504	
248 CCK/W33	480	938	0.0043	0.0524	0.0552	
252 CCK/W33	470	914	0.0046	0.0559	0.0587	d
256 CCK/W33	428	818	0.0050	0.0595	0.0626	u
260 CCK/W33	419	802	0.0053	0.0634	0.0662	
264 CCK/W33	442	841	0.0057	0.0674	0.0705	
EO 4 COI (WOS	772	041	0.0037	0.0074	0.0703	e

- * Values given valid for HMV (C) E series hydraulic nuts equal to bearing size and with one sliding surface (see Figures b and c). Surfaces lightly oiled with light oil.
- ** Values given valid for HMV (C) E series hydraulic nuts equal to one size smaller than bearing size and two sliding surfaces (see **Figure e**). Surfaces lightly oiled with light oil.
- *** Values given are valid for one sliding surface (see **Figures b** and **c**). Surfaces lightly oiled with light oil.

^{****} Values given are valid for two sliding surfaces (see **Figure e**). Surfaces lightly oiled with light oil. The difference in drive-up between one surface and two surfaces is the result of smoothing.

NOTE: To convert values to mm and MPa mm = in x 25.4 MPA = psi x 0.0069

Table 5 Table 5 Pressure and axial drive-up for spherical roller bearings Pressure and axial drive-up for spherical roller bearings Starting position Starting position Final position Final position Radial clearance SKF bearing Hydraulic Axial drive-up SKF bearing Hydraulic Radial clearance Axial drive-up from starting from starting designation pressure reduction from zero designation pressure reduction from zero position position Sa position position S 1*** (in.) 2**** (in.) 2** (psi) 1* (psi) 2** (psi) 1*** (in.) 2**** (in.) 1* (psi) (in.) (in.) 223xx series 230xx series 22310 EK 270 0.0008 0.0134 0.0162 23022 CCK/W33 157 283 0.0019 0.0240 0.0268 22311 EK 287 532 0.0010 0.0150 0.0181 23024 CCK/W33 0.0021 149 262 0.0260 0.0288 0.0162 0.0189 0.0276 22312 FK 345 616 0.0011 23026 CCK/W33 184 325 0.0023 0.0303 22313 EK 306 570 0.0011 0.0165 0.0193 23028 CCK/W33 175 309 0.0025 0.0295 0.0327 22314 EK 374 674 0.0013 0.0185 0.0217 23030 CCK/W33 180 316 0.0027 0.0319 0.0347 22315 EK 338 608 0.0013 0.0189 0.0217 23032 CCK/W33 180 351 0.0028 0.0335 0.0362 22316 EK 348 624 0.0014 0.0197 0.0225 23034 CCK/W33 194 363 0.0030 0.0351 0.0378 428 0.0213 0.0240 23036 CCK/W33 219 0.0374 0.0406 22317 EK 764 0.0015 409 0.0032 22318 FK 432 787 0.0016 0.0225 0.0256 23038 CCK/W33 215 409 0.0033 0.0394 0.0422 22319 EK 441 784 0.0232 0.0260 23040 CCK/W33 236 0.0418 0.0445 0.0017 438 0.0035 22320 EK 595 1057 0.0018 0.0252 0.0280 23044 CCK/W33 242 476 0.0039 0.0453 0.0485 22322 EK 653 1176 0.0019 0.0272 0.0299 23048 CCK/W33 216 422 0.0043 0.0489 0.0516 22324 CCK/W33 634 1118 0.0021 0.0288 0.0319 23052 CCK/W33 249 484 0.0046 0.0532 0.0559 22326 CCK/W33 686 0.0023 0.0307 23056 CCK/W33 225 431 0.0050 0.0630 1209 0.0335 0.0595 22328 CCK/W33 729 1282 0.0025 0.0331 0.0359 23060 CCK/W33 255 487 0.0053 0.0607 0.0634 22330 CCK/W33 766 1344 0.0027 0.0355 0.0382 23064 CCK/W33 232 442 0.0057 0.0642 0.0670 22332 CCK/W33 747 1465 0.0028 0.0374 0.0402 23068 CCK/W33 267 492 0.0060 0.0682 0.0713 22334 CKK/W33 760 1417 0.0030 0.0390 0.0418 23072 CCK/W33 238 448 0.0064 0.0717 0.0745 22336 CCK/W33 747 1396 0.0032 0.0414 0.0441 23076 CCK/W33 229 419 0.0067 0.0753 0.0780 22338 CCK/W33 738 0.0433 0.0461 0.0796 1405 0.0033 23080 ... K/W33 254 476 0.0071 0.0823 22340 CCK/W33 745 1382 0.0035 0.0457 0.0485 23084 CAK/W33 236 439 0.0074 0.0827 0.0855 22344 CCK/W33 811 1595 0.0039 0.0508 0.0536 23088 CAK/W33 248 450 0.0078 0.0867 0.0894 22348 CCK/W33 808 1581 0.0043 0.0548 0.0575 23092 CAK/W33 249 452 0.0081 0.0906 0.0934 22352 CCK/W33 815 1581 0.0046 0.0591 0.0619 23096 CAK/W33 218 400 0.0085 0.0934 0.0961 22356 CCK/W33 827 1581 0.0050 0.0634 0.0662 231xx series 23120 CCK/W33 206 364 0.0018 0.0225 0.0252 23122 CCK/W33 210 378 0.0019 0.0240 0.0268 23124 CCK/W33 257 454 0.0021 0.0264 0.0295 23126 CCK/W33 239 421 0.0023 0.0280 0.0307 23128 CCK/W33 248 435 0.0025 0.0299 0.0327 23130 CCK/W33 322 564 0.0027 0.0327 0.0355 23132 CCK/W33 328 641 0.0028 0.0343 0.0374 23134 CCK/W33 310 579 0.0030 0.0359 0.0386 23136 CCK/W33 335 626 0.0032 0.0382 0.0410 23138 CCK/W33 363 690 0.0033 0.0402 0.0429 23140 CCK/W33 377 700 0.0035 0.0426 0.0453 23144 CCK/W33 393 773 0.0039 0.0465 0.0492 23148 CCK/W33 378 741 0.0043 0.0500 0.0532 23152 CCK/W33 418 811 0.0046 0.0544 0.0571 23156 CCK/W33 377 721 0.0050 0.0579 0.0607 23160 CCK/W33 409 780 0.0053 0.0619 0.0646 23164 CCK/W33 448 853 0.0057 0.0662 0.0689 23168 CCK/W33 489 900 0.0060 0.0705 0.0733 23172 CACK/W33 473 890 0.0064 0.0745 0.0772 23176 CAK/W33 416 760 0.0067 0.0772 0.0800

^{*} Values given valid for HMV (C) E series hydraulic nuts equal to bearing size and with one sliding surface (see Figures b and c). Surfaces lightly oiled with light oil.

^{**} Values given valid for HMV (C) E series hydraulic nuts equal to one size smaller than bearing size and two sliding surfaces (see **Figure e**). Surfaces lightly oiled with light oil.

^{***} Values given are valid for one sliding surface (see **Figures b** and **c**). Surfaces lightly oiled with light oil.

^{****} Values given are valid for two sliding surfaces (see **Figure e**). Surfaces lightly oiled with light oil. The difference in drive-up between one surface and two surfaces is the result of smoothing.

NOTE: To convert values to mm and MPa mm = in x 25.4 MPA = psi x 0.0069

Table 5 Table 5 Pressure and axial drive-up for spherical roller bearings Pressure and axial drive-up for spherical roller bearings Final position Starting position Starting position Final position Radial clearance Axial drive-up Radial clearance SKF bearing Hydraulic SKF bearing Hydraulic Axial drive-up designation pressure reduction from zero from starting designation pressure reduction from zero from starting position position S. position position S_s 1*** (in.) 1* (psi) 2** (psi) 2**** (in.) 2** (psi) 1*** (in.) 2**** (in.) (in.) 1* (psi) (in.) 232xx series 240xx series 23218 CCK/W33 245 447 0.0016 0.0213 0.0244 24024 CCK30/W33 157 302 0.0021 0.0646 0.0717 278 23220 CCK/W33 494 0.0018 0.0256 24026 CCK30/W33 387 0.0023 0.0693 0.0764 0.0229 203 0.0019 0.0248 0.0741 0.0812 23222 CCK/W33 341 615 0.0276 24028 CCK30/W33 186 357 0.0025 23224 CCK/W33 0.0021 0.0272 0.0299 24030 CCK30/W33 194 370 0.0027 0.0796 0.0867 367 647 23226 CCK/W33 371 655 0.0023 0.0288 0.0315 24032 CCK30/W33 191 409 0.0028 0.0835 0.0906 23228 CCK/W33 439 774 0.0025 0.0311 0.0339 24034 CCK30/W33 219 444 0.0030 0.0879 0.0950 23230 CCK/W33 451 792 0.0027 0.0335 0.0362 24036 CCK30/W33 257 521 0.0032 0.0946 0.1020 24038 CCK30/W33 477 935 0.0028 0.0382 467 0.0977 0.1050 23232 CCK/W33 0.0355 225 0.0033 23234 CCK/W33 497 929 0.0030 0.0370 0.0398 24040 CCK30/W33 251 508 0.0035 0.1040 0.1110 23236 CCK/W33 863 0.0032 0.0390 24044 CCK30/W33 252 541 0.1130 461 0.0418 0.0039 0.1210 23238 CCK/W33 471 898 0.0033 0.0410 0.0437 24048 CCK30/W33 219 464 0.0043 0.1220 0.1290 23240 CCK/W33 503 934 0.0035 0.0433 0.0461 24052 CCK30/W33 274 581 0.0046 0.1330 0.1400 23244 CCK/W33 550 1080 0.0039 0.0477 0.0504 24056 CCK30/W33 239 499 0.0050 0.1410 0.1480 23248 ...K/W33 0.0043 0.0520 273 567 0.1510 0.1580 626 1224 0.0552 24060 ... K30/W33 0.0053 23252 ...K/W33 667 1296 0.0046 0.0563 0.0595 24064 CCK30/W33 261 538 0.0057 0.1610 0.1680 23256 ...K/W33 599 1147 0.0050 0.0599 0.0626 24068 CCK30/W33 296 592 0.0060 0.1710 0.1780 23260 ...K/W33 629 1201 0.0053 0.0642 0.0670 24072 CCK30/W33 270 551 0.0064 0.1790 0.1860 23264 ...K/W33 677 1289 0.0057 0.0686 0.0713 24076 CCK30/W33 258 513 0.0067 0.1880 0.1950 23268 ...K/W33 721 1328 0.0060 0.0725 0.0756 0.0788 23272 ...K/W33 677 1275 0.0064 0.0760 241xx series 23276 ...K/W33 686 1253 0.0067 0.0800 0.0831 24122 CCK30/W33 225 442 0.0019 0.0607 0.0674 24124 CCK30/W33 280 538 0.0021 0.0666 0.0737 239xx series 24126 CCK30/W33 271 521 0.0023 0.0705 0.0776 23936 CCK/W33 122 0.0032 0.0366 24128 CCK30/W33 273 522 0.0025 0.0756 0.0827 23938 CCK/W33 104 0.0033 0.0382 24130 CCK30/W33 342 654 0.0027 0.0820 0.0890 129 0.0871 23940 CCK/W33 0.0035 0.0406 24132 CCK30/W33 370 786 0.0028 0.0942 23944 CCK/W33 109 0.0039 0.0437 24134 CCK30/W33 315 638 0.0030 0.0898 0.0965 23948 CCK/W33 93 0.0043 0.0473 24136 CCK30/W33 357 726 0.0032 0.0961 0.1030 23952 CCK/W33 132 0.0046 0.0516 24138 CCK30/W33 384 798 0.0033 0.1010 0.1080 23956 CCK/W33 119 0.0050 0.0552 24140 CCK30/W33 410 827 0.0035 0.1070 0.1140 23960 CCK/W33 154 0.0053 0.0595 24144 CCK30/W33 409 873 0.0039 0.1170 0.1240 23964 CCK/W33 139 0.0057 0.0626 24148 CCK30/W33 412 876 0.0043 0.1260 0.1340 23968 CCK/W33 129 0.0060 0.0662 24152 CCK30/W33 450 950 0.0046 0.1370 0.1440 23972 CCK/W33 116 0.0064 0.0697 24156 CCK30/W33 402 837 0.0050 0.1450 0.1520 23976 CCK/W33 152 0.0067 0.0741 24160 CCK30/W33 448 929 0.0053 0.1560 0.1630 24164 CCK30/W33 492 1018 0.0057 0.1670 0.1740 24168 ECAK30/W33 522 1047 0.0060 0.1770 0.1840 24172 ECCK30J/W33 476 97/ 0.0064 0.1850 0.1920 24176 ECAK30/W33 439 871 0.0067 0.1930 0.2010

^{*} Values given valid for HMV (C) E series hydraulic nuts equal to bearing size and with one sliding surface (see Figures b and c). Surfaces lightly oiled with light oil.

^{**} Values given valid for HMV (C) E series hydraulic nuts equal to one size smaller than bearing size and two sliding surfaces (see **Figure e**). Surfaces lightly oiled with light oil.

^{***} Values given are valid for one sliding surface (see **Figures b** and **c**). Surfaces lightly oiled with light oil.

^{****} Values given are valid for two sliding surfaces (see **Figure e**). Surfaces lightly oiled with light oil. The difference in drive-up between one surface and two surfaces is the result of smoothing.


NOTE: To convert values to mm and MPa $\,$ mm = in x 25.4 $\,$ MPA = psi x 0.0069

Mounting of CARB® toroidal roller bearings

CARB can accommodate axial displacement within the bearing. This means that the inner ring as well as the roller assembly can be axially displaced in relation to the outer ring. CARB can be secured with lock nuts KMF .. E or KML. If standard KM, AN, or N style lock nuts and locking washers are used instead, a spacer may be needed between the bearing inner ring and the washer to prevent washer contact with the cage, if axial displacement or misalignment are extreme, see **Figure 9**. The spacer dimensions shown in **Figure 10** will help ensure safe operation with axial offset ±10% of bearing width, and 0.5° misalignment.

Note that both the inner and outer ring must be locked in the axial direction as shown in **Figures 9** and **10**.

Figure 9 Axial location and axial displacement

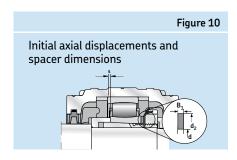

Spacer dimensions

 $d < 35 \, mm$

For mounting with standard KM, AN and N lock nuts and locking washers, as shown in **Figure 10**, spacers with the following dimensions are needed:


u . 00		
35 mm < d < 120 mm	B1 = 3 mm	
d > 120 mm	B1 = 4 mm	
Dimensions d and d2 as	shown in Figure	
10 must be obtained from the SKF General		
Catalog, CARB section.		

 $B1 = 2 \, \text{mm}$

Axial mounting position

Initial axial displacement of one ring in relation to the other can be used to increase the available axial clearance for shaft movement in one direction, see **Figure 10**.

It is also possible to accurately adjust the radial clearance or the radial position of the bearing by displacing one of the rings. Axial and radial clearance are interdependent, i.e. an axial displacement of one ring from the center position reduces the radial clearance. This principle is shown in **Figure 11** as applied to CARB C 2220.

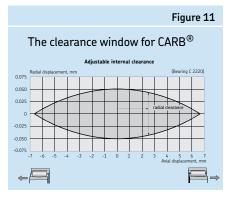

For example, if the axial displacement is 2.5 mm, the radial clearance is reduced from 100 to 90 μm and the radial position of the bearing changes from –50 to –45 μm , (**Figure 11**). For more information please contact SKF.

Mounting of CARB toroidal roller bearings with cylindrical bore

The same precautions and mounting procedures apply as other bearings with cylindrical bores. See page 13 for the different methods of mounting cylindrical bore CARB.

Radial clearance reduction method for mounting tapered bore (1:12) CARB on adapter sleeves

Precautions

For hollow shafts, please consult SKF Applications Engineering. The bearings should be left in their original packages until immediately before mounting so they do not become dirty. The dimensional and form accuracy of all components, which will be in contact with the bearing, should be checked.

Step 1

Remove any burrs or rust on the shaft with an emery cloth or a fine file.



Step 2
Wipe the shaft with a clean cloth.




Step 3
Measure the shaft diameter.

Shaft tolerance limits for adapter mounting seatings

Nomina inch over	al diameter including	Tolerance limits inch
1/2 1 2 4	1 2 4 6	0.000 / -0.002 0.000 / -0.003 0.000 / -0.004 0.000 / -0.005
6	-	0.000 / -0.006

Step 4

Screw off the locknut from the adapter sleeve assembly and remove the locking washer.

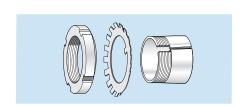


Step 5

Wipe preservative from the adapter O. D. and bore. Remove oil from the shaft to prevent transfer of oil to the bore of the adapter sleeve.



Step 6

Position the adapter sleeve on the shaft, threads outboard as indicated, to the approximate location with respect to required bearing centerline. For easier positioning of the sleeve, a screwdriver can be placed in the slit to open the sleeve. Applying a light oil to the sleeve outside diameter surface results in easier bearing mounting and removal.

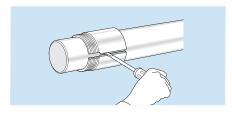

Step 7

Wipe the preservative from the bore of the bearing. It may not be necessary to remove the preservative from the internal components of the bearing unless the bearing will be lubricated by a circulating oil or oil mist system.



Step 8


Measure the unmounted radial internal clearance in the bearing. The values for unmounted internal clearance for CARB are provided in **Table 6**.

Oscillate the inner ring in a circumferential direction to properly seat the rollers.

Measure the radial internal clearance in the bearing by inserting progressively larger feeler blades the full length of the roller between the most unloaded roller and the


outer ring sphere. NOTE: Do not roll completely over a pinched feeler blade, slide through the clearance. It is permissible to rotate a roller up onto the feeler blade but be sure it slides out of the contact area with a slight resistance. Record the measurement on the largest size blade that will slide through. This is the unmounted radial internal clearance.

Repeat this procedure in two or three other locations by resting the bearing on a different spot on its O.D. and measuring over different rollers.

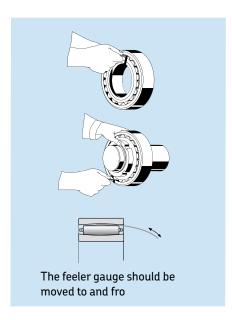

Step 9

Place the bearing on the adapter sleeve, leading with the large bore of the inner ring to match the taper of the adapter. Apply the locknut with its chamfer facing the bearing (DO NOT apply the locking washer at this time because the drive-up procedure may damage the locking washer). Applying a light coating of oil to the chamfered face of the lock nut will make mounting easier. With the bearing hand tight on the adapter sleeve, locate the bearing to the proper axial position on the shaft.

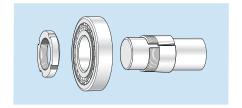

Step 10

Using a spanner wrench, hand-tighten the locknut so that the sleeve grips the shaft and the adapter sleeve can neither be moved axially, nor rotated on the shaft. With the bearing hand tight on the adapter, locate the bearing to the proper axial position on the shaft.



Step 11

Select the proper radial internal clearance reduction range from **Table 6** on page 31. Using a hammer and a spanner wrench or just a hydraulic nut, begin tightening the locknut in order to drive the inner ring up the tapered seat until the appropriate clearance reduction is achieved.

NOTE: LARGE SIZE BEARINGS WILL
REQUIRE A HEAVY DUTY IMPACT SPANNER
WRENCH AND SLEDGE HAMMER TO
OBTAIN THE REQUIRED REDUCTION IN
RADIAL INTERNAL CLEARANCE. AN SKF
HYDRAULIC NUT MAKES MOUNTING OF
LARGE SIZE BEARINGS EASIER.

Do not attempt to tighten the locknut with hammer and drift. The locknut will be damaged and chips can enter the bearing.

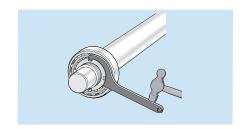


Table 6 Radial internal clearance (RIC) of CARB® toroidal roller bearings with tapered bore Reduction in RIC Axial drive-up (S)1 Bore diameter Unmounted radial internal clearance C2 C.3 C4 1:12 taper Normal range d min min min min min min max max max max max max inch mm inch inch inch inch 18 24 0.0007 0.0012 0.0012 0.0017 0.0017 0.0022 0.0022 0.0027 0.0004 0.0006 0.0083 0.0114 25 30 0.0009 0.0015 0.0015 0.0020 0.0020 0.0026 0.0026 0.0032 0.0005 0.0007 0.0098 0.0134 31 40 0.0011 0.0018 0.0018 0.0024 0.0024 0.0031 0.0031 0.0039 0.0006 0.0009 0.0118 0.0165 50 0.0021 0.0021 0.0029 0.0029 0.0037 0.0037 0.0046 0.0008 41 0.0013 0.0012 0.0146 0.0201 0.0025 0.0025 0.0035 0.0035 0.0044 0.0058 0.0010 51 65 0.0017 0.0044 0.0015 0.0173 0.0252 66 80 0.0020 0.0031 0.0031 0.0043 0.0043 0.0054 0.0054 0.0069 0.0013 0.0019 0.0213 0.0299 81 100 0.0025 0.0038 0.0038 0.0052 0.0052 0.0068 0.0068 0.0086 0.0016 0.0024 0.0256 0.0366 0.0433 120 0.0030 0.0045 0.0045 0.0061 0.0061 0.0079 0.0079 0.0100 0.0020 0.0028 0.0311 101 121 140 0.0035 0.0053 0.0053 0.0071 0.0071 0.0091 0.0091 0.0116 0.0024 0.0033 0.0366 0.0500 141 160 0.0041 0.0061 0.0061 0.0083 0.0083 0.0106 0.0106 0.0133 0.0028 0.0038 0.0421 0.0567 0.0119 180 0.0046 0.0068 0.0068 0.0094 0.0094 0.0119 0.0150 0.0031 0.0043 0.0476 0.0634 161 200 0.0051 0.0076 0.0076 0.0102 0.0102 0.0130 0.0130 0.0164 0.0035 0.0047 0.0535 0.0701 181 0.0084 0.0113 0.0039 225 0.0057 0.0084 0.0113 0.0143 0.0143 0.0181 0.0053 0.0591 0.0783 201 226 250 0.0063 0.0093 0.0093 0.0124 0.0124 0.0158 0.0158 0.0201 0.0044 0.0059 0.0657 0.0866 251 280 0.0069 0.0102 0.0102 0.0135 0.0135 0.0175 0.0175 0.0219 0.0049 0.0067 0.0728 0.0969 0.0111 0.0148 0.0811 315 0.0111 0.0148 0.0189 0.0243 0.0055 0.0078 0.0189 0.0075 0.1083 281 316 355 0.0088 0.0125 0.0125 0.0165 0.0165 0.0213 0.0213 0.0267 0.0062 0.0085 0.0909 0.1217 0.0138 356 400 0.0099 0.0138 0.0185 0.0185 0.0235 0.0235 0.0296 0.0070 0.0094 0.1020 0.1366 401 450 0.0111 0.0151 0.0151 0.0207 0.0207 0.0257 0.0257 0.0329 0.0079 0.0106 0.1146 0.1535 451 500 0.0120 0.0171 0.0171 0.0226 0.0226 0.0289 0.0289 0.0359 0.0089 0.0118 0.1283 0.1701 0.0187 0.0249 0.0249 0.0316 0.0316 0.0396 0.0098 0.0132 501 560 0.0132 0.0187 0.1421 0.1902 0.0209 0.0276 0.0349 0.0110 630 0.0150 0.0209 0.0276 0.0349 0.0437 0.0150 0.1591 0.2134 561 710 0.0166 0.0232 0.0232 0.0304 0.0304 0.0388 0.0388 0.0484 0.0124 0.0167 0.1783 0.2402 631 800 0.0189 0.0265 0.0265 0.0339 0.0339 0.0433 0.0433 0.0543 0.0140 0.0189 0.2008 0.2701 711 900 801 0.0208 0.0289 0.0289 0.0376 0.0376 0.0478 0.0478 0.0600 0.0157 0.0213 0.2256 0.3035

0.0228

0.0254

0.0320

0.0352

0.0320

0.0352

901 1000

1,001 1120

CAUTION: Do not use the maximum reduction of radial internal clearance when the initial unmounted radial internal clearance is in the lower half of the tolerance range or where large temperature differentials between the bearing rings can occur in operation.

0.0528

0.0589

0.0528

0.0589

0.0657


0.0738

0.0409

0.0459

Step 12

Remove the locknut and install the locking washer on the adapter sleeve. The inner prong of the locking washer should face the bearing and be located in the slot of the adapter sleeve. Reapply the locknut until tight. (DO NOT drive the bearing further up the taper, as this will reduce the radial internal clearance further).

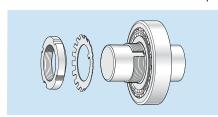


Step 13

0.0409

0.0459

Find the locking washer tang that is nearest a locknut slot. If the slot is slightly past the tang don't loosen the nut, but instead tighten it to meet the closest locking washer tang. Do not bend the locking tab to the bottom of the locknut slot.

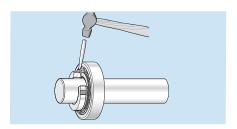

Step 14

0.0177

0.0197

0.0236

0.0264

Check that the shaft and outer ring can be rotated easily by hand.

0.2535

0.2811

0.3370

0.3768



^{1.} Valid only for solid tapered shafts.


Radial clearance reduction method for mounting tapered bore (1:12) CARB® toroidal bearings onto a tapered shaft

Precautions

For hollow shafts, please consult SKF Applications Engineering. The bearings should be left in their original packages until immediately before mounting so they do not become dirty. The dimensional and form accuracy of all components, which will be in contact with the bearing, should be checked.

Step 1


Remove any burrs or rust on the shaft with an emery cloth or a fine file.

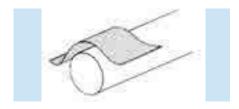

Step 2
Wipe the shaft with a clean cloth.



Step 3Measure the shaft taper for geometry and contact using taper gauges.

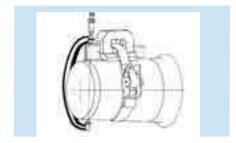

Step 4


Wipe the preservative from the bore of the bearing. It may not be necessary to remove the preservative from the internal components of the bearing unless the bearing will be lubricated by a circulating oil or oil mist system.




Step 5

Measure the unmounted radial internal clearance in the bearing. The values for unmounted internal clearance for tapered bore CARB are provided in **Table 6** on page 31. Oscillate the inner ring in a circumferential direction to properly seat the rollers. Measure the radial internal clearance in the bearing by inserting progressively larger feeler blades the full length of the roller between the most unloaded roller and the outer ring sphere. NOTE: Do not roll completely over a pinched feeler blade, slide through the clearance. It is permissible to rotate a roller up onto the feeler blade but be sure it slides out of the contact area with a slight resistance. Record the measurement on the largest size blade that will slide through. This is the unmounted radial internal clearance.


Repeat this procedure in two or three other locations by resting the bearing on a different spot on its O.D. and measuring over different rollers.

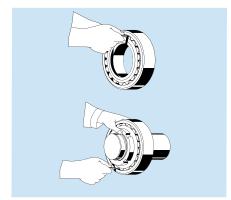

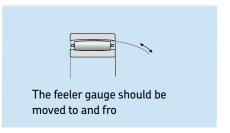


Step 6

Place the bearing on the tapered shaft, leading with the large bore of the inner ring to match the taper of the shaft. Apply the locknut with its chamfer facing the bearing (DO NOT apply the locking washer at this time because the drive-up procedure may damage the locking washer). Applying a light coating of oil to the chamfered face of the lock nut will make mounting easier.

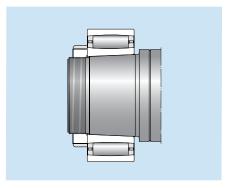


Step 7

Select the proper radial internal clearance reduction range from **Table 6** on page 31. Using a hammer and a spanner wrench or just a hydraulic nut, begin tightening the nut in order to drive the inner ring up the tapered shaft until the appropriate clearance reduction is achieved. NOTE: LARGE SIZE BEARINGS WILL REQUIRE A HEAVY DUTY IMPACT SPANNER WRENCH AND SLEDGE HAMMER TO OBTAIN THE REQUIRED REDUCTION IN RADIAL INTERNAL CLEAR-ANCE. AN SKF HYDRAULIC NUT MAKES MOUNTING OF LARGE SIZE BEARINGS EASIER. Do not attempt to tighten the locknut with a hammer and drift. The locknut will be damaged and chips can enter the bearing.

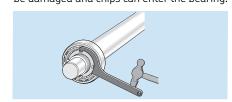


Step 8

Remove the locknut and install the locking washer on the shaft. The inner prong of the locking washer should face the bearing and be located in the keyway. Reapply the locknut until tight. (DO NOT drive the bearing further up the taper as this will reduce the radial internal clearance further).

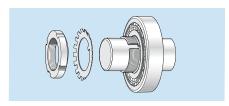

Step 9

Find the locking washer tang that is nearest a locknut slot. If the slot is slightly past the tang don't loosen the nut, but instead tighten it to meet the closest locking washer tang. Do not bend the locking tab to the bottom of the locknut slot.

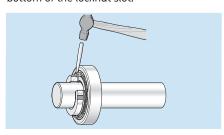

Step 10 Check that the shaft and outer ring can be rotated easily by hand.



Angular drive-up method for mounting tapered bore (1:12) CARB toroidal bearings on an adapter sleeve.

The angular drive-up method simplifies the mounting process by equating axial drive up to the rotation of a locknut. By knowing the threads per inch of a locknut, the number of rotations to achieve a specific axial movement can be determined. In order to make this mounting method work properly, the starting point is important since that is the reference point to determine when to start counting the rotation of the locknut.

Precautions

The bearings should be left in their original packages until immediately before mounting so they do not become dirty. The dimensional and form accuracy of all components, which will be in contact with the bearing, should be checked.

Step 1

Remove any burrs or rust on the shaft with an emery cloth or a fine file.



Step 2
Wipe the shaft with a clean cloth.




Step 3Measure the shaft diameter.

Shaft tolerance limits for adapter mounting seatings

Nomin inch over	al diameter including	Tolerance limits inch
1/2 1 2 4 6	1 2 4 6 -	0.000 / -0.002 0.000 / -0.003 0.000 / -0.004 0.000 / -0.005 0.000 / -0.006

Step 4

Screw off the nut from the adapter sleeve assembly and remove the locking washer.

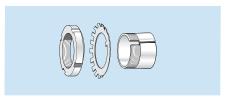


Step 5

Wipe preservative from the adapter O. D. and bore. Remove oil from the shaft to prevent transfer of oil to the bore of the adapter sleeve.



Step 6

Position the adapter sleeve on the shaft, threads outboard as indicated, to the approximate location with respect to required bearing centerline. For easier positioning of the sleeve, a screwdriver can be placed in the slit to open the sleeve. Applying a light oil to the sleeve outside diameter surface results in easier bearing mounting and removal.

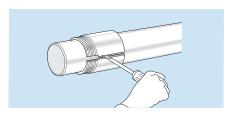


Step 7

Wipe the preservative from the bore of the bearing. It may not be necessary to remove the preservative from the internal components of the bearing unless the bearing will be lubricated by a circulating oil or oil mist system.



Step 8

Place the bearing on the adapter sleeve, leading with the large bore of the inner ring to match the taper of the adapter. Apply the locknut with its chamfer facing the bearing (DO NOT apply the locking washer at this time because the drive-up procedure may damage the locking washer). Applying a light coating of oil to the chamfered face of the lock nut will make mounting easier.

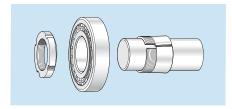

Step 9

Using a spanner wrench, hand-tighten the locknut so that the sleeve grips the shaft and the adapter sleeve can neither be moved axially, nor rotated on the shaft. With the bearing hand tight on the adapter, locate the bearing to the proper axial position on the shaft. A method for checking if the bearing and sleeve are properly clamped is to place a screwdriver in the adapter sleeve split on the large end of the sleeve. Applying pressure to the screwdriver to attempt to turn the sleeve around the shaft is a good check to determine if the sleeve is clamped down properly. If the sleeve no longer turns on the shaft, then the zero point has been reached. Do not drive the bearing up any further.



Step 10


Place a reference mark on the locknut face and shaft, preferably in the 12 o'clock position, to use when measuring the tightening angle.

Step 11

Locate the specific bearing part number in **Table 7**. Note the specific lock nut part number on the adapter sleeve to determine if it is an inch or metric assembly. Once the appropriate locknut part number has been obtained, select the corresponding tightening angle from **Table 7** on page 35.


Step 12

Using a hammer and a spanner wrench, begin tightening the locknut the corresponding tightening angle. **NOTE:** LARGE SIZE BEARINGS WILL REQUIRE A HEAVY DUTY IMPACT SPANNER WRENCH AND SLEDGE HAMMER TO OBTAIN THE REQUIRED REDUCTION IN RADIAL INTERNAL CLEARANCE. Do not attempt to tighten the locknut with hammer and drift. The locknut will be damaged and chips can enter the bearing.

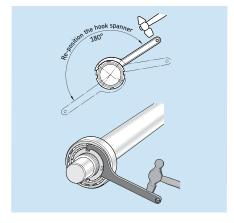


Step 13

Remove the locknut and install the locking washer on the adapter sleeve. The inner prong of the locking washer should face the bearing and be located in the slot of the adapter sleeve. Reapply the locknut until tight. (DO NOT drive the bearing further up the taper, as this will reduce the radial internal clearance further).

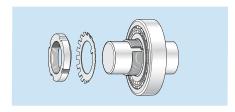

Step 14

Find the locking washer tang that is nearest a locknut slot. If the slot is slightly past the tang don't loosen the nut, but instead tighten it to meet the closest locking washer tang. Do not bend the locking tab to the bottom of the locknut slot.

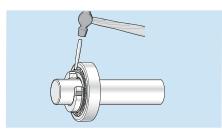

Step 15
Check that the shaft and outer ring can be rotated easily by hand.



34 **5KF**

Table 7

Angular drive-up for CARB® toroidal roller bearings (metric and inch nuts)

Bearing designation	Bearing bore diameter d	Axial drive-up s	Metric nut designation	Turning angle a	Inch nut designation	Turning angle a
	(mm)	(mm)		(degrees)		(degrees)
		,		<u> </u>		, , , , , , , , , , , , , , , , , , , ,
22xx series						
C 2205 K	25	0.25	KM(FE) 5	100	N 05	190
C 2206 K	30	0.25	KM(FE) 6	105	N 06	115
C 2207 K	35	0.30	KM(FE) 7	115	N 07	120
C 2208 K	40	0.30	KM(FE) 8	125	N 08	135
C 2209 K	45	0.37	KM(FE) 9	130	N 09	140
C 2210 K	50	0.37	KM(FE) 10	140	N 10	150
C 2211 K	55	0.44	KM(FE) 11	110	N 11	155
C 2212 K	60	0.44	KM(FE) 12	115	N 12	165
C 2213 K	65	0.44	KM(FE) 13	120	N 13	170
C 2214 K	70	0.54	KM(FE) 14	125	N 14	175
C 2215 K	75	0.54	KM(FE) 15	130	AN 15	120
C 2216 K	80	0.54	KM(FE) 16	140	AN 16	130
C 2217 K	85	0.65	KM(FE) 17	145	AN 17	135
C 2218 K	90	0.65	KM(FE) 18	150	AN 18	145
C 2219 K	95	0.65	KM(FE) 19	150	AN 19	150
C 2220 K	100	0.65	KM(FE) 20	155	AN 20	160
C 2222 K	110	0.79	KM(FE) 22	170	AN 22	160
C 2224 K	120	0.79	KM 24	180	AN 24	170
23xx series						
C 2314 K	70	0.54	KM(FE) 14	130	N 14	185
C 2315 K	75	0.54	KM(FE) 15	135	AN 15	130
C 2316 K	80	0.54	KM(FE) 17	140	AN 16	135
C 2317 K	85	0.65	KM(FE) 18	145	AN 17	140
C 2318 K	90	0.65	KM(FE) 19	155	AN 18	145
C 2319 K	95	0.65	KM(FE) 20	155	AN 19	150
C 2320 K	100	0.65	KM(FE) 21	160	AN 20	155
			/			

For sizes greater than those shown above we recommend the use of the SKF Hydraulic drive-up method. For threads per inch see **Table 2** (page 17).

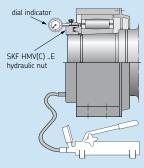


Figure 12

SKF hydraulic (axial) drive-up method for tapered bore (1:12) CARB toroidal bearings on an adapter sleeve.

The axial drive-up method relies on the bearing being driven up a tapered seat a specific amount in order to ensure the inner ring is expanded enough to properly clamp the shaft or sleeve. In order for this method to work properly, the starting point is important since that is the reference point to determine when the bearing has been driven up enough. A new method of accurately achieving this starting point has been developed by SKF and is now available. The method incorporates the use of an SKF hydraulic nut, HMV(C) .. E fitted with a dial indicator and a specially calibrated pressure gauge, mounted on a selected pump. The equipment is shown in **Figure 12** below. The required pressure for each CARB bearing is given in **Table 8**, page 37. This enables accurate positioning of the bearing at the starting point, from where the axial drive-up (s) is measured. **Table 8** also provides the required psi pressures required for each.

- 1. Reduced time to mount bearings.
- 2. A reliable, safe and accurate method of clearance adjustment.

Precautions

For hollow shafts, please consult SKF Applications Engineering. The bearings should be left in their original packages until immediately before mounting so they do not become dirty. The dimensional and form accuracy of all components, which will be in contact with the bearing, should be checked.

Step 1

Remove any burrs or rust on the shaft with an emery cloth or a fine file.



Step 2
Wipe the shaft with a clean cloth.



Step 3


Measure the shaft diameter.

Shaft tolerance limits for adapter mounting seatings

Nomin	al diameter	Tolerance limits
inch		inch
over	including	
1/2	1	0.000 / -0.002
1	2	0.000 / -0.003
2	4	0.000 / -0.004
4	6	0.000 / -0.005
6	-	0.000 / -0.006


Step 4

Remove the locknut and locking washer from the adapter sleeve assembly.

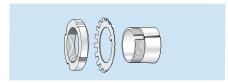


Step 5

Wipe preservative from the adapter 0. D. and bore. Remove oil from the shaft to prevent transfer of oil to the bore of the adapter sleeve.

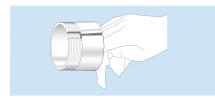


Step 6

Position the adapter sleeve on the shaft, threads outboard as indicated, to the approximate location with respect to required bearing centerline. For easier positioning of the sleeve, a screwdriver can be placed in the slit to open the sleeve.

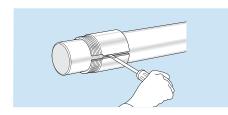


Step 7

Applying a light oil to the sleeve outside diameter surface results in easier bearing mounting and removal. Wipe the preservative from the bore of the bearing. It may not be necessary to remove the preservative from the internal components of the bearing unless the bearing will be lubricated by a circulating oil or oil mist system.

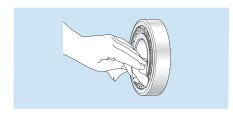


Step 8

Place the bearing on the adapter sleeve leading with the large bore of the inner ring to match the taper of the adapter. Apply the hydraulic nut (DO NOT apply the locking washer at this time). Ensure that the bearing size is equal to the hydraulic nut. Otherwise, the pressure in the table must be adjusted. Drive the bearing up to the starting position by applying the hydraulic pressure listed in Starting Position 1* in **Table 8** for the specific bearing size being mounted. Monitor the pressure by the gauge on the selected pump. As an alternative, SKF mounting gauge TMJG 100D can be screwed directly into the hydraulic nut.

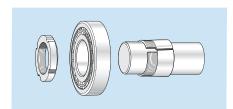


Step 9

Drive the bearing up the adapter sleeve the required distance S_s shown under column heading 1*** of **Table 8**. The axial drive-up is best monitored by a dial indicator.

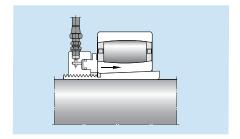


Step 10

Remove the hydraulic nut and install the locking washer on the adapter sleeve. The inner prong of the locking washer should face the bearing and be located in the slot of the adapter sleeve. Reapply the locknut until tight. (DO NOT drive the bearing further up the taper, as this will reduce the radial internal clearance further).

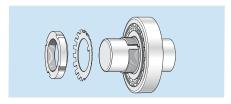

Step 11

Find the locking washer tang that is nearest a locknut slot. If the slot is slightly past the tang don't loosen the nut, but instead tighten it to meet the closest locking washer tang. Do not bend the locking tab to the bottom of the locknut slot.

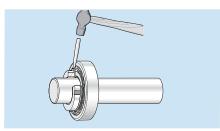

Step 12

Check that the shaft and outer ring can be rotated easily by hand.



36 **5KF**

Pressure and axial drive-up for CARB toroidal roller bearings with tapered bore

	Starting	position		Final position	on		Starting	position		Final positi	on
SKF bearing designation	Hydrauli pressure		Radial clearance reduction from zero position	Axial drive- from startin position S _s		SKF bearing designation	Hydraul pressure		Radial clearance reduction from zero position	Axial drive- from starti position S _s	
	1* (psi)	2** (psi)	(in.)	1*** (in.)	2**** (in.)		1* (psi)	2** (psi)	(in.)	1*** (in.)	2**** (in.)
C 22xx series						C 31xx series					
C 2210 K	97	185	0.0009	0.0126	0.0154	C 3130 K	349	613	0.0027	0.0331	0.0359
C 2211 K	83	154	0.0010	0.0138	0.0165	C 3132 K	300	589	0.0028	0.0343	0.0370
C 2212 K	158	283	0.0011	0.0154	0.0181	C 3136 K	247	464	0.0032	0.0370	0.0398
C 2213 K	119	222	0.0011	0.0158	0.0185	C 3140 K	393	731	0.0035	0.0426	0.0457
C 2214 K	110	199	0.0013	0.0169	0.0197	C 3144 K	400	787	0.0039	0.0465	0.0496
C 2215 K	102	183	0.0013	0.0173	0.0250	C 3148 K	291	571	0.0043	0.0489	0.0516
C 2216 K	149	268	0.0014	0.0189	0.0217	C 3152 K	400	777	0.0046	0.0540	0.0567
C 2217 K	162	290	0.0015	0.0197	0.0225	C 3156 K	381	731	0.0050	0.0579	0.0607
C 2218 K	197	358	0.0016	0.0217	0.0244	C 3160 K	407	777	0.0053	0.0619	0.0646
C 2220 K	162	287	0.0018	0.0221	0.0252	C 3164 K	303	576	0.0057	0.0634	0.0662
C 2222 K	216	390	0.0019	0.0244	0.0272	C 3168 K	386	712	0.0060	0.0686	0.0713
C 2226 K	209	368	0.0023	0.0276	0.0303						
C 2228 K	342	603	0.0025	0.0311	0.0339	C 32xx series					
C 2230 K	260	454	0.0023	0.0323	0.0357	C 3224 K	357	629	0.0021	0.0268	0.0299
C 2234 K	374	697	0.0027	0.0323	0.0331	C 3232 K	389	761	0.0028	0.0343	0.0370
C 2234 K	257	489	0.0030	0.0370	0.0376	C 3236 K	535	1001	0.0032	0.0343	0.0370
						C 3230 K	333	1001	0.0032	0.0570	0.0427
C 2244 K	283	557	0.0039	0.0453	0.0481	C / Oi					
						C 40xx series	100	2/5	0.0025	0.07/4	0.004.2
C 23xx series						C 4028 K30	180	345	0.0025	0.0741	0.0812
C 2314 K	291	525	0.0013	0.0177	0.0209	C 4032 K	152	325	0.0028	0.0820	0.0890
C 2315 K	326	587	0.0013	0.0189	0.0217						
C 2316 K	306	550	0.0014	0.0193	0.0221						
C 2317 K	348	622	0.0015	0.0205	0.0232	7	Zero	Startin	ıg Final		
C 2318 K	418	760	0.0016	0.0225	0.0252	r	osition	positio	n position		
C 2319 K	323	574	0.0017	0.0225	0.0252	·	(. 1			
C 2320 K	371	658	0.0018	0.0232	0.0260		\	1			
C 30xx series								Ss			
C 3036 K	207	389	0.0032	0.0374	0.0402			→	-		
C 3038 K	232	309 442	0.0032	0.0374	0.0402			S			
C 3040 K	235	435	0.0035	0.0418	0.0445						
C 3044 K	229	450	0.0039	0.0453	0.0481						
C 3048 K	194	380	0.0043	0.0485	0.0512						
C 3052 K	257	499	0.0046	0.0532	0.0559			a			
C 3056 K	245	470	0.0050	0.0571	0.0599			d	,		
C 3060 K	261	499	0.0053	0.0611	0.0638						
C 3064 K	261	497	0.0057	0.0650	0.0678						
C 3068 K	296	545	0.0060	0.0689	0.0721						
C 3092 K	290	526	0.0081	0.0918	0.0946						
b			C			d					

^{*} Values given valid for HMV (C) E series hydraulic nuts equal to bearing size and with one sliding surface (see Figures b and c). Surfaces lightly oiled with light oil.

NOTE: To convert values to mm and MPa $\,$ mm = in x 25.4 $\,$ MPA = psi x 0.0069

^{**} Values given valid for HMV (C) E series hydraulic nuts equal to one size smaller than bearing size and two sliding surfaces (see **Figure e**). Surfaces lightly oiled with light oil.

^{***} Values given are valid for one sliding surface (see **Figures b** and **c**). Surfaces lightly oiled with light oil.


^{****} Values given are valid for two sliding surfaces (see **Figure e**). Surfaces lightly oiled with light oil. The difference in drive-up between one surface and two surfaces is the result of smoothing.

Assembly instructions for pillow block housings

SAF and SAFS series

WARNING: Read these instructions before starting work. Failure to follow these instructions could result in injury or damage such as catastrophic premature bearing failure. Be careful with heavy weight and tools and other devices, and with high pressure oil when using the hydraulic assist method. Be familiar with the MSDS or other safety instructions for any grease or oil used and keep them nearby.

Step 1Remove any burrs or rust on the shaft with an emery cloth or a fine file.

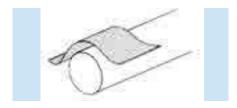

Step 2
Wipe the shaft with a clean cloth.



Table 9

Dia. tol. for adapter & cylindrical bore mounted shaft extensions

Nominal dia. inches		Dia. tolerance limits inches		
over	including	S-1	S-2 & S-3	
1	2	0.000 -0.003	0.000 -0.003	
2	4	0.000 -0.004	0.000 -0.003	
4	6	0.000 -0.005	0.000 -0.003	
6	10	0.000 -0.006	0.000 -0.004	
10	15	0.000 -0.006	0.000 -0.005	
15	-	0.000 -0.006	0.000 -0.006	

Step 3


Check shaft diameter.

Note: S1 refers to the shaft tolerance for an adapter mounted bearing. S2 and S3 refer to the shaft tolerance under the seal for a cylindrical mounted bearing, not the bearing seat diameter. For bearing seat diameter tolerances, refer to the Shaft and Housing Fits Section of this catalog on page 57.

Step 4

Install inboard seal.


PosiTrac (LOR) and PosiTrac Plus seal Slide the seal onto the shaft. The resistance should only require slight hand pressure to overcome. The O-ring can be lubricated with grease or oil to ease assembly. Locate the seal to match the labyrinths in the housing. The old style LER labyrinth seal still used for small shaft diameters is installed in the same manner. The picture shows the PosiTrac Plus seal, which requires greasing the seal lip at assembly. See PosiTrac Plus Assembly Instructions for more information (Publication 655-810), which is included with the B-10724 contact element. SKF's next generation M5 style SAF housings have the external labyrinth painted for improved corrosion resistance. Removal of this paint is not recommended.

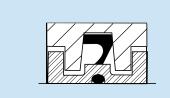

Taconite (TER) seal

Coat the shaft with oil. Smear grease in the bore of the seal cartridge, filling the cavity between seals, and lubricating the bore of the felt seal and the lip of the contact seal. Fill the TER seal cavity with grease. If the end of the shaft does not have a lead-in bevel, smooth the bore of the felt seal with a flat instrument to aid in starting the felt over the end of the shaft. Carefully slide the seal cartridge assembly on the shaft to approximate assembly position. **Note:** Make sure the lobes of the rubber extrusion on the outside diameter of the taconite seal are not located at the split of the housing; to ensure this occurs, the grease fitting should

be at 12 or 6 o'clock. For seal misalignment capabilities, see **Table 12**.

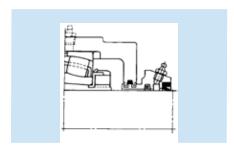

Step 5

Mount the bearing.

Note: Several mounting methods exist. Refer to the beginning of this section for specific mounting instructions for the specific bearing being used in the housing. Please consult SKF for alternative instructions or reference www.skf.com/mount.

Step 6

Install outboard seal (same as step 4).

Step 7

Lower half of housing (Base)

Set the bases on their mounting surface and lightly oil the bearing seats. SKF's M5 style SAF housings have painted baseplanes. Removal of this paint is not required prior to installation. If grease is used as a lubricant, it should be applied before the upper half of the housing is secured. Smear grease between the rolling elements of the bearing and work it in until the bearing is 100% full. The base should be packed 1/3 to 1/2 full of grease. See **Table 10** for initial grease fill. For M5 style SAF housings, there is a cast line in the housing base that can be used as a grease fill line (fill to the bottom of the line). See **Figure 13**.

Place the shaft with bearings into the base, carefully guiding the seals into the seal grooves. Be certain that the bearings' outer rings sit squarely in the housing bearing seats. Bolt the "held" housing securely in place (see step 8). The "free" bearing housing will be located and bolted to its mounting surface after the "free" bearing is properly positioning in the "free" housing to ensure correct float. **Note:** If shimming is required, shims must cover the full mounting surface of the base.

38 **5KF**

Initial grea	ase fill for SAF	housings				
Housing Size					Initial fill 20 %	40%
					oz	
_	_	_	507	_	0.7	1.3
_	_	_	509	_	0.9	1.8
_	_	_	510	_	1.1	2.3
_	_	_	_	_		
_ _	_	308	_		1.1	2.3
_	_	309	_	609	1.4	2.9
_	_	_	511	_	1.4	2.9
_ _	_	— 310	_	— 610	1.9	3.8
_	_	310	— 513	910	1.9	3.8
		311		— 611	2.4	4.8
_	_	_	_	—	2.4	4.0
_	_	_	515	_	2.4	4.8
_	_	312	_	_	3.1	6.2
_	216	313	516	613	3.1	6.2
	_	_	_	_		
_	217	_	517	_	3.9	7.7
_	_	314	_	_	3.9	7.7
_ _	218	315	518	615	5.0	10.1
_	_	.	_	-		
_ _	_	316	_	616	6.4	12.9
		317		617	6.4	12.9
024	220 —	_	520 —	_	6.4	12.9
_ _	_	318	_	— 618	8.2	17
026	222	_	522	—	8.2	17
028	224	320	524	620	13.4	27
_	_	_	_	_		
030	226	322	526	622	13.5	27
032	_	_	_	_	13.5	27
034	228	_	528	_	17	35
_	_	_	_	_		
	230	324	530	624	22	44
036	232	326	532	626	28	57
038	_	_	_	_	28	57
— 0/0	— 234	— 328	— 534		31	/2
040 —	234	328 330	534 536	628 630	31 46	62 93
— 044	238	332	538	632	46 59	93 119
_	_	- -		—	3,	117
048	240	334	540	634	76	152
052	244	338	544	638	97	194
056		340		640	124	248

Note: There must be only one "held" bearing per shaft. One bearing should be "free" to permit shaft expansion. Some housings require two stabilizing rings, which must be inserted to obtain a "held" assembly with the bearing centered in the housing. Stabilizing rings enclosed in standard housings are intended for spherical roller bearings or CARB. A different stabilizing ring is required for self-aligning ball bearings (purchased separately).

Step 9

Upper half housing (Cap)


The bearing seat in the cap should be thoroughly cleaned, lightly oiled and placed over the bearing. With oil lubrication, use a sealing compound such as Permatex 2 or equivalent at the split surfaces; apply sparingly. Wipe a thin film near the outer edges. Excessive amounts may get forced between the housing bore and bearing outside diameter. This can pinch an outer ring or make a "free" bearing actually "held".

Two dowel pins will align the cap to its mating base. Note: Caps and bases of housings are not interchangeable. Each cap and base must be assembled with its original mating part. All SKF SAF and SAFS split housings are match marked with serialized identification on the cap and base to assist in assembling of mating parts. To complete the assembly, the lockwashers and cap bolts are then applied and tightened to the proper tightening torque for the specific cap bolts. See Table 11 and Figure 14. The rubber plug and plastic fitting in the cap holes of M5 style SAF housings should be removed and discarded. Replace with appropriate metallic plugs/fittings that are supplied with each SKF M5 style SAF housing.

Grease fill line

Step 8 Stabilizing rings

A stabilizing ring should be used if a spherical roller or self-aligning ball bearing is to be "Held" or Fixed" (i.e. locating the shaft). The stabilizing ring should also be used for all toroidal roller bearing (CARB) units. In cases when only one locating ring is used, move the shaft axially so that the stabilizing ring can be inserted between the bearing outer ring and housing shoulder on the locknut side of bearing, where practical. For bearings that will be free to float in the housing, generally center the bearings in the housing seat.

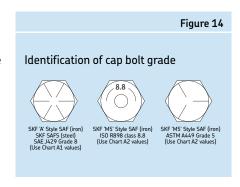

Tightening torque for SAF "A" style and SAFS "N" style cap bolts (see fig. 2)

		S	AF (cast iron)			SAFS (ca	st steel)	Torque ft-lbs
ĺ	-	-	-	509 510	-	-	-	70
	-	-	308 309 310	511 513 515	609 610 611	215 218	515 518	-
	-	-	311 312	515	-	-	-	110
	-	216 217 218	313 314 315	516 517 518	613 615	216 217 220	516 517 520	220
	-	-	-	-	-	222	522	-
	024 026	220 222 230	316 317 318	520 522 530	616 617 618	226	526	-
	-	232 234 236	324 326 328	532 534 536	624 626 628	-	-	380
	-	509 510	509 510	509 510	509 510	-	-	-
	044 048	238 240	332 334	538 540	632 634	228 230 532	528 530 532	600
	056	-	340	-	640	-	-	870
	028 030 032	224 226 228	320 322 338	524 526 528	620 622 638	234	534	-
	034 052	244	-	544	-	-	-	900
	-	-	-	-	-	238	538	1280
	-	-	-	-	-	240	540	1820
	-	-	-	-	-	236 244	536 544	2380

Table 11	

Table 11

Tightening	Tightening torque for SAF M5 cap bolts (see fig. 2)								
SAF M5	FSAF M5	SAF M5	FSAF M5	Cap bolt (no.) size	Torque ft-lbs				
-	-	507	-	(2) 3/8 - 16	30				
-	-	509	-	(2) 7/16 -14	45				
-	-	510	-	(2) 7/16 -14	45				
-	-	511	-	(2) 1/2 -13	60				
213	-	513	-	(2) 1/2 -13	60				
215	-	515	515	(2) 1/2 -13	60				
216	216	516	516	(2) 5/8 -11	110				
217	217	517	517	(2) 5/8 -11	110				
218	218	518	518	(2) 5/8 -11	110				
220	220	520	520	(2) 3/4 -10	150				
*222	-	*522	-	(2) 3/4 -10	150				
*224	-	*524	-	(2) 1-8	295				
*226	-	*526	-	(2) 1-8	295				
230	324	530	624	(4) 3/4 -10	150				
232	326	532	626	(4) 3/4 -10	150				

628

630

Table 12

150

150

SKF seal alignment canabilities

328

330

534

536

234

236

Sitt Seat angiline to	Sin Searchighnier capazinics						
Designation	Description	Allowable misalignment (degrees) ¹⁾					
		,					
LER	Labyrinth seal (SAF 507-513)	0.3					
B-9784	Contact seal (SAF 507-513)	0.1 ²⁾					
LOR	PosiTrac labyrinth seal	0.3					
LOR + B 10724-xx	PosiTrac Plus seal	0.3					
TER	Taconite seal w/contact seal	0.1 ²⁾					
TER-xx V	Taconite seal w/V-ring	0.5					

¹⁾ Values are approximate to cover a family of parts. For specific sizes, consult SKF application engineering

Misalignment

The misalignment capability of SKF split housings is dependent upon the specific seal that is being used. Even though the bearing inside the housing can accommodate more misalignment, the limiting component is the seal. Refer to the table below for misalignment capability of specific SKF seals.

Lubrication

See Lubrication section, page 87. Should bearing temperature be below 32° F (0° C) or above 200° F (93° C), consult SKF for lubrication recommendations.

Temperature limits

The temperature limitations of the SAF and SAFS series housings are mainly dependent upon the specific lubricant bearing used to lubricate the bearing and/or the seal material limitations. Any seal using a rubber lip component will have a temperature limit of 240° F. However, the lubricant being used may have a lower temperature limit than the seal and be the limiting factor. So in order to determine the maximum operating temperature of the housing, the application conditions, lubricant, and seal must be known.

40 SKF

(4) 3/4 -10


(4) 3/4 -10

²⁾ Optimum contact seal performance is obtained when shaft misalignment and run-out are kept to a minimum

Mounting instructions for collar mounted roller bearing unit pillow blocks and flanged housings (held and free bearings)

Step 1

Remove any burrs or rust on the shaft with an emery cloth or a fine file.

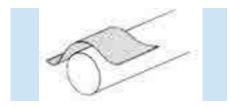

Step 2
Wipe the shaft with a clean cloth.



Step 3
Check the shaft diameter.


Recommended shaft tolerances

Up to $1^{15}/_{16}$ " Nominal to -0.0005" 2" to $4^{15}/_{16}$ " Nominal to -0.0010"

NOTE: When the load is Heavy, C/P<8.3, a press fit must be used.
Consult SKF Applications Engineering.

Step 4

Clean the base of the housing and support surface on which it rests. Be sure the supporting surface is flat. If pillow block elevation must be adjusted by shims, the shims MUST extend the full length and width of the support surface.

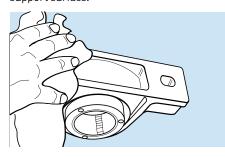


Step 5

Slide the bearing and housing onto the shaft and position it where the pillow block is to be secured. Bolt the housing securely to the support.



Step 6

The FREE bearing must be centered in the housing to allow for axial shaft expansion. Move the bearing axially in the housing in both directions as far as it will go and determine the centered position. It will be necessary to relieve the bearing load while moving the bearing.

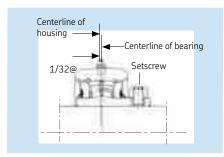

Step 7

Tighten each setscrew alternately with the proper allen wrench until they stop turning and the wrench starts to spring. The spring of the wrench can be easily seen and felt when an extension is used. When both set-



screws are tightened on the shaft, the bearing is firmly seated.**

Misalignment

The misalignment capability of SKF collar mounted roller units is a maximum of 1.5°. Even though the bearing inside the housing can accommodate more misalignment, the limiting component is the seal. The optimum contact seal performance is obtained when shaft misalignment and run-out are kept to a minimum.

Lubrication

All SKF unit roller bearing pillow blocks and flanged housings are equipped with a grease fitting which allows the roller bearing to be relubricated in service. Suggestions for relubrication frequency and quantity are found on page 95. Relubrication cycles shorter than suggested on page 95 may be necessary where the bearing operates in severe conditions such as humid or excessively dirty environments. The standard bearing units are packed with SKF grease LGEP2, which is a lithium based NLGI No. 2 grease with EP additives and a base viscosity at 140° F (40° C) of 190 CST (mm²/s). When relubricating the bearing care must be taken to use greases that are compatible with LGEP2. SKF suggests medium temperature, lithium base NLGI grade No. 2 greases with oil viscosity of 150 to 220 CST (mm^2/s) at 140° F (40° C) (750 to 1000 SUS at 100° F). When a unit is being relubricated, avoid excessive pressure, which may cause damage to the bearing seals. Should the bearing operating temperature

**CAUTION

Proper tightness of setscrews is necessary to assure adequate bearing service life and axial locating ability. To achieve full permissible axial load carrying rating without an abutment shoulder, the following recommended setscrew tightening torques should be applied.

Shaft sizes	Setscrew (no.) size	Torque in-lbs	Permissible axial load lbs
1 ⁷ / ₁₆ to 2 ³ / ₁₆	(2) ³ /8"-24	250	515
2 ⁷ / ₁₆ to 3 ¹ / ₂	(2) ¹ /2"-20	620	900
3 ¹¹ / ₁₆ to 4	(2) 5/8"-18	1325	1200
4 ⁷ / ₁₆ to 4 ¹⁵ / ₁₆	(4) 5/8"-18	1325	2400


Mounting instructions for ConCentra™ mount roller bearing unit pillow blocks and flanged housings (held and free bearings)


NOTE: Read all instructions carefully before mounting or dismounting. In the following instructions, provision has been made to achieve a tight interference fit on the shaft using commercial grade shafting. This is a unit assembly. Do not attempt to remove the bearing from the assembly prior to installation. One side of the bearing has a collar marked "MOUNTING" and one side marked "DISMOUNTING". Do not tighten any mounting screws. Do not remove the plastic protection plugs from the dismounting collar.


- Make sure that the support surface and the base of the bearing unit are clean and free from burrs.
- 2. Check the flatness and surface roughness of the support surface. SKF recommends using a support surface with a surface roughness $R_a \leq 12,5\mu m$ (500 μ in) and flatness tolerance that meets IT7 specification (approximately .0012 in./foot of base length). If shims are used, the entire contact surface must be covered.
- Remove any burrs on the shaft with emery cloth and wipe the shaft clean with a lintfree cloth.
- 4. Check the dimensional and form accuracy of the shaft. SKF recommends using shaft seats to dimensional tolerance class h9 and cylindricity tolerance IT5/2, in accordance with ISO 1101.


 The surface roughness R_a of the sleeve
 - seat, in accordance with ISO 4288, should not exceed R_a 3,2 μm (125 $\mu in.).$
- Mount any necessary components on the shaft, between the two bearing unit positions.
- 6. Coat the shaft seats with a thin layer of light oil.
- 7. With the mounting collar facing outward, slide the locating and non-locating bearing units onto the shaft and into position at the drive and non-drive ends of the shaft respectively. Take into consideration that during mounting, the units will be displaced axially on the stepped sleeve.
- 8. Fasten the bearing units to the support surface with suitable attachment bolts and tighten lightly (a).
- Adjust the position of the bearing units and shaft if necessary. Centre lines in the housing base can facilitate this.

- 10. To secure the locating bearing unit onto the shaft, tighten the set screws in the mounting collar "finger tight". Then tighten each set screw $\frac{1}{4}$ of a turn, according to the tightening pattern shown.
 - Shaft sizes 3.7/16" and 3.15/16" have M6 set screws that require a 3mm allen bit to tighten. Torque each M6 set screw to 7.4 Nm (65 in.lb.) (b).
 - Shaft sizes 4.7/16" and 4.15/16" have M8 set screws that require a 4mm allen bit to tighten. Torque each M8 set screw to 18 Nm (160 in.lb.) (b).
- Fully tighten the attachment bolts of the locating bearing unit to the support surface.
- 12. Find the middle of the non-locating bearing unit seat in the housing by supporting the shaft and pushing the bearing from one end position in the housing to the other, while keeping the housing fixed (c). Non-locating bearing units have a total of 5 mm (.2 in.) axial float. If only thermal elongation of the shaft is expected, position the non-locating bearing further in the direction of the locating bearing. Be careful to only push the bearing and not the housing.
- To secure the non-locating bearing unit onto the shaft and to support surface, follow steps 10 and 11 above.
- 14. Remove the shaft support.
- 15. Check that any misalignment of the shaft relative to the bearing units is less than 1.5°.
- 16. Where applicable, press the end cover into the housing bore recess.

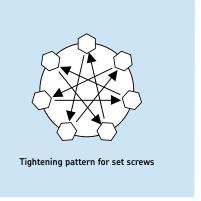

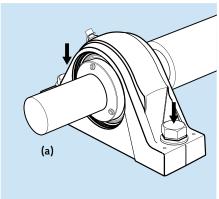


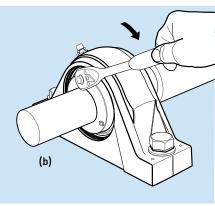


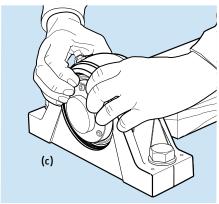



Dismounting instructions for ConCentra™ roller bearing units

- 1. Clean the external surfaces of the bearing unit.
- 2. Remove the end cover, if present.
- 3. Clean the internal hexagon of the set screw in the mounting collar of both the bearings units.
- 4. Remove any rust or surface damage from the shaft extension with emery cloth.
- 5. Start with the locating bearing unit. Loosen the attachment bolts and remove them. If possible, SKF recommends lifting the complete bearing arrangement i.e. shaft, both bearing units and associated components out first, before dismounting the bearing units (a).
- 6. Place a support under the shaft.
- 7. Loosen the set screws in the mounting collar by a few turns (b).
- 8. Face the mounting collar and while holding the base, pull the bearing unit until it releases from the shaft (c). The energy from the preloaded wave spring will facilitate the release of the bearing unit from the shaft. But if necessary, use a rubber hammer to tap the back-up ring on the opposite side of the unit (d).
- 9. Withdraw the bearing unit from the shaft.
- 10. Dismount the non-locating bearing unit in the same way as the locating bearing unit, repeating steps 5 to 9.16. Where applicable, press the end cover into the housing bore recess.

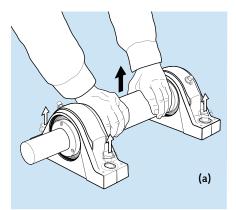

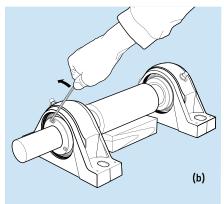

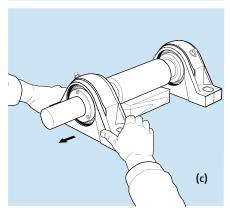

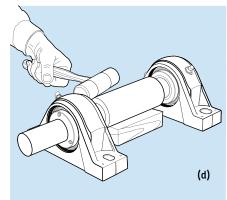

Mounting instructions for ball bearing unit pillow blocks and flanged housings

Step 1

Remove any burrs or rust on the shaft with an emery cloth or a fine file.



Step 2
Wipe the shaft with a clean cloth.



Step 3 Check the shaft diameter.


$\begin{tabular}{lll} Recommended shaft tolerances \\ Shaft diameter & Tolerance \\ Up to <math>1^{15}/_{16}$ " & Nominal to -0.0005" (-0.013 mm) & Nominal to -0.013 mm) & Nominal to -0.0010" (-0.025 mm)

NOTE: When the load is heavy, $\frac{C}{D}$ < 6.6

a press fit must be used.


Step 4

Slide the bearing and housing onto the shaft and position. For eccentric lock-type units, leave the collar loose on the shaft.

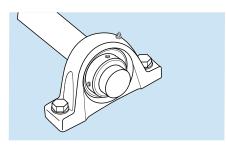


Step 5

Clean the base of pillow block and the support surface on which it rests. Be sure the supporting surface is flat. If the pillow block elevation must be adjusted by shims, the shims MUST extend the full length and width of the support surface. Bolt pillow block securely to the support. With flanged housings, clean the flange and support surface. Be sure the support surface is flat. Bolt the flanged housing securely to the support.

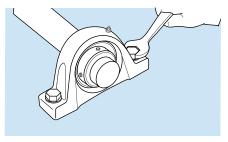


Step 6 Setscrew lock (6A)

Tighten each setscrew alternately with proper hex head socket wrench until they stop turning and the hex head socket wrench starts to spring. The spring of the hex head socket wrench can be easily seen and felt when the extension is used (see Table 13). When both setscrews are tightened on the shaft, the bearing is firmly seated. This completes the procedure for mounting setscrew lock units.

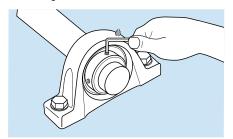

Eccentric lock (6B)

Slide the collar up to the bearing and turn it by hand in the direction of shaft rotation until it slips over the inner ring extension and engages the eccentric. Turn the collar quickly by hand in the direction of shaft rotation until the eccentric groove in the collar engages the eccentric on the inner ring and the two parts are locked together. This requires about 1/4 turn.

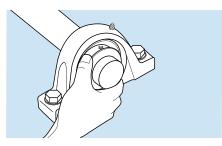

Step 7

Place a punch or drift in the blind hole in the collar and strike it sharply with a hammer in the direction of shaft rotation to lock the collar and ring tightly together. This also tightens the inner ring on the shaft.



Step 8

Tighten the collar setscrew with proper hex head socket wrench until the setscrew stops turning and the hex head socket wrench starts to spring. Proper tightness of setscrews is necessary to assure adequate bearing service life (see **Table 13**). The setscrew is an added locking device and should not be relied upon alone to lock the bearing to the shaft.



		Table 13					
Tightening torque for setscrews							
Setscrew size	Length in (mm)	Torque in-lbs(Nm)					
#10-32	$\frac{1}{4}$ (6.35) and longer	36 (4.0)					
¹ / ₄ (6.35) x 28	$\frac{1}{4}$ (6.35) and longer	87 (9.8)					
⁵ / ₁₆ (7.96) x 24	⁵ / ₁₆ (7.96) and longer	165 (18.6)					
³ / ₈ (9.53) x 24	$^{3}/_{8}$ (9.53) and longer	290 (32.8)					
⁷ / ₁₆ (11.11) × 20	$^{7}/_{16}$ (11.11) and longer	430 (48.6) ⁾					
¹ / ₂ (12.70) x 20	$^{1}/_{2}$ (12.70) and longer	620 (70.1)					

Misalignment

Ball bearing units can compensate for up to $\pm 5^{\circ}$ of static misalignment. However, in the cast iron housings when it is desirable to relubricate the bearings, initial errors in alignment should not exceed $\pm 2^{\circ}$ for basic bearings size 211 and smaller and $\pm 1.5^{\circ}$ for larger sizes. Misalignment greater than this will prevent the lubrication holes in the outer ring of the bearing from lining up with the groove in the housing bore and the bearings will not be relubricated.

Lubrication

Generally speaking, ball bearing units are designed to operate without relubrication under normal speed and operating conditions. All ball bearing units are sealed at both sides with rubbing contact seals and are filled with a special long life grease of NLGI consistency 2. The grease has good corrosion inhibiting properties and is suitable for operating temperatures between –4° F and 248° F. However, under extreme conditions or in heavily contaminated environments, it may be necessary to relubricate the bearings.

Many SKF ball bearing units are equipped with a grease fitting that allows the bearing to be relubricated in service. When relubricating, care must be taken to use greases that are compatible with the original grease. SKF suggests a medium temperature, lithium calcium base, NLGI 2 grease having a base oil with a viscosity of 900 SUS (200mm²/s) at 100° F (40° C). When a unit is being relubricated, avoid excessive pressure, which may cause damage to the bearing seals.

See Lubrication section, page 87. Should the bearing temperature be below 32° F (0° C) or above 200° F (93° C), consult SKF for lubrication recommendations.


Cages

Most ball bearing units are fitted with an injection molded, heat stabilized, glass fiber reinforced polyamide 6.6 cage that has a maximum operating temperature range of 240° F.

Dismounting instructions for ball unit pillow blocks and flanged housings


Setscrew lock

Step 1
Loosen setscrews

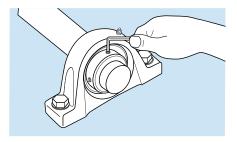


Step 2

Unbolt the housing from its support. Complete bearing unit can then be removed from the shaft. It will be necessary to relieve the bearing load when removing the unit.

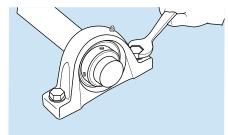

Eccentric lock

Step 1 First loosen setscrews.

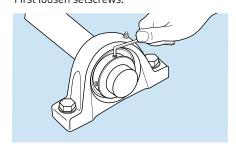

Step 2

Place punch or drift in the blind hole in the collar and strike it sharply with a hammer in the opposite direction of shaft rotation.




Step 3

The collar can now be turned by hand and removed from the inner ring.



Sten 4

The housing can then be unbolted from its support and the complete bearing unit removed from the shaft. It will be necessary to relieve the bearing load while removing the bearing unit.

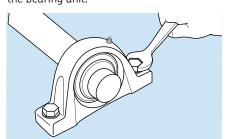

To remove bearing from housing

Setscrew lock

Tilt the bearing on its spherical seat 90° from its normal position and slide it out through the slots provided in the housing.

Eccentric lock

Remove the collar first. Tilt the bearing on its spherical seat 90° from its normal position and slide it out through the slots provided in the housing.




Mounting instructions for Concentra ball unit pillow blocks and flanged housings

NOTE: This is a unit assembly. No attempt should be made to disassemble the bearing prior to installation. In the following instructions, provision has been made to achieve a tight interference fit on the shaft using commercial grade shafting.

Read all instructions carefully before mounting or dismounting.

Step 1

Remove any burrs or rust on the shaft with an emery cloth or a fine file.

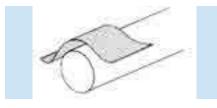

Step 2
Wipe the shaft with a clean cloth.



Step 3
Check shaft diameter.

Recommended shaft tolerances


Shaft diameter	Tolerance
Up to $1^{15}/_{16}$ "	+0.000" to -0.003"
Up to 55mm	$+0.00$ mm to -76 μ m
2" to 2 ¹⁵ / ₁₆ "	+0.000" to -0.004"
55mm to 75mm	+0.00 mm to –102 μm

Step 4
Lubricate the shaft with light oil.



Step 5

Clean the base of the pillow block and the support surface on which it rests. Be sure the supporting surface is flat. If the pillow block elevation must be adjusted by shims, the shims MUST extend the full length and width of the support surface.

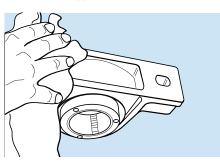


Step 6

Slide the bearing and housing, with the mounting side facing outward, onto the shaft where the pillow block is to be secured. Bolt the pillow block securely to the support.



Step 7

Position the collar so that a setscrew is directly opposite the split in the sleeve. Snug the mounting screws to finger tightness holding the short leg of the supplied allen wrench.

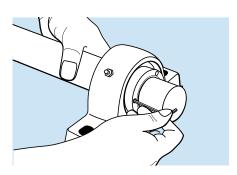


46 **5KF**

Step 8

Tighten the mounting screws a total of 1/2 turn by alternately tightening in two increments (1/4 turn and 1/4 turn). Lastly tighten each setscrew, starting with the screw opposite the split in the sleeve, until the long end of the allen wrench comes in contact with supplied torque indicator or to a torque of (7,4 Nm) 5.5 ft. lbs.

CAUTION: Do not use auxiliary equipment such as a hammer or pipe in tightening the screws.

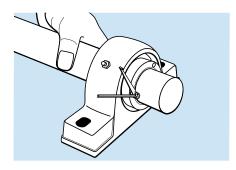

Step 9 Pillow block housings – 2nd unit

Position the second unit at its correct location on the shaft. Place the housing mounting bolts in their holes but do not tighten. Repeat steps 7 and 8. Tighten the housing mounting bolts to the correct torque.

Flange housings - 2nd unit

Position the second bearing and housing at its location on the shaft. Snug the mounting screws to finger tightness (unit should be able to slide along shaft) holding the short leg of the supplied allen wrench. Bolt the flange securely to the mounting surface. Repeat steps 7 and 8.

Misalignment

Ball bearing units can compensate for up to $\pm 5^{\circ}$ of static misalignment. However, in the cast iron housings when it is desirable to relubricate the bearings, initial errors in alignment should not exceed $\pm 2^{\circ}$ for basic bearings size 211 and smaller and $\pm 1.5^{\circ}$ for larger sizes. Misalignment greater than this will prevent the lubrication holes in the outer ring of the bearing from lining up with the groove in the housing bore and the bearings will not be relubricated.

Lubrication

Generally speaking, ball bearing units are designed to operate without relubrication under normal speed and operating conditions. All ball bearing units are sealed at both sides with rubbing contact seals and are filled with a special long life grease of NLGI consistency 2. The grease has good corrosion inhibiting properties and is suitable for operating temperatures between –4° F and 248° F. However, under extreme conditions or in heavily contaminated environments, it may be necessary to relubricate the bearings.

Many SKF ball bearing units are equipped with a grease fitting that allows the bearing to be relubricated in service. When relubricating, care must be taken to use greases that are compatible with the original grease. SKF suggests a medium temperature, lithium calcium base, NLGI 2 grease having a base oil with a viscosity of 900 SUS (200mm²/s) at 100° F (40° C). When a unit is being relubricated, avoid excessive pressure, which may cause damage to the bearing seals.

See Lubrication section, page 87. Should the bearing temperature be below 32° F (0° C) or above 200° F (93° C), consult SKF for lubrication recommendations.

Cages

Most ball bearing units are fitted with an injection molded, heat stabilized, glass fiber reinforced polyamide 6.6 cage that has a maximum operating temperature range of 240° F.

Dismounting instructions for Concentra ball unit pillow blocks and flanged housings

Step 1

It may be necessary to clean the shaft extension with emery cloth to remove rust or repair surface damage.

Step 2

Loosen the mounting setscrews 1 to 2 full turns.

Step 3

Lightly impact the bearing collar side of the shaft until the bearing releases from shaft. Remove complete unit from the shaft.

Test running

After mounting a bearing, the prescribed lubricant is applied and a test run made so that noise and bearing temperature can be checked. The test run should be carried out under partial load and — where there is a wide speed range — at slow or moderate speed. Under no circumstances should a rolling bearing be allowed to start up unloaded and accelerated to high speed, as there is a danger that the rolling elements would slide on the raceways and damage them, or that the cage would be subjected to inadmissible stresses.

Normally, bearings produce an even "purring" noise. Whistling or screeching indicates inadequate lubrication. An uneven rumbling or hammering is due in most cases to the presence of contaminants in the bearing or to bearing damage caused during mounting.

An increase in bearing temperature immediately after start up is normal. For example, in the case of grease lubrication, the temperature will not drop until the grease has been evenly distributed in the bearing arrangement, after which an equilibrium temperature will be reached. Unusually high temperatures or constant peaking indicates that there may be too much lubricant in the arrangement or that the bearing is radially or axially distorted. Other causes are that the associated components have not been correctly made or mounted, or that the seals have excessive friction.

During the test run, or immediately afterwards, the seals should be checked to see that they perform correctly and any lubrication equipment, as well as the oil level of an oil bath, should be checked. It may be necessary to sample the lubricant to determine whether the bearing arrangement is contaminated or components of the arrangement have become worn.

Dismounting methods

Dismounting of bearings may become necessary when a machine functions improperly or is being overhauled. Many precautions and operations used to dismount bearings are common to the mounting of bearings. The methods and tools depend on many factors such as bearing design, accessibility, type of fit, etc.

There are three dismounting methods: mechanical, hydraulic and oil injection.

• When dismounting bearings, never apply the force through the rolling elements.

Interference fits on a cylindrical shaft

Bearings with a bore diameter up to 120 mm, mounted with an interference fit on the shaft, can be dismounted using a conventional puller. The puller should engage the inner ring, and the bearing is then removed with a steady force until the bearing bore completely clears the entire length of the cylindrical seating, see **Figure 15**.

Larger bearings with an interference fit on the shaft often require considerable dismounting force. In these cases a hydraulic tool is more suitable than a mechanical one.

The puller should engage the inner ring

Interference fit in the housing

A bearing mounted in a housing without shoulders can be removed by hammer blows directed on a sleeve that abuts the outer ring. Larger bearings require greater force to dismount, and the use of a press is recommended.

Interference fit both in the housing and on the shaft

For bearings with an interference fit on both rings, the best method is to allow the bearing to be pressed out of the housing with the shaft. If this is not suitable, the opposite procedure – allowing the bearing to come off the shaft with the housing – can be used.

Dismounting from a tapered shaft

Smaller bearings can be dismounted using a conventional puller, which engages the inner ring. Center the puller accurately to avoid damage to the bearing seating. Larger bearings may require considerable force to dismount, so a hydraulic withdrawal tool may be more suitable than a mechanical one. The best way to facilitate dismounting of inner rings is to utilize the SKF oil injection method. Detailed information is found at www.skf.com/mount.

Dismounting from sleeves

Adapter and withdrawal sleeves are often used. CARB toroidal roller bearings are, in principle, dismounted in the same way as other bearings. Detailed information is given at www.skf.com/mount.

Can the bearing be used again?

Always inspect a dismounted bearing, but don't try to judge whether it can be reused until after it has been cleaned. Treat it as new. Never spin a dirty bearing; instead, rotate it slowly while washing. Wash with a petroleum-based solvent. Dry with a clean, lint-free cloth or compressed clean, moisture-free air, taking care that no bearing part starts rotating. Contact your SKF Authorized Distributor for information on equipment for cleaning and drying.

Larger bearings with badly oxidized lubricant can be cleaned with a strong alkaline solution, for example, a solution containing up to 10% caustic soda. Add 1% of a suitable wetting agent. Take care when following this cleaning procedure: lye is harmful to skin, clothing and aluminum. Always use protective gloves, goggles and apron.

Examine a used bearing closely to determine whether it is reusable. Use a small mirror and a dental-type probe with a rounded point to inspect raceways, cage and rolling elements. Look for scratches, marks, streaks, cracks, discolorations, mirror-like surfaces and so on. Carefully rotate the bearing and listen to the sound. An undamaged bearing (i.e., one that has no marks or other defects and runs evenly without abnormally large radial internal clearance) can be remounted.

Before a large bearing is remounted for a critical application, ask SKF for examination. The cost of such inspection may actually save money.

Bearings with a shield or seal on one side should be cleaned, dried, inspected and handled in the same way as bearings without seals. However, never wash a bearing with seals or shields on both sides. They are sealed and lubricated for life and should be replaced if you suspect bearing or seal damage.

To prevent corrosion, use a rust preventative immediately after cleaning.

Cleaning bearings

All lubricants have a tendency to deteriorate in the course of time, but at a greatly different rate. Therefore, sooner or later, it will be necessary to replace the old lubricant with new. Oils and greases should be removed in the early stages of deterioration so that removal does not become unnecessarily troublesome. Oils can be drained and the bearing flushed and washed, preferably with some solvents, kerosene or even with light oil. The solution should then be drained thoroughly and the bearing and housing flushed with some hot, light oil and again drained before adding new lubricant. Lighter petroleum solvents may be more effective for cleaning but are often objectionable, either because of flammability or because they may have a tendency to become corrosive, particularly in the presence of humidity. A grease is also more easily replenished in early stages of deterioration, for instance, by displacement with new grease, if the housing is designed so that this can be done. Bearings which are dismantled are, of course, much more easily cleaned than bearings which must stay

48 **5KF**

assembled in equipment. Solvents can then be used more freely for cleaning. Badly oxidized oil and grease, however, need a very thorough treatment for their removal; ordinary solvents are usually not satisfactory. The following methods for cleaning unshielded bearings, as suggested by ABEC (Annular Bearing Engineers' Committee) are recommended.

1. Cleaning unmounted bearings which have been in service

Place bearings in a basket and suspend the basket in a suitable container of clean, cold petroleum solvent or kerosene and allow to soak, preferably overnight. In cases of badly oxidized grease, it may be found expedient to soak bearings in hot, light oil at 93° to 116° C (200° to 240° F), agitating the basket of bearings slowly through the oil from time to time. In extreme cases, boiling in emulsifiable cleaners diluted with water will usually soften the contaminating sludge. If the hot emulsion solutions are used, the bearings should be drained and spun individually until the water has completely evaporated. The bearings should be immediately washed in a second container of clean petroleum solvent or kerosene. Each bearing should be individually cleaned by revolving by hand with the bearing partly submerged in the solvent... turning slowly at first and working with a brush if necessary to dislodge chips or solid particles. The bearings may be judged for their condition by rotating by hand. After the bearings have been judged as being clean, they should immediately be spun in light oil to completely remove the solvent ... coated with preservative if they are not to be reassembled immediately and wrapped at once in clean oil-proof paper while awaiting reassembly. The use of chlorinate solvents of any kind is not recommended in bearing cleaning operations because of the rust hazard involved. Nor is the use of compressed air found desirable in bearing cleaning operations.

2. Cleaning of bearings as assembled in an installation

For cleaning bearings without dismounting, hot, light oil at 93° to 116° C (200° to 240° F) may be flushed through the housing while the shaft or spindle is slowly rotated. In cases of badly oxidized grease and oil, hot, agueous emulsions may be run into the housings, preferably while rotating the bearings until the bearing is satisfactorily cleaned. The solution must then be drained thoroughly, providing rotation if possible, and the bearing and housing flushed with hot, light oil and again drained before adding new lubricant. In some very difficult cases an intermediate flushing with a mixture of alcohol and light mineral solvent after the emulsion treatment may be useful. If the bearing is to be relubricated with grease, some of the fresh grease may be forced through the bearing to purge any remaining contamination. This practice cannot be used unless there are drain plugs which can be removed so that the old grease may be forced out. Also, bearings should be operated for at least twenty minutes before drain plugs are replaced, as excess lubricant will cause serious overheating of the bearing.

3. Oils used for cleaning

Light transformer oils, spindle oils, or automotive flushing oils are suitable for cleaning bearings, but anything heavier than light motor (SAE 10) is not recommended. An emulsifying solution made with grinding, cutting or floor cleaning compounds, etc., in hot water, has been found effective. Petroleum solvents must be used with the usual precautions associated with fire hazards.

WARNING:

When hot cleaning, use a thin, clean oil with a flash point of at least 480° F (250° C). Use protective gloves whenever possible. Regular contact with petroleum products may cause allergic reactions. Follow the Material Safety Data Sheet (MSDS) safety instructions included with the solvent you use to clean bearings.

Shaft and housing fits

Purpose of proper fits

In order for a bearing to function properly and achieve its load carrying ability, the fit between the shaft and the inner ring, and the fit between the outer ring and the housing must be suitable for the application. Although a bearing must satisfy a wide range of operating conditions, which determine the choice of fit, the tolerances for the bearing itself are standardized. Therefore, the desired fit can only be achieved by selecting the proper tolerance for the shaft diameter and housing bore. The fits must ensure that the rings are properly supported around their circumference as well as across their entire widths. The bearing seats must be made with adequate accuracy and their surface should be uninterrupted by grooves, holes or other features. In addition, the bearing rings must be properly secured to prevent them from turning relative to their seats under load.

The system of limits and fits used by industry for all rolling bearings, except tapers (ISO Standard 286), contains a considerable choice of shaft and housing tolerances. When used with standard bearings, these will give any of the desired fits, from the tightest to the loosest required. A letter and numeral designate each tolerance. The letter (lower case for shaft diameters and capitalized for housing bores) locates the tolerance zone in relation to the nominal dimensions. The numeral portion provides the range of the tolerance zone. Figure 1 illustrates this relation. The rectangles indicate the location and magnitude of the various shaft and housing tolerance zones, which are used for rolling bearings, superimposed on the bore and O.D. tolerance of the bearing rings.

Selection of fit


The selection of the proper fit is dependant upon several factors, which include the size of the bearing, type of loading, magnitude of applied load, bearing internal clearance, temperature conditions, design and material of shaft and housing, ease of mounting and dismounting, displacement of the non-locating bearing, and running accuracy requirements. Consideration must also be given to the fact that a solid shaft deforms differently than a hollow one.

Size of the bearing

As the overall size of the bearing increases, the magnitude of the fits typically increases as well. This is based on the assumption that the applied loads will be higher with larger bearings than with smaller bearings. Hence, the fit selection tables will show increasing fits as the bearing diameter increases.

Suitable fits

Generally speaking, proper fits can only be obtained when the rings are mounted with an appropriate degree of interference. Improperly secured bearing rings generally cause damage to the bearings and associated components. However, when easy mounting and dismounting are desirable, or when axial displacement is required as with a non-locating bearing, an interference fit cannot always be used. In certain cases, where a loose fit is employed, it is necessary to take special precautions to limit the inevitable wear from creeping or turning of the bearing ring. Some examples of this are surface hardening of the bearing seating and abutments, lubrication of the mating surfaces via special lubrication grooves and the removal of wear particles, or slots in the bearing ring side faces to accommodate keys or other holding devices.

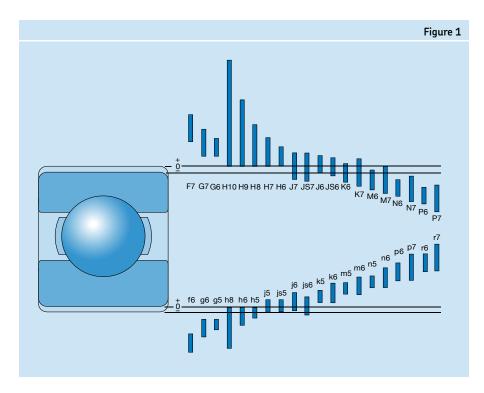

Type of loading (stationary or rotating)

Type of loading refers to the direction of the load relative to the bearing ring being considered. Essentially there are three different conditions: rotating load, stationary load and direction of load indeterminate (See Table 1).

Rotating load refers to a bearing ring that rotates while the direction of the applied load is stationary. A rotating load can also refer to a bearing ring that is stationary, and the direction of the applied load rotates so that all points on the raceway are sub-

jected to load in the course of one revolution. Heavy loads, which do not rotate but oscillate are generally considered as rotating loads. A bearing ring subjected to a rotating load will creep or turn on its seat if mounted with either a clearance fit or too light an interference fit. Fretting corrosion of the contact surfaces will result and eventual turning of the ring relative to its seat can occur, resulting in scored seats. To prevent this from happening, the proper interference fits must be selected and used.

Stationary load refers to a bearing ring that is stationary while the direction of the

applied load is also stationary. A stationary load can also refer to a bearing ring that rotates at the same speed as the load, so that the load is always directed towards the same position on the raceway. Under these conditions, a bearing ring will normally not turn on its seating. Therefore, an interference fit is not normally required unless it is required for other reasons.

Direction of load indeterminate refers to variable external loads, shock loads, vibrations and unbalance loads in highspeed machines. These give rise to changes in the direction of load, which cannot be

52 **5KF**

accurately predicted. When the direction of load is indeterminate, and particularly where heavy loads are involved, it is desirable for both rings to have an interference fit. For the inner ring, the recommended fit for a rotating load is normally used. However, when the outer ring must be free to move axially in the housing, and the load is not heavy, a somewhat looser fit than that recommended for a rotating load may be used.

Magnitude of applied load

The interference fit of a bearing ring on its seat will be loosened with increasing load, since the ring can flex under load. If the ring is also exposed to a rotating load, it may begin to creep. Therefore, the amount of interference fit should be related to the magnitude of the applied load; the heavier the load, the greater the interference fit that is required. See Conditions column in **Tables 2, 4,** and **5**.

Bearing internal clearance

When a ring is pressed onto a shaft or into a housing, the interference fit causes the ring to either expand or compress, depending upon whether it is the inner ring or outer ring respectively. As a result, the bearing internal clearance is reduced. In order to avoid preloading a bearing and causing it to overheat, a minimum clearance should remain in the bearing after mounting. The initial clearance and permissible reduction depend on the type and size of the bearing. The reduction in clearance due to the interference fit can be so large that bearings with an initial clearance greater than Normal have to be used in order to prevent the bearing from becoming preloaded (Figure 2).

Temperature conditions

In many applications the outer ring has a lower temperature in operation than the inner ring. This leads to a reduction of the radial internal clearance. When in service, bearing rings will normally reach a higher temperature than the components they are mounted to. This can result in a loosening of the inner ring press fit on the shaft, while the outer ring may expand into the housing and prevent the desired axial float of the ring. Temperature differences and the direction of heat flow in the bearing arrangement must therefore be carefully considered when selecting fits (**Figure 3**).

Design and material of shaft and housing

The fit of a bearing ring on its seating must not be uneven, causing distortion or an out-of-round condition. This can be caused, for example, by discontinuities in the seating surface. For example, split housings are not generally suitable when an interference fit is required on an outer ring. To provide adequate support for bearing rings mounted in thin-walled housings, light alloy housings or on hollow shafts, heavier interference fits are typically required to account for the slight collapse of these components.

The component material that the bearing is mounted to is also of great importance in determining the proper fit tolerance. For instance, stainless steel shafts and aluminum housings have significantly different coefficients of thermal expansion than bearing steel and therefore will have slightly different fit requirements to account for this.

For applications with stainless steel bearings, the recommended tolerances in **Tables 2** thru **6** apply, but the restrictions in the **Footnotes 2** and **3** in **Table 2** shall be taken into account. **Footnote 1** in **Table 2** is not valid for stainless steel bearings. If tighter fits than those recommended in **Table 2** are needed, please contact SKF Application Engineering.


Ease of mounting and dismounting


Bearings with clearance or loose fits are usually easier to mount or dismount than those with interference fits. When operating conditions necessitate interference fits and when it is essential that mounting and dismounting can be done easily, separable bearings, or bearings with a tapered bore may be used. Bearings with a tapered bore can be mounted either directly on a tapered shaft seating or via adapter or withdrawal sleeves on smooth or stepped cylindrical shafts.

Displacement of the non-locating bearing

If a non-separable bearing is used as the non-locating bearing, it is imperative that one of the bearing rings is free to move axially at all times during operation. Using a clearance fit for the ring that has the stationary load will allow this (see **Table 1**). In addition to having a loose fit in the housing bore, the bearing should also be unrestricted to slide axially (i.e. no housing shoulders near the bearing outer ring). In the case of a stationary load on the inner ring of a bearing, the inner ring should have the loose fit and there should be a gap between it and the shaft shoulder to allow the shaft to expand through the bore of the inner ring.

If cylindrical roller bearings having one ring without flanges, needle roller bearings or CARB toroidal roller bearings are being used, both bearing rings may be mounted with an interference fit because axial displacement will take place within the bearing.

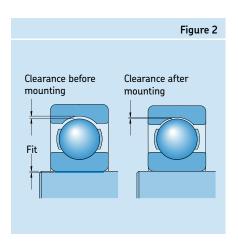

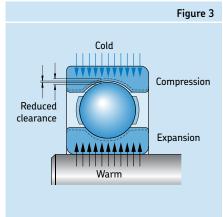

Shaft fit tolerances for solid steel shafts

Classification for metric radial ball and roller bearings with cylindrical bore, Classes ABEC-1, RBEC-1 (except inch dimensioned taper roller bearings)

Conditions	Examples	Shaft diameter, n Ball bearings ¹⁾	nm Cylindrical roller bearings	Taper roller bearings	CARB and spherical roller bearings	Tolerance ¹¹⁾
Rotating inner ring load or	direction of load indetermina					~ 1
Light and	Conveyors, lightly	≤ 17	-	-	-	js5 (h5) ²⁾
variable loads	loaded gearbox	18 to 100	≤ 25	≤ 25	-	j6 (js5) ²⁾
(P ≤ 0.05 C)	bearings	101 to 140	26 to 60	26 to 60	-	k6
		-	61 to 140	61 to 140	-	m6
Normal to	Bearing applications	≤ 10	-	_	_	js5
heavy loads	generally,	11 to 17	-	-	-	j5 (js5) ²⁾
(P > 0.05 C)	electric motors,	18 to 100	-	_	< 25	k5 ³⁾
	turbines, pumps,	-	≤ 30	≤ 40	-	k6
	gearing, wood	101 to 140	31 to 50	-	25 to 40	m5
	working machines,	141 to 200	_	41 to 65	_	m6
	windmills	-	51 to 65	-	41 to 60	n5 ⁴⁾
		201 to 500	66 to 100	66 to 200	61 to 100	n6 ⁴⁾
		_	101 to 280	201 to 360	101 to 200	p6 ⁴⁾
		> 500	_	_	_	p7 ⁴⁾
			281 to 500	361 to 500	201 to 500	r6 ⁴⁾
			> 500	> 500	> 500	r7 ⁴⁾
Heavy to very	Axle boxes for heavy	_	51 to 65	_	51 to 70	n5 ⁴⁾
heavy loads and	railway vehicles,	_	66 to 85	51 to 110	_	n6 ⁴⁾
shock loads	traction motors,	_	86 to 140	111 to 200	71 to 140	p6 ⁴⁾
with difficult	rolling mills	_	141 to 300	201 to 500	141 to 280	r6 ⁴⁾
working conditions	- Totaling Irlints		301 to 500	201 (0 300	281 to 400	s6min ± IT6/2
(P > 0.1 C)	_	_	> 500	> 500	> 400	s7min ± IT7/2
High demands on	Machine tools	8 to 240	_			js4
running accuracy	Machine tools	0 to 240	25 to 40	25 to 40	_	js4 (j5) ⁷⁾
with light loads		_	41 to 140	41 to 140		k4 (k5) ⁷⁾
(P ≤ 0.05 C)			141 to 200	141 to 200		m5
(1 2 0.00 0)			201 to 500	201 to 500	_	n5
			201 10 000	201 (0 000		,,,,
Stationary inner ring load Easy axial displace-	Wheels on					g6 ⁸⁾
ment of inner ring	non-rotating axles					90
on shaft desirable	non-rotating axies					
Easy axial displace-	Tension pulleys,					h6
ment of inner ring	rope sheaves					
on shaft unnecessary						
Axial loads only						
	Bearing applications	≤ 250	≤250	≤250	≤ 250	j6
	of all kinds	> 250	> 250	> 250	> 250	js6

¹⁾ For normally to heavily loaded ball bearings (P > 0.05 C), radial clearance greater than Normal is often needed when the shaft tolerances in the table above are used. Sometimes the working conditions require tighter fits to prevent ball bearing inner rings from turning (creeping) on the shaft. If proper clearance, mostly larger than Normal clearance is selected, the tolerances below can then be used. For additional information please contact SKF Application Engineering.

K4 for shaft diameters 10 to 17 mm, k5 for shaft diameters 18 to 25 mm, m5 for shaft diameters 26 to 140 mm, n6 for shaft diameters 141 to 300 mm, p6 for shaft diameters 301 to 500 mm

²⁾ The tolerance in brackets applies to stainless steel bearings

³⁾ For stainless steel bearings within the diameter range 17 to 30 mm, tolerance j5 applies

⁴⁾ Bearings with radial internal clearance greater than Normal are recommended.

⁵⁾ Bearings with radial internal clearance greater than Normal are recommended for d \leq 150 mm. For d > 150 mm bearings with radial internal clearance greater than Normal may be necessary.

⁶⁾ Please consult SKF Application Engineering for tolerance values.

⁷⁾ The tolerances in brackets apply to taper roller bearings. For lightly loaded taper roller bearings adjusted via the inner ring, js5 or js6 should be used

⁸⁾ Tolerance f6 can be selected for large bearings to provide easy displacement

⁹⁾ For ABEC-5 bearings, use Table 18; for higher precision bearings, other recommendations apply. Consult with SKF Application Engineering.

¹⁰⁾ Shaft tolerances for Y-Bearings (setscrew mounted) are available from SKF Application Engineering.

¹¹⁾ See Table 8 for specific shaft diameters

Shaft fit tolerances for thrust bearings on solid steel shafts Conditions Shaft diameter, mm Axial loads only Thrust ball bearings - h6 Cylindrical roller thrust bearings - h6 (h8) Cylindrical roller and cage thrust assemblies - h8 Combined radial and axial loads acting on spherical roller thrust bearings Stationary load on shaft washer ≤ 250 > 250 Stationary load on shaft washer, ≤ 200 Action of load indeterminate 201 to 400 Tolerance 1) h6 Axial loads only h6 Action direction of load indeterminate			Table 3
Axial loads only Thrust ball bearings - h6 Cylindrical roller thrust bearings - h6 (Cylindrical roller and cage thrust assemblies - h8 Combined radial and axial loads acting on spherical roller thrust bearings Stationary load on shaft washer ≤ 250 j6 > 250 js6 Rotating load on shaft washer, ≤ 200 k6 or direction of load indeterminate 201 to 400 m6	Shaft fit tolerances for thrust bearing	s on solid steel shafts	
$ \begin{array}{c ccccccccccccccccccccccccccccccccccc$	Conditions	, and the second se	Tolerance ¹⁾
Cylindrical roller thrust bearings – h6 (h8) Cylindrical roller and cage thrust assemblies – h8 Combined radial and axial loads acting on spherical roller thrust bearings Stationary load on shaft washer ≤ 250 j6 > 250 js6 Rotating load on shaft washer, ≤ 200 k6 or direction of load indeterminate 201 to 400 m6	Axial loads only		
Cylindrical roller and cage thrust assemblies − h8 Combined radial and axial loads acting on spherical roller thrust bearings Stationary load on shaft washer ≤ 250 j6 > 250 js6 Rotating load on shaft washer, ≤ 200 k6 or direction of load indeterminate 201 to 400 m6	Thrust ball bearings	_	h6
Combined radial and axial loads acting on spherical roller thrust bearings Stationary load on shaft washer ≤ 250 j6 > 250 js6 Rotating load on shaft washer, ≤ 200 k6 or direction of load indeterminate 201 to 400 m6	Cylindrical roller thrust bearings	_	h6 (h8)
Stationary load on shaft washer ≤ 250 j6 > 250 js6 Rotating load on shaft washer, ≤ 200 k6 or direction of load indeterminate 201 to 400 m6	Cylindrical roller and cage thrust assemblies	-	h8
> 250 js6 Rotating load on shaft washer, ≤200 k6 or direction of load indeterminate 201 to 400 m6	Combined radial and axial loads acting on spher	ical roller thrust bearings	
Rotating load on shaft washer, ≤200 k6 or direction of load indeterminate 201 to 400 m6	Stationary load on shaft washer	≤ 250	j6
or direction of load indeterminate 201 to 400 m6		> 250	js6
	Rotating load on shaft washer,	≤200	k6
100	or direction of load indeterminate	201 to 400	m6
> 400 n6		> 400	n6

¹⁾ See Table 8 for specific shaft diameters

Table 4

Housing fit tolerances for cast Iron and steel housings (solid housings)

Classification for metric radial ball and roller bearings tolerance classes ABEC-1, RBEC-1 (except inch dimensioned taper roller bearings)

Conditions	Examples	Tolerance ^{1) 4)}	Displacement of outer ring
Rotating outer ring load			
Heavy loads on bearings in thin-walled housings, heavy shock loads (P > 0.10 C)	Roller bearing wheel hubs, big-end bearings	P7	Cannot be displaced
Normal to heavy loads (P > 0.05 C)	Ball bearing wheel hubs, big-end bearings, crane traveling wheels	N7	Cannot be displaced
Light and variable loads (P ≤ 0.05 C)	Conveyor rollers, rope sheaves, belt tensioner pulleys	M7	Cannot be displaced
Direction of load indeterm	inate		
Heavy shock loads	Electric traction motors	M7	Cannot be displaced
Normal and heavy loads (P > 0.06 C), axial displacement of outer ring unnecessary	Electric motors, pumps, crankshaft bearings	K7	Cannot be displaced as a rule
Accurate or quiet running	J ²⁾		
Ball bearings	Small electric motors	J6 ³⁾	Can be displaced
Taper roller bearings	When adjusted via the outer ring Axially located outer ring Rotating outer ring load	JS5 K5 M5	- - -

¹⁾ For ball bearings with $D \le 100$ mm, tolerance grade IT6 is often preferable and is recommend for bearings with thin-walled rings, e.g. in the 7, 8 or 9 Dimension Series. For these series, cylindricity tolerances IT4 are also recommended.

Dimensional, form, and running accuracy requirements

The accuracy of cylindrical bearing seatings on shafts and in housing bores should correspond to the accuracy of the bearings used. The following guideline values for dimensional, form and running accuracy are given for machining seatings and abutments.

Dimensional tolerances

For bearings made with normal tolerances. the dimensional accuracy of the cylindrical seatings on the shaft is shown in **Tables 2** and 3. For housings, see Tables 4, 5 and 6. For bearings with higher accuracy, correspondingly higher tolerances should be used; for ABEC 5 bearings see Tables 18 and 19 (pages 85 and 86). Where adapter or withdrawal sleeves are used on cylindrical shafts, wider diameter tolerances can be permitted than for bearing seatings (see **Table 7** page 57 for inch sleeves and **Table 11** page 80 for metric sleeves). The basic tolerance for the standardized tolerance series to ISO/R286-1962 will be found in **Table 10** (page 80).

Tolerances for cylindrical form

The cylindricity tolerance t, as defined in ISO 1101-1983 should be 1 to 2 IT grades better than the prescribed dimensional tolerance, depending on requirements. For example, if a bearing seating on a shaft has been machined to tolerance m6, then the accuracy of form should be to IT5 or IT4. The tolerance value t_1 for cylindricity is obtained for an assumed shaft diameter of 150 mm from t_1 = IT5/2 = 18/2 = 9 μ m or from t_1 = IT4/2 = 12/2 = 6 μ m. **Table 13** (page 81) gives guideline values for the cylindrical form tolerance (and for the total runout tolerance t_3 if preferred).

Tolerance for perpendicularity

Abutments for bearing rings should have a rectangularity tolerance as defined in ISO 1101-1983, which is better by at least one IT grade than the diameter tolerance of the associated cylindrical seating. For thrust bearing washer seatings, the perpendicularity tolerance should not exceed the values to IT5. Guideline values for the rectangularity tolerance t_2 (and for the total axial runout t_4 will be found in **Table 13**.

²⁾ For ABEC-5 bearings, use Table 19; For higher precision bearings, other recommendations apply. Contact SKF Application Engineering

³⁾ When easy displacement is required use H6 instead of J6 $\,$

⁴⁾ See **Table 9** for specific housing bore diameters

Table 5

Housing fit tolerances for cast iron and steel housings (split or solid housings)

Classification for metric radial ball and roller bearings tolerance classes ABEC-1, RBEC-1 (except inch dimensioned taper roller bearings)

	Conditions	Examples	Tolerance 1) 4)	Displacement of outer ring
I	Direction of load indetermin	nate		
	Light to normal loads (P ≤ 0.10 C), axial displacement of outer ring desirable	Medium-sized electrical machines, pumps, crankshaft bearings	J7	Can be displaced as a rule
	Stationary outer ring load			
	Loads of all kinds railway axle boxes	General engineering,	H7 ²⁾	Can be displaced
	Light to normal loads (P ≤ 0.10 C) with simple working conditions	General engineering	H8 ³⁾	Can be displaced
	Heat conduction through shaft	Drying cylinders, large electrical machines with spherical roller bearings	G7 ²⁾	Can be displaced

For ball bearings with D ≤ 100 mm, tolerance grade IT6 is often preferable and is recommend for bearings with thin-walled rings, e.g. in the 7, 8 or 9 Dimension Series. For these series, cylindricity tolerances IT4 are also recommended.

Table 6

Housing fit tolerances for thrust bearings in cast iron and steel housings

Conditions	Tolerance ¹⁾	Remarks					
Axial loads only							
Thrust ball bearings	Н8	For less accurate bearing arrangements there can be a radial clearance of up to 0.001 D					
Cylindrical roller thrust bearings	H7 (H9)						
Cylindrical roller and cage thrust assemblies	H10						
Spherical roller thrust bearings where separate bearings provide radial location	-	Housing washer must be fitted with adequate radial clearance so that no radial load whatsoever can act on the thrust bearings					
Combined radial and axial loads on spherical roller thrust bearings							
Stationary load on housing washer	H7						
Rotating load on housing washer	M7						

¹⁾ See Table 9 for specific housing bore diameters

Surface roughness of bearing seatings

The roughness of bearing seating surfaces does not have the same degree of influence on bearing performance as the dimensional, form and running accuracies. However, a desired interference fit is much more accurately obtained the smoother the mating surfaces are. For less critical bearing arrangements, relatively large surface roughness is permitted. For bearing arrangements where demands in respect to accuracy are high, guideline values for the mean surface roughness Ra are given in **Table 12** (page 80) for different dimensional accuracies of the bearing seatings. These guideline values apply to ground seatings, which are normally assumed for shaft seatings. For fine turned seatings, the roughness may be a class or two higher.

Fits for hollow shafts

If bearings are to be mounted with an interference fit on a hollow shaft it is generally necessary to use a heavier interference fit than would be used for a solid shaft in order to achieve the same surface pressure between the inner ring and shaft seating. The following diameter ratios are important when deciding on the fit to be used:

$$c_i = \frac{d_i}{d}$$
 and $c_e = \frac{d}{d_e}$

The fit is not appreciably affected until the diameter ratio of the hollow shaft $c_i \geq 0.5$. If the outside diameter of the inner ring is not known, the diameter ratio c_e can be calculated with sufficient accuracy using the equation

$$c_e = \frac{d}{k(D-d) + d}$$

where

c_i = diameter ratio of the hollow shaft

 c_e = diameter ratio of the inner ring

d = outside diameter of the hollow shaft,bore diameter of bearing, mm

d_i = internal diameter of the hollow shaft, mm

 d_e = average outside diameter of the inner ring, mm

D = outside bearing diameter, mm

k = a factor for the bearing type
 for self-aligning ball bearings in the 22
 and 23 series, k = 0.25
 for cylindrical roller bearings, k = 0.25
 for all other bearings, k = 0.3

56 **5KF**

²⁾ For large bearings (D > 250 mm) and temperature differences between outer ring and housing > 10 °C, the fit tolerance should be loosened one class, i.e. a G7 should be used instead of H7, and an F7 should be used instead of G7.

³⁾ For applications such as electric motors and centrifugal pumps, an H6 should be used to reduce the amount of looseness in the housing, while still allowing the bearing to float.

⁴⁾ See Table 9 for specific housing bore diameters

To determine the requisite interference fit for a bearing to be mounted on a hollow shaft, use the mean probable interference between the shaft seating and bearing bore obtained for the tolerance recommendation for a solid shaft of the same diameter. If the plastic deformation (smoothing) of the mating surfaces produced during mounting is neglected, then the effective interference can be equated to the mean probable interference.

The interference Δ_H needed for a hollow steel shaft can then be determined in relation to the known interference Δ_V for the solid shaft from **Diagram 1**. Δ_V equals the mean value of the smallest and largest values of the probable interference for the solid shaft. The tolerance for the hollow shaft is then selected so that the mean probable interference is as close as possible to the interference Δ_H obtained from **Diagram 1**.

Example

A 6208 deep groove ball bearing with d = 40 mm and D = 80 mm is to be mounted on a hollow shaft having a diameter ratio c_i = 0.8. From **Table 2** (page 54), the recommended shaft tolerance is "k5" resulting in an interference fit of 0.0001 in to 0.0010 in. The mean probable interference Δ_V = (0.0001 + 0.0010)/2 = 0.00055 in. For c_i = 0.8 and

$$c_e = \frac{40}{0.3(80 - 40) + 40} = 0.77$$

so that from **Diagram 1** the ratio $\Delta_H/\Delta_V = 1.7$. Thus the requisite interference for the hollow shaft $\Delta_H = 1.7 \times 0.00055$ in = 0.0009 in. Consequently, tolerance m6 is selected for the hollow shaft as this gives a mean probable interference of this order.

Shaft tolerance limits for adapter mounting and pillow block seal seatings³ (inch)

Nominal dia. inches Over	Including	S-1 ¹⁾	Dia. tolerance limits inches S-2 and S-3 ²⁾
1/2	1	0.000 - 0.002	-
1	2	0.000 - 0.003	0.000 - 0.003
2	4	0.000 - 0.004	0.000 - 0.003
4	6	0.000 - 0.005	0.000 - 0.003
6	10	0.000 - 0.006	0.000 - 0.004
10	15	0.000 - 0.006	0.000 - 0.005
15	-	0.000 - 0.006	0.000 - 0.006


- 1) "S-1" values are deviations from nominal shaft dimensions for mounting via an adapter or sleeve.

 The out-of-round (00R) and cylindrical form tolerance for shaft diameters ≤ 4 inches: 00R ≤ .0005 in; ≥ 4 in. 00R ≤ .001 in.; total indicated runout (TIR) ≤ 1/2 00R.
- 2) "S-2" and "S-3" values are deviations for nominal shaft dimensions for pillow block mountings (except Unit Ball and Unit Roller). The shaft diameter recommendations assure proper operation of the seals, while the recommended shaft tolerance for the cylindrical bearing seat should be taken from Table 2.
- 3) See Table 11 for metric shaft tolerances

Diagram 1

Table 7

Relation of interference Δ_H , needed for a hollow steel shaft, to the known interference Δ_V for a solid steel shaft

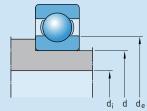

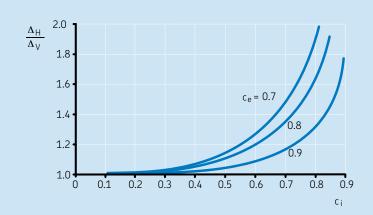


														Table 8
Shaft be	aring-seat d	iameters (v	alues in inch	es)										
	earing bore			f7			g6	D 11 .		h5	D 11 .		h6	Б 1
1	diameter	hes	Ch-	aft dia.	Resultant fit ¹⁾ in	Ch-	aft dia.	Resultant fit ¹⁾ in	Ch-	ıft dia.	Resultant fit ¹⁾ in		ft dia.	Resultant fit ¹⁾ in
mm	max.	min.	max.	min.	0.0001"	max.	min.	0.0001"	max.	min.	0.0001"	max.	min.	0.0001"
4	0.1575	0.1572	0.1571	0.1566		0.1573	0.1570		0.1575	0.1573		0.1575	0.1572	
5	0.1969	0.1966	0.1965	0.1960	9 L	0.1967	0.1964	5 L	0.1969	0.1967	2 L	0.1969	0.1966	3 L
6	0.2362	0.2359	0.2358	0.2353	1 L	0.2360	0.2357	1T	0.2362	0.2360	3 T	0.2362	0.2359	3 T
7	0.2756	0.2753	0.2751	0.2745		0.2754	0.2750		0.2756	0.2754		0.2756	0.2752	
8	0.3150	0.3147	0.3145	0.3139	11 L	0.3148	0.3144	6 L	0.3150	0.3148	2 L	0.3150	0.3146	4 L
9	0.3543	0.3540	0.3538	0.3532	2 L	0.3541	0.3537	1 T	0.3543	0.3541	3 T	0.3543	0.3539	3 T
10	0.3937	0.3934	0.3932	0.3926		0.3935	0.3931		0.3937	0.3935		0.3937	0.3933	
12	0.4724	0.4721	0.4718	0.4711		0.4722	0.4717		0.4724	0.4721		0.4724	0.4720	
15	0.5906	0.5903	0.5900	0.5893	13 L	0.5904	0.5899	7 L	0.5906	0.5903	3 L	0.5906	0.5902	4 L
17	0.6693	0.6690	0.6687	0.6680	3 L	0.6691	0.6686	1T	0.6693	0.6690	3 T	0.6693	0.6689	3 T
20	0.7874	0.7870	0.7866	0.7858		0.7871	0.7866		0.7874	0.7870		0.7874	0.7869	
25	0.9843	0.9839	0.9835	0.9827	16 L	0.9840	0.9835	8 L	0.9843	0.9839	4 L	0.9843	0.9838	5 L
30	1.1811	1.1807	1.1803	1.1795	4 L	1.1808	1.1803	1T	1.1811	1.1807	4 T	1.1811	1.1806	4 T
35	1.3780	1.3775	1.3770	1.3760		1.3776	1.3770		1.3780	1.3776		1.3780	1.3774	
40	1.5748	1.5743	1.5738	1.5728	20 L	1.5744	1.5738	10 L	1.5748	1.5744	4 L	1.5748	1.5742	6 L
45	1.7717	1.7712	1.7707	1.7697	5 L	1.7713	1.7707	1T	1.7717	1.7713	5 T	1.7717	1.7711	5 T
50	1.9685	1.9680	1.9675	1.9665		1.9681	1.9675		1.9685	1.9681		1.9685	1.9679	
55	2.1654	2.1648	2.1642	2.1630		2.1650	2.1643		2.1654	2.1649		2.1654	2.1647	
60	2.3622	2.3616	2.3610	2.3598	27.1	2.3618	2.3611	44.1	2.3622	2.3617	-	2.3622	2.3615	7.1
65 70	2.5591 2.7559	2.5585 2.7553	2.5579 2.7547	2.5567 2.7535	24 L 6 L	2.5587 2.7555	2.5580 2.7548	11 L 2 T	2.5591 2.7559	2.5586 2.7554	5 L 6 T	2.5591 2.7559	2.5584 2.7552	7 L 6 T
75	2.9528	2.9522	2.9516	2.9504	0.2	2.9524	2.9517		2.9528	2.9523	0.	2.9528	2.9521	0.
80	3.1496	3.1490	3.1484	3.1472		3.1492	3.1485		3.1496	3.1491		3.1496	3.1489	
85	3.3465	3.3457	3.3451	3.3437		3.3460	3.3452		3.3465	3.3459		3.3465	3.3456	
90	3.5433	3.5425	3.5419	3.5405		3.5428	3.5420		3.5433	3.5427		3.5433	3.5424	
95	3.7402	3.7394	3.7388	3.7374		3.7397	3.7389		3.7402	3.7396		3.7402	3.7393	
100 105	3.9370 4.1339	3.9362 4.1331	3.9356 4.1325	3.9342 4.1311	28 L 6 L	3.9365 4.1334	3.9357 4.1326	13 L 3 T	3.9370 4.1339	3.9364 4.1333	6 L 8 T	3.9370 4.1339	3.9361 4.1330	9 L 8 T
110	4.1337	4.1331	4.1323	4.1311	0 L	4.1334	4.1320	31	4.1339	4.1333	01	4.1339	4.1330	01
115	4.5276	4.5268	4.5262	4.5248		4.5271	4.5263		4.5276	4.5270		4.5276	4.5267	
120	4.7244	4.7236	4.7230	4.7216		4.7239	4.7231		4.7244	4.7238		4.7244	4.7235	
125	4.9213	4.9203	4.9196	4.9180		4.9207	4.9198		4.9213	4.9206		4.9213	4.9203	
130	5.1181	5.1171	5.1164	5.1148		5.1175	5.1166		5.1181	5.1174		5.1181	5.1171	
140	5.5118	5.5108	5.5101	5.5085		5.5112	5.5103		5.5118	5.5111		5.5118	5.5108	
150	5.9055	5.9045	5.9038	5.9022	33 L	5.9049	5.9040	15 L	5.9055	5.9048	7 L	5.9055	5.9045	10 L
160 170	6.2992 6.6929	6.2982 6.6919	6.2975 6.6912	6.2959 6.6896	7 L	6.2986 6.6923	6.2977 6.6914	4 T	6.2992 6.6929	6.2985 6.6922	10 T	6.2992 6.6929	6.2982 6.6919	10 T
180	7.0866	7.0856	7.0849	7.0833		7.0860	7.0851		7.0866	7.0859		7.0866	7.0856	
190	7.4803	7.4791	7.4783	7.4765		7.4797	7.4786		7.4803	7.4795		7.4803	7.4792	
200	7.8740	7.8728	7.8720	7.8702	38 L	7.8734	7.8723	17 L	7.8740	7.8732	8 L	7.8740	7.8729	11 L
220	8.6614	8.6602	8.6594	8.6576	8 L	8.6608	8.6597	6 T	8.6614	8.6606	12 T	8.6614	8.6603	12 T
240	9.4488	9.4476	9.4468	9.4450		9.4482	9.4471		9.4488	9.4480		9.4488	9.4477	

Note: To convert inches to mm, multiply inches by 25.4 $^{1)}\,L$ indicates "L00SE" fit, T indicates "TIGHT" fit

9.8405 9.8387

9.8425 9.8413

250

58 **SKF**

9.8419 9.8408

9.8425

9.8417

9.8425 9.8414

Table 8

Shaft bearing-seat diameters (values in inches)

	Bearing bore	·	alues in inch I	f7		1				h5		l	h6	
	diameter			17	Resultant		g6	Resultant		IIO	Resultant		110	Resultant
		ches	Ch.	aft dia.	fit ¹⁾ in	Ch	aft dia.	fit ¹⁾ in		aft dia.	fit ¹⁾ in		aft dia.	fit ¹⁾ in
		min.		min.	0.0001"	max.	min.	0.0001"			0.0001"	max.	min.	0.0001"
mm	max.	min.	max.	min.	0.0001	max.	min.	0.0001	max.	min.	0.0001			0.0001
260	10.2362	10.2348	10.2340	10.2319		10.2355	10.2343		10.2362	10.2353		10.2362	10.2349	
280	11.0236	11.0222	11.0214	11.0193	43 L	11.0229	11.0217	19 L	11.0236	11.0227	9 L	11.0236	11.0223	13 L
300	11.8110	11.8096	11.8088	11.8067	8 L	11.8103	11.8091	7 T	11.8110	11.8101	14 T	11.8110	11.8097	14 T
310	12.2047	12.2033	12.2025	12.2004		12.2040	12.2028		12.2047	12.2038		12.2047	12.2034	
320	12.5984	12.5968	12.5959	12.5937		12.5977	12.5963		12.5984	12.5974		12.5984	12.5970	
340	13.3858	13.3842	13.3833	13.3811		13.3851	13.3837		13.3858	13.3848		13.3858	13.3844	
350	13.7795	13.7779	13.7770	13.7748	47 L	13.7788	13.7774	21 L	13.7795	13.7785	10 L	13.7795	13.7781	14 L
360	14.1732	14.1716	14.1707	14.1685	9 L	14.1725	14.1711	9 T	14.1732	14.1722	16 T	14.1732	14.1718	16 T
380	14.9606	14.9590	14.9581	14.9559		14.9599	14.9585		14.9606	14.9596		14.9606	14.9592	
400	15.7480	15.7464	15.7455	15.7433		15.7473	15.7459		15.7480	15.7470		15.7480	15.7466	
420	16.5354	16.5336	16.5327	16.5302		16.5346	16.5330		16.5354	16.5343		16.5354	16.5338	
440		17.3210	17.3201		52 L	17.3220	17.3204	24 L	17.3228	17.3217	11 L	17.3228		16 L
460		18.1084		18.1050	9 L	18.1094	18.1078	10 T	18.1102	18.1091	18 T		18.1086	18 T
480		18.8958	18.8949	18.8924	, _	18.8968	18.8952	101	18.8976	18.8965	101		18.8960	101
500		19.6832		19.6798		19.6842	19.6826		19.6850	19.6839			19.6834	
500	17.0030	17.0032	17.0023	17.0770		17.0042	17.0020		17.0000	17.0037		19.0000	17.0034	
530	20.8661	20.8641	20.8631	20.8605		20.8652	20.8635		_	_		20.8661	20.8644	
560		22.0452	22.0442	22.0416	56 L	22.0463	22.0446	26 L	_	_			22.0455	17 L
600		23.6200	23.6190	23.6164	10 L	23.6211	23.6194	11 T	_				23.6203	20 T
630		24.8011	24.8001		10 L	24.8022	24.8005	111					24.8014	201
030	24.0031	24.0011	24.0001	24.7773		24.0022	24.0003		_			24.0031	24.0014	
660	25.9843	25.9813	25.9811	25.9782		25.9834	25.9814		_	_		25.9843	25.9823	
670		26.3750		26.3719		26.3771	26.3751		_	_			26.3760	
710		27.9498	27.9496	27.9467	61 L	27.9519	27.9499	29 L	_	_			27.9508	20 L
750		29.5246	29.5244	29.5215	2 L	29.5267	29.5247	21 T	_			29.5276	29.5256	30 T
780	30.7087		30.7055	30.7026	2 L	30.7078	30.7058	211	_	_		30.7087	30.7067	30 1
									_	_				
800	31.4961	31.4931	31.4929	31.4900		31.4952	31.4932		-	-		31.4961	31.4941	
850	33.4646	33 4607	33.4611	33 //577		33.4636	33.4614		_			33 //6//6	33.4624	
900		35.4292	35.4296	35.4262	69 L	35.4321	35.4299	32 L					35.4309	22 L
950	37.4016		37.3981	37.3947	4 T	37.4006	37.3984	29 T	_	_		37.4016		39 T
					4 1			29 1	-	-				391
1000	39.3701	39.3662	39.3666	39.3632		39.3691	39.3669		-	_		39.3701	39.3679	
1060	41.7323	41 7274	41.7284	41.7247		41.7312	41.7286		_	_		41.7323	41.7297	
1120	44.0945		44.0906	44.0869	76 L	44.0934	44.0908	37 L				44.0945	44.0919	26 L
1120			46.4528			46.4556		37 L 38 T	_	_				49 T
		46.4518		46.4491	10 T		46.4530	381	_	_		46.4567	46.4541	491
1250	49.2126	49.2077	49.2087	49.2050		49.2115	49.2089		-	-		49.2126	49.2100	

Note: To convert inches to mm, multiply inches by 25.4 $^{1)}$ L indicates "LOOSE" fit, T indicates "TIGHT" fit

	lρ	

		ameters (va	lues in inches)							js4				
	aring bore			h8	D 11 1		j5	D 1: .	j6				I D 11 1	
0	liameter		Chat	دالد عا	Resultant fit ¹⁾ in	Chal	E	Resultant fit ¹⁾ in	Chaft	عائد	Resultant fit ¹⁾ in			Resultant fit ¹⁾ in
	incl			t dia.	0.0001"		ft dia.	0.0001"	Shaft		0.0001"	max. min.		0.0001"
mm	max.	min.	max.	min.	0.0001	max.	min.	0.0001	max.	min.	0.0001	max.	min.	0.0001
4	0.1575	0.1572	0.1575	0.1568		0.1576	0.1574		0.1577	0.1574		-	-	
5	0.1969	0.1966	0.1969	0.1962	7 L	0.1970	0.1968	1 L	0.1971	0.1968	1 L	-	-	
6	0.2362	0.2359	0.2362	0.2355	3 T	0.2363	0.2361	4 T	0.2364	0.2361	5 T	-	-	
7	0.2756	0.2753	0.2756	0.2747		0.2758	0.2755		0.2759	0.2755		0.2757	0.2755	
8	0.3150	0.3147	0.3150	0.3141	9 L	0.3152	0.3149	1 L	0.3153	0.3149	1 L	0.3151	0.3149	1 L
9	0.3543	0.3540	0.3543	0.3534	3 T	0.3545	0.3542	5 T	0.3546	0.3542	6 T	0.3544	0.3542	4 T
10	0.3937	0.3934	0.3937	0.3928		0.3939	0.3936		0.3940	0.3936		0.3938	0.3936	
12	0.4724	0.4721	0.4724	0.4713	44.1	0.4726	0.4723	4.1	0.4727	0.4723	4.1	0.4725	0.4723	4.1
15	0.5906	0.5903	0.5906	0.5895	11 L	0.5908	0.5905	1L	0.5909	0.5905	1 L	0.5907	0.5905	1 L
17	0.6693	0.6690	0.6693	0.6682	3 T	0.6695	0.6692	5 T	0.6696	0.6692	6 T	0.6694	0.6692	4 T
20	0.7874	0.7870	0.7874	0.7861	121	0.7876	0.7872	21	0.7878	0.7872	21	0.7875	0.7872	21
25	0.9843	0.9839	0.9843	0.9830	13 L 4 T	0.9845	0.9841	2 L 6 T	0.9847	0.9841	2 L 8 T	0.9844	0.9841	2 L 5 T
30	1.1811	1.1807	1.1811	1.1798	4 1	1.1813	1.1809	01	1.1815	1.1809	01	1.1812	1.1809	51
25	4.0700	4.0775	4.0700	4.07/5		4.0700	4.0770		4.0707	4.0770		4.0704	4.0770	
35	1.3780	1.3775	1.3780	1.3765	4	1.3782	1.3778		1.3784	1.3778		1.3781	1.3778	
40	1.5748	1.5743	1.5748	1.5733	15 L	1.5750	1.5746	2 L	1.5752	1.5746	2 L	1.5749	1.5746	2 L
45	1.7717	1.7712	1.7717	1.7702	5 T	1.7719	1.7715	7 T	1.7721	1.7715	9 T	1.7718	1.7715	6 T
50	1.9685	1.9680	1.9685	1.9670		1.9687	1.9683		1.9689	1.9683		1.9686	1.9683	
55	2.1654	2.1648	2.1654	2.1636		2.1656	2.1651		2.1659	2.1651		2.1655	2.1652	
60	2.3622	2.3616	2.3622	2.3604		2.3624	2.3619		2.3627	2.3619		2.3623	2.3620	
65	2.5591	2.5585	2.5591	2.5573	18 L	2.5593	2.5588	3 L	2.5596	2.5588	3 L	2.5592	2.5589	2 L
70	2.7559	2.7553	2.7559	2.7541	6T	2.7561		8T	2.7564		11 T	2.7560	2.7557	7 T
70 75	2.7559	2.7553	2.7559	2.7541	01	2.7561	2.7556 2.9525	01	2.7564	2.7556	111	2.7500		/ 1
80	3.1496	3.1490								2.9525			2.9526	
	3.1490	3.1490	3.1496	3.1478		3.1498	3.1493		3.1501	3.1493		3.1497	3.1494	
85	3.3465	3.3457	3.3465	3.3444		3.3467	3.3461		3.3470	3.3461		3.3467	3.3463	
90	3.5433	3.5425	3.5433	3.5412		3.5435	3.5429		3.5438	3.5429		3.5435	3.5431	
95	3.7402	3.7394	3.7402	3.7381		3.7404	3.7398		3.7407	3.7398		3.7404	3.7400	
100	3.9370	3.9362	3.9370	3.9349	21 L	3.9372	3.9366	4 L	3.9375	3.9366	4 L	3.9372	3.9368	2 L
105	4.1339	4.1331	4.1339	4.1318	8T	4.1341	4.1335	10 T	4.1344	4.1335	13 T	4.1341	4.1337	10 T
110	4.3307	4.3299	4.3307	4.3286		4.3309	4.3303	231	4.3312	4.3303	131	4.3309	4.3305	10.
115	4.5276	4.5268	4.5276	4.5255		4.5278	4.5272		4.5312	4.5272		4.5278	4.5274	
120	4.7244	4.7236	4.7244	4.7223		4.7246	4.7240		4.7249	4.7240		4.7246	4.7242	
			2-1-1	223		1.7.2.40	240		2 17	240		240		
125	4.9213	4.9203	4.9213	4.9188		4.9216	4.9209		4.9219	4.9209		4.9215	4.9210	
130	5.1181	5.1171	5.1181	5.1156		5.1184	5.1177		5.1187	5.1177		5.1183	5.1178	
140	5.5118	5.5108	5.5118	5.5093		5.5121	5.5114		5.5124	5.5114		5.5120	5.5115	
150	5.9055	5.9045	5.9055	5.9030	25 L	5.9058	5.9051	4 L	5.9061	5.9051	4 L	5.9057	5.9052	3 L
160	6.2992	6.2982	6.2992	6.2967	10 T	6.2995	6.2988	13 T	6.2998	6.2988	16 T	6.2994	6.2989	12 T
170	6.6929	6.6919	6.6929	6.6904		6.6932	6.6925	20 1	6.6935	6.6925	10 1	6.6931	6.6926	
180	7.0866	7.0856	7.0866	7.0841		7.0869	7.0862		7.0872	7.0862		7.0868	7.0863	
190	7.4803	7.4791	7.4803	7.4775		7.4806	7.4798		7.4809	7.4798		7.4806	7.4800	
200	7.8740	7.8728	7.8740	7.8712	28 L	7.8743	7.8735	5 L	7.8746	7.8735	5 L	7.8743	7.8737	3 L
220	8.6614	8.6602	8.6614	8.6586	12 T	8.6617	8.6609	15 T	8.6620	8.6609	18 T	8.6617	8.6611	15 T
240	9.4488	9.4476	9.4488	9.4460		9.4491	9.4483		9.4494	9.4483		9.4491	9.4485	
250	9.8425	9.8413	9.8425	9.8397		9.8428	9.8420		9.8431	9.8420		9.8428	9.8422	

Note: To convert inches to mm, multiply inches by 25.4

 $^{^{1)}\,}L$ indicates "LOOSE" fit, T indicates "TIGHT" fit

t	Bearing bore		h8				j5			j6 js4					
		diameter				Resultant			Resultant			Resultant		,	Resultant
		inc	ches	Sha	ıft dia.	fit ¹⁾ in	Shaf	t dia.	fit ¹⁾ in	Shaft	dia.	fit ¹⁾ in	Shaf	t dia.	fit ¹⁾ in
	mm	max.	min.	max.	min.	0.0001"	max.	min.	0.0001"	max.	min.	0.0001"	max.	min.	0.0001"
Ī	2/0	10.2362	10.2348	10.2362	10.2330		10.2365	10.2356		10.2368	10.2356		10 22/5	10.2250	
	260 280	11.0236	11.0222		11.0204	32 L	11.0239	11.0230	6 L	11.0242	11.0230	6 L		10.2359 11.0233	3 L
	300	11.0236	11.8096		11.8078	14 T	11.0239	11.0230	17 T	11.0242	11.8104	20 T	11.8113		17 T
	310	12.2047	12.2033	12.2047	12.2015	141	12.2050	12.2041	1/1	12.2053	12.2041	201		12.2044	1/ 1
	310	12.2047	12.2033	12.2047	12.2013		12.2030	12.2041		12.2033	12.2041		12.2030	12.2044	
	320	12.5984	12.5968	12.5984	12.5949		12.5987	12.5977		12.5991	12.5977		_	_	
	340	13.3858	13.3842	13.3858	13.3823		13.3861	13.3851		13.3865	13.3851		_	_	
	350	13.7795	13.7779		13.7760	35 L	13.7798	13.7788	7 L	13.7802	13.7788	7 L	_	_	
	360	14.1732	14.1716		14.1697	16 T	14.1735	14.1725	19 T	14.1739	14.1725	23 T	_	_	
	380	14.9606	14.9590	14.9606	14.9571		14.9609	14.9599		14.9613	14.9599		_	_	
	400	15.7480	15.7464	15.7480	15.7445		15.7483	15.7473		15.7487	15.7473		_	_	
	420	16.5354	16.5336	16.5354	16.5316		16.5357	16.5346		16.5362	16.5346		-	-	
	440	17.3228	17.3210	17.3228	17.3190	38 L	17.3231	17.3220	8 L	17.3236	17.3220	8 L	-	-	
	460	18.1102	18.1084	18.1102	18.1064	18 T	18.1105	18.1094	21 T	18.1110	18.1094	26 T	-	-	
	480	18.8976	18.8958	18.8976	18.8938		18.8979	18.8968		18.8984	18.8968		-	-	
	500	19.6850	19.6832	19.6850	19.6812		19.6853	19.6842		19.6858	19.6842		-	-	
	530	20.8661	20.8641		20.8618		-	-		20.8670	20.8652		_	-	
	560	22.0472	22.0452	22.0472	22.0429	43 L	-	-		22.0481	22.0463	9 L	-	-	
	600	23.6220	23.6200	23.6220	23.6177	20 T	_	-		23.6229	23.6211	29 T	-	-	
	630	24.8031	24.8011	24.8031	24.7988		-			24.8040	24.8022		-	_	
	660	25.9843	25.9813	25.9843	25.9794		_	_		25.9853	25.9833		_	_	
	670	26.3780	26.3750	26.3780	26.3731		_	_		26.3790	26.3770		_	_	
	710	27.9528	27.9498	27.9528	27.9479	49 L	_	_		27.9538	27.9518	10 L	_	_	
	750	29.5276	29.5246	29.5276	29.5227	30 T	_	_		29.5286	29.5266	40 T	_	_	
	780	30.7087	30.7057	30.7087	30.7038		_	_		30.7097	30.7077		_	_	
	800	31.4961	31.4931	31.4961	31.4912		-	_		31.4971	31.4951		_	_	
	850	33.4646	33.4607	33.4646	33.4591		-	-		33.4657	33.4635		-	-	
	900	35.4331	35.4292	35.4331	35.4276	55 L	-	-		35.4342	35.4320	11 L	-	-	
	950	37.4016	37.3977	37.4016	37.3961	39 T	-	-		37.4027	37.4005	50 T	-	-	
	1000	39.3701	39.3662	39.3701	39.3646		-	-		39.3712	39.3690		-	-	
Ī	10/0	/4 7000	/4 707/	/4 7000	/4 7050					/4 700/	/4 7040				
	1060	41.7323	41.7274	41.7323	41.7258	451	-	-		41.7336	41.7310	421	_	-	
	1120	44.0945	44.0896	44.0945	44.0880	65 L	-	-		44.0958	44.0932	13 L	_	-	
	1180	46.4567	46.4518	46.4567	46.4502	49 T	-	-		46.4580	46.4554	62 T	_	-	
	1250	49.2126	49.2077	49.2126	49.2061		_	-		49.2139	49.2113		-	-	
		l													

Note: To convert inches to mm, multiply inches by 25.4 $^{1)}\, L$ indicates "LOOSE" fit, T indicates "TIGHT" fit

Ta	ble	8
	~	. •

Shaft bearing-seat diameters (values in inches)														
	Bearing bore	!		js5			js6			k4		k5		
	diameter .				Resultant			Resultant			Resultant			Resultant
		nches		aft dia.	fit ¹⁾ in	Shaf		fit ¹⁾ in	Shaf		fit ¹⁾ in	Shaf		fit ¹⁾ in
mr	n max.	min.	max.	min.	0.0001"	max.	min.	0.0001"	max.	min.	0.0001"	max.	min.	0.0001"
4	0.1575	0.1572	0.1576	0.1574		0.1577	0.1573		0.1577	0.1575		0.1577	0.1575	
5	0.1969	0.1966	0.1970	0.1968	1 L	0.1971	0.1967	2 L	0.1971	0.1969	0 T	0.1971	0.1969	0T
6	0.2362	0.2359	0.2363	0.2361	4 T	0.2364	0.2360	5 T	0.2364	0.2362	5 T	0.2364	0.2362	5 T
7	0.2756	0.2753	0.2757	0.2755		0.2758	0.2754		0.2758	0.2756		0.2759	0.2756	
8	0.3150	0.3147	0.3151	0.3149	1 L	0.3152	0.3148	2 L	0.3152	0.3150	ОТ	0.3153	0.3150	0 T
9	0.3543	0.3540	0.3544	0.3542	4 T	0.3545	0.3541	5 T	0.3545	0.3543	5 T	0.3546	0.3543	6T
10	0.3937	0.3934	0.3938	0.3936		0.3939	0.3935		0.3939	0.3937		0.3940	0.3937	
12	0.4724	0.4721	0.4726	0.4722		0.4726	0.4722		0.4727	0.4724		0.4728	0.4724	
15	0.5906	0.5903	0.5908	0.5904	2 L	0.5908	0.5904	2 L	0.5909	0.5906	0 T	0.5910	0.5906	0 T
17	0.6693	0.6690	0.6695	0.6691	5 T	0.6695	0.6691	5 T	0.6696	0.6693	6 T	0.6697	0.6693	7 T
20	0.7874	0.7870	0.7876	0.7872		0.7876	0.7871		0.7877	0.7874		0.7878	0.7875	
25	0.9843	0.9839	0.9845	0.9841	2 L	0.9845	0.9840	3 L	0.9846	0.9843	0 T	0.9847	0.9844	1T
30	1.1811	1.1807	1.1813	1.1809	6 T	1.1813	1.1808	6 T	1.1814	1.1811	7 T	1.1815	1.1812	8T
35	1.3780	1.3775	1.3782	1.3778		1.3783	1.3777		1.3783	1.3781		1.3785	1.3781	
40	1.5748	1.5743	1.5750	1.5746	2 L	1.5751	1.5745	3 L	1.5751	1.5749	1T	1.5753	1.5749	1 T
45	1.7717	1.7712	1.7719	1.7715	7 T	1.7720	1.7714	8T	1.7720	1.7718	8T	1.7722	1.7718	10 T
50	1.9685	1.9680	1.9687	1.9683		1.9688	1.9682		1.9688	1.9686		1.9690	1.9686	
55	2.1654	2.1648	2.1656	2.1651		2.1658	2.1650		2.1658	2.1655		2.1660	2.1655	
60	2.3622	2.3616	2.3624	2.3619		2.3626	2.3618		2.3626	2.3623		2.3628	2.3623	
65	2.5591	2.5585	2.5593	2.5588	3 L	2.5595	2.5587	4 L	2.5595	2.5592	1T	2.5597	2.5592	1T
70	2.7559	2.7553	2.7561	2.7556	8T	2.7563	2.7555	10 T	2.7563	2.7560	10 T	2.7565	2.7560	12 T
75	2.9528	2.9522	2.9530	2.9525		2.9532	2.9524		2.9532	2.9529		2.9534	2.9529	
80	3.1496	3.1490	3.1498	3.1493		3.1500	3.1492		3.1500	3.1497		3.1502	3.1497	
85	3.3465	3.3457	3.3468	3.3462		3.3469	3.3461		3.3470	3.3466		3.3472	3.3466	
90	3.5433	3.5425	3.5436	3.5430		3.5437	3.5429		3.5438	3.5434		3.5440	3.5434	
95	3.7402	3.7394	3.7405	3.7399		3.7406	3.7398		3.7407	3.7403		3.7409	3.7403	
100	3.9370	3.9362	3.9373	3.9367	3 L	3.9374	3.9366	4 L	3.9375	3.9371	1T	3.9377	3.9371	1T
105	4.1339	4.1331	4.1342	4.1336	11 T	4.1343	4.1335	12 T	4.1344	4.1340	13 T	4.1346	4.1340	15 T
110	4.3307	4.3299	4.3310	4.3304		4.3311	4.3303		4.3312	4.3308		4.3314	4.3308	
115	4.5276	4.5268	4.5279	4.5273		4.5280	4.5272		4.5281	4.5277		4.5283	4.5277	
120	4.7244	4.7236	4.7247	4.7241		4.7248	4.7240		4.7249	4.7245		4.7251	4.7245	
125	4.9213	4.9203	4.9216	4.9209		4.9218	4.9208		4.9219	4.9214		4.9221	4.9214	
130	5.1181	5.1171	5.1184	5.1177		5.1186	5.1176		5.1187	5.1182		5.1189	5.1182	
140	5.5118	5.5108	5.5121	5.5114		5.5123	5.5113		5.5124	5.5119		5.5126	5.5119	
150	5.9055	5.9045	5.9058	5.9051	4 L	5.9060	5.9050	5 L	5.9061	5.9056	1T	5.9063	5.9056	1T
160	6.2992	6.2982	6.2995	6.2988	13 T	6.2997	6.2987	15 T	6.2998	6.2993	16 T	6.3000	6.2993	18 T
170	6.6929	6.6919	6.6932	6.6925		6.6934	6.6924		6.6935	6.6930		6.6937	6.6930	
180	7.0866	7.0856	7.0869	7.0862		7.0871	7.0861		7.0872	7.0867		7.0874	7.0867	
100	7 / 902	7 / 701	7 / 207	7 (700		7 / 200	7 / 707		7 / 010	7 / 905		7 (012	7 / 905	
190	7.4803	7.4791	7.4807	7.4799	4.1	7.4809	7.4797	4.1	7.4810	7.4805 7.8742	2.T	7.4812	7.4805	эт
200	7.8740	7.8728	7.8744	7.8736	4 L	7.8746	7.8734	6 L	7.8747		2T	7.8749	7.8742	2T
220	8.6614	8.6602	8.6618	8.6610	16 T	8.6620	8.6608	18T	8.6621	8.6616	19 T	8.6623	8.6616	21 T
240	9.4488	9.4476	9.4492	9.4484		9.4494	9.4482		9.4495	9.4490		9.4497	9.4490	
250	9.8425	9.8413	9.8429	9.8421		9.8431	9.8419		9.8432	9.8427		9.8434	9.8427	

Note: To convert inches to mm, multiply inches by 25.4 $^{1)}\, L$ indicates "LOOSE" fit, T indicates "TIGHT" fit

	earing-seat of the seat of the			js5			js6			k4			k5	
	diameter			<u> </u>	Resultant			Resultant			Resultant			Resultant
	in	ches	Sha	aft dia.	fit ¹⁾ in	Shaft	dia.	fit ¹⁾ in	Shaft	dia.	fit ¹⁾ in	Shaft	dia.	fit ¹⁾ in
mm	max.	min.	max.	min.	0.0001"	max.	min.	0.0001"	max.	min.	0.0001"	max.	min.	0.0001"
260	10 2362	10.2348	10.2366	10.2357		10.2368	10.2356		10.2370	10.2364		10 2373	10.2364	
280		11.0222	11.0240	11.0231	5 L	11.0242	11.0230	6 L	11.0244	11.0238	2T		11.0238	2 T
300		11.8096	11.8114	11.8105	18T	11.8116	11.8104	20 T	11.8118	11.8112	22 T		11.8112	25 T
310		12.2033	12.2051	12.2042	101	12.2053	12.2041	201	12.2055	12.2049	22 1		12.2049	231
	12.2047	12.2000	12.2031	12.2042		12.2033	12.2041		12.2033	12.2047		12.2000	12.2047	
320	12.5984	12.5968	12.5989	12.5979		12.5991	12.5977		12.5992	12.5986		12.5995	12.5986	
340	13.3858	13.3842	13.3863	13.3853		13.3865	13.3851		13.3866	13.3860		13.3869	13.3860	
350	13.7795	13.7779	13.7800	13.7790	5 L	13.7802	13.7788	7 L	13.7803	13.7797	2T	13.7806	13.7797	2T
360	14.1732	14.1716	14.1737	14.1727	21 T	14.1739	14.1725	23 T	14.1740	14.1734	24 T	14.1743	14.1734	27 T
380	14.9606	14.9590	14.9611	14.9601		14.9613	14.9599		14.9614	14.9608		14.9617	14.9608	
400	15.7480	15.7464	15.7485	15.7475		15.7487	15.7473		15.7488	15.7482		15.7491	15.7482	
420	16.5354	16.5336	16.5359	16.5349		16.5362	16.5346		16.5364	16.5356		16.5367	16.5356	
440	17.3228	17.3210	17.3233	17.3223	5 L	17.3236	17.3220	8 L	17.3238	17.3230	2 T	17.3241	17.3230	2T
460	18.1102	18.1084	18.1107	18.1097	23 T	18.1110	18.1094	26 T	18.1112	18.1104	28 T	18.1115	18.1104	31 T
480	18.8976	18.8958	18.8981	18.8971		18.8984	18.8968		18.8986	18.8978		18.8989	18.8978	
500	19.6850	19.6832	19.6855	19.6845		19.6858	19.6842		19.6860	19.6852		19.6863	19.6852	
												00.0470		
530		20.8641	20.8666	20.8655		20.8669	20.8652	0.1	_	-			20.8661	0.7
560		22.0452	22.0477	22.0466	6 L	22.0480	22.0463	9 L	_	-			22.0472	0T
600		23.6200	23.6225	23.6214	25 T	23.6228	23.6211	28 T	-	-			23.6220	32T
630	24.6031	24.8011	24.8036	24.8025		24.8039	24.8022		-	-		24.6043	24.8031	
660	25.9843	25.9813	25.9849	25.9837		25.9852	25.9833		_	_		25.9857	25.9843	
670	26.3780	26.3750	26.3786	26.3774		26.3789	26.3770		_	_		26.3794	26.3780	
710	27.9528	27.9498	27.9534	27.9522	6 L	27.9537	27.9518	10 L	_	_		27.9542	27.9528	OT
750	29.5276	29.5246	29.5282	29.5270	36 T	29.5285	29.5266	39 T	_	_		29.5290	29.5276	44 T
780	30.7087	30.7057	30.7093	30.7081		30.7096	30.7077		-	-		30.7101	30.7087	
800	31.4961	31.4931	31.4967	31.4955		31.4970	31.4951		-	-		31.4975	31.4961	
850		33.4607	33.4653	33.4639		33.4657	33.4635		-	-			33.4646	
900		35.4292	35.4338	35.4324	7 L	35.4342	35.4320	11 L	-	-			35.4331	0T
950		37.3977	37.4023	37.4009	46 T	37.4027	37.4005	50 T	-	-			37.4016	55 T
1000	39.3701	39.3662	39.3708	39.3694		39.3712	39.3690		ı	-		39.3717	39.3701	
1060	41,7323	41.7274	41.7331	41.7315		41.7336	41.7310			_		41.7341	41.7323	
1120	44.0945	44.0896	44.0953	44.0937	8 L	44.0958	44.0932	13 L	_	_			44.0945	ОТ
1180	46.4567	46.4518	46.4575	46.4559	57 T	46.4580	46.4554	62T	_	_			46.4567	67 T
1250	49.2126	49.2077	49.2134	49.2118	371	49.2139	49.2113	02 1	_	_			49.2126	371
		0,,										17.2117		

Note: To convert inches to mm, multiply inches by 25.4 $^{1)}\,L$ indicates "LOOSE" fit, T indicates "TIGHT" fit

	Shaft bearing-seat diameters (va Bearing bore			k6 m5 m6							n5			
(liameter				Resultant			Resultant			Resultant			Resultant
		hes		ft dia.	fit ¹⁾ in	Shaft		fit ¹⁾ in	Shaft		fit ¹⁾ in	Shaft		fit ¹⁾ in
mm	max.	min.	max.	min.	0.0001"									
4	0.1575	0.1572	0.1579	0.1575	ОТ	0.1579	0.1577	2.7	0.1580	0.1577		0.1580	0.1578	2.T
5	0.1969	0.1966	0.1973	0.1969	0 T 7 T	0.1973	0.1971	2T	0.1974	0.1971	2T 8T	0.1974	0.1972	3 T 8 T
6	0.2362	0.2359	0.2366	0.2362	7 1	0.2366	0.2364	7 T	0.2367	0.2364	01	0.2367	0.2365	01
7	0.2756	0.2753	0.2760	0.2756		0.2761	0.2758		0.2762	0.2758		0.2762	0.2760	
8	0.3150	0.3147	0.3154	0.3150	ОТ	0.3155	0.3152	2T	0.3156	0.3152	2 T	0.3156	0.3154	4 T
9	0.3543	0.3540	0.3547	0.3543	7 T	0.3548	0.3545	8T	0.3549	0.3545	9 T	0.3549	0.3547	9 T
10	0.3937	0.3934	0.3941	0.3937		0.3942	0.3939		0.3943	0.3939		0.3943	0.3941	
12	0.4724	0 / 721	0.4729	0.4724		0.4730	0.4727		0.4731	0.4727		0.4732	0.4729	
12 15	0.4724	0.4721 0.5903	0.4729	0.4724	ОТ	0.4730	0.4727	3 T	0.4731	0.4727	3 T	0.4732	0.4729	5 T
17	0.6693	0.6690	0.6698	0.6693	8 T	0.6699	0.6696	9 T	0.6700	0.6696	10 T	0.6701	0.6698	11 T
20	0.7874	0.7870	0.7880	0.7875	1T	0.7881	0.7877	3 T	0.7882	0.7877	3 T	0.7883	0.7880	6 T
25	0.9843	0.9839	0.9849	0.9844	10T	0.9850	0.9846	11 T	0.9851	0.9846	12T	0.9852	0.9849	13 T
30	1.1811	1.1807	1.1817	1.1812		1.1818	1.1814		1.1819	1.1814		1.1820	1.1817	
35	1.3780	1.3775	1.3787	1.3781		1.3788	1.3784		1.3790	1.3784		1.3791	1.3787	
40	1.5748	1.5743	1.5755	1.5749	1T	1.5756	1.5752	4 T	1.5758	1.5752	4 T	1.5759	1.5755	7 T
45	1.7717	1.7712	1.7724	1.7718	12 T	1.7725	1.7721	13 T	1.7727	1.7721	15 T	1.7728	1.7724	16 T
50	1.9685	1.9680	1.9692	1.9686		1.9693	1.9689		1.9695	1.9689		1.9696	1.9692	
55	2.1654	2.1648	2.1662	2.1655		2.1663	2.1658		2.1666	2.1658		2.1667	2.1662	
60	2.3622	2.3616	2.3630	2.3623		2.3631	2.3626		2.3634	2.3626		2.3635	2.3630	
65	2.5591	2.5585	2.5599	2.5592	1T	2.5600	2.5595	4 T	2.5603	2.5595	4 T	2.5604	2.5599	8T
70	2.7559	2.7553	2.7567	2.7560	14 T	2.7568	2.7563	15 T	2.7571	2.7563	18 T	2.7572	2.7567	19T
75	2.9528	2.9522	2.9536	2.9529		2.9537	2.9532		2.9540	2.9532		2.9541	2.9536	
80	3.1496	3.1490	3.1504	3.1497		3.1505	3.1500		3.1508	3.1500		3.1509	3.1504	
85	3.3465	3.3457	3.3475	3.3466		3.3476	3.3470		3.3479	3.3470		3.3480	3.3474	
90	3.5433	3.5425	3.5443	3.5434		3.5444	3.5438		3.5447	3.5438		3.5448	3.5442	
95	3.7402	3.7394	3.7412	3.7403		3.7413	3.7407		3.7416	3.7407		3.7417	3.7411	
100	3.9370	3.9362	3.9380	3.9371	1T	3.9381	3.9375	5T	3.9384	3.9375	5 T	3.9385	3.9379	9T
105 110	4.1339 4.3307	4.1331 4.3299	4.1349 4.3317	4.1340 4.3308	18 T	4.1350 4.3318	4.1344 4.3312	19 T	4.1353 4.3321	4.1344 4.3312	22 T	4.1354 4.3322	4.1348 4.3316	23 T
115	4.5276	4.5268	4.5317	4.5277		4.5310	4.5281		4.5321	4.5281		4.5222	4.5285	
120	4.7244	4.7236	4.7254	4.7245		4.7255	4.7249		4.7258	4.7249		4.7259	4.7253	
125 130	4.9213 5.1181	4.9203 E 1171	4.9224 5.1192	4.9214		4.9226 5.1194	4.9219 5.1187		4.9229 5.1197	4.9219		4.9231 5.1199	4.9224	
140	5.5118	5.1171 5.5108	5.5129	5.1182 5.5119		5.5131	5.5124		5.5134	5.1187 5.5124		5.5136	5.1192 5.5129	
150	5.9055	5.9045	5.9066	5.9056	1T	5.9068	5.9061	6 T	5.9071	5.9061	6 T	5.9073	5.9066	11 T
160	6.2992	6.2982	6.3003	6.2993	21 T	6.3005	6.2998	23 T	6.3008	6.2998	26 T	6.3010	6.3003	28 T
170	6.6929	6.6919	6.6940	6.6930		6.6942	6.6935		6.6945	6.6935		6.6947	6.6940	
180	7.0866	7.0856	7.0877	7.0867		7.0879	7.0872		7.0882	7.0872		7.0884	7.0877	
190	7.4803	7.4791	7.4815	7.4805		7.4818	7.4810		7.4821	7.4810		7.4823	7.4815	
200	7.8740	7.8728	7.8753	7.8742	2 T	7.8755	7.8747	7 T	7.8758	7.8747	7 T	7.8760	7.8752	12 T
220	8.6614	8.6602	8.6627	8.6616	25 T	8.6629	8.6621	27 T	8.6632	8.6621	30 T	8.6634	8.6626	32 T
240	9.4488	9.4476	9.4501	9.4490		9.4503	9.4495		9.4506	9.4495		9.4508	9.4500	
250	9.8425	9.8413	9.8438	9.8427		9.8440	9.8432		9.8443	9.8432		9.8445	9.8437	

Note: To convert inches to mm, multiply inches by 25.4 $^{1)}\, L$ indicates "LOOSE" fit, T indicates "TIGHT" fit

	earing bore	nameters (v		k6			m5			m6			n5	
	diameter				Resultant			Resultant			Resultant			Resultant
	in	ches	Sh	aft dia.	fit ¹⁾ in	Shaf	t dia.	fit ¹⁾ in	Shaft	t dia.	fit ¹⁾ in	Shaf	t dia.	fit ¹⁾ in
mm	max.	min.	max.	min.	0.0001"	max.	min.	0.0001"	max.	min.	0.0001"	max.	min.	0.0001"
260	10.2362	10.23//8	10.2376	10.2364		10.2379	10.2370		10.2382	10.2370		10 238/	10.2375	
280	11.0236			11.0238	2 T	11.0253	11.0244	8T	11.0256	11.0244	8T		11.0249	13 T
300	11.8110			11.8112	28 T	11.8127	11.8118	31 T	11.8130	11.8118	34 T		11.8123	36 T
310	12.2047			12.2049	201	12.2064	12.2055	311	12.2067	12.2055	341		12.2060	301
320	12.5984	12.5968	12.6000	12.5986		12.6002	12.5992		12.6006	12.5992		12.6008	12.5999	
340	13.3858	13.3842	13.3874	13.3860		13.3876	13.3866		13.3880	13.3866		13.3882	13.3873	
350	13.7795	13.7779	13.7811	13.7797	2 T	13.7813	13.7803	8T	13.7817	13.7803	8T	13.7819	13.7810	15 T
360	14.1732	14.1716	14.1748	14.1734	32 T	14.1750	14.1740	34 T	14.1754	14.1740	38 T	14.1756	14.1747	40 T
380	14.9606	14.9590	14.9622	14.9608		14.9624	14.9614		14.9628	14.9614		14.9630	14.9621	
400	15.7480	15.7464	15.7496	15.7482		15.7498	15.7488		15.7502	15.7488		15.7504	15.7495	
420	16.5354			16.5356		16.5374	16.5363		16.5379	16.5363			16.5370	
440	17.3228		17.3246		2T	17.3248	17.3237	9 T	17.3253	17.3237	9 T		17.3244	16 T
460	18.1102			18.1104	36 T	18.1122	18.1111	38 T	18.1127	18.1111	43 T		18.1118	44 T
480	18.8976			18.8978		18.8996	18.8985		18.9001	18.8985			18.8992	
500	19.6850	19.6832	19.6868	19.6852		19.6870	19.6859		19.6875	19.6859		19.68/6	19.6866	
530	20.8661	20.8641	20.8678	20.8661		20.8683	20.8671		_	_		20.8689	20.8678	
560	22.0472			22.0472	ОТ	22.0494	22.0482	10 T	_	_			22.0489	17 T
600	23.6220	23.6200	23.6237	23.6220	37 T	23.6242	23.6230	42 T	_	_		23.6248	23.6237	48 T
630	24.8031	24.8011	24.8048	24.8031		24.8053	24.8041		-	-		24.8059	24.8048	
660	25.9843		25.9862			25.9869	25.9855		-	-			25.9863	
670	26.3780			26.3780		26.3806	26.3792		-	-			26.3800	
710	27.9528			27.9528	0T	27.9554	27.9540	12 T	-	-			27.9548	20 T
750	29.5276	29.5246		29.5276	49 T	29.5302	29.5288	56 T	_	-			29.5296	62 T
780	30.7087	30.7057		30.7087		30.7113	30.7099		_	-			30.7107	
800	31.4961	31.4931	31.4980	31.4961		31.4987	31.4973		-	-		31.4993	31.4981	
850	33.4646	33.4607	33,4668	33.4646		33.4675	33.4659		_	_		33,4683	33.4668	
900	35.4331			35.4331	ОТ	35.4360	35.4344	13 T	_	_			35.4353	22 T
950	37.4016			37.4016	61 T	37.4045	37.4029	68 T	_	_			37.4038	76 T
1000	39.3701	39.3662		39.3701		39.3730	39.3714		_	-			39.3723	
1060		41.7274		41.7323		41.7357	41.7339		-	-			41.7349	
1120	44.0945	44.0896		44.0945	0 T	44.0979	44.0961	16 T	-	-			44.0971	26 T
1180	46.4567	46.4518	46.4593	46.4567	75 T	46.4601	46.4583	83 T	-	-			46.4593	92 T
1250	49.2126	49.2077	49.2152	49.2126		49.2160	49.2142		-	-		49.2169	49.2152	

Note: To convert inches to mm, multiply inches by 25.4 $^{1)}\,L$ indicates "L00SE" fit, T indicates "TIGHT" fit

	_			-
-	Га	ы	۱.	О

	ring-seat diameters (/alues in inches)				,			,			_		
	aring bore		n6			р6			r6			r7		
	liameter	_		Resultant			Resultant			Resultant			Resultant	
	inches .	Shaft d		fit ¹⁾ in	Shaf		fit ¹⁾ in	Shaft		fit ¹⁾ in	Shaft		fit ¹⁾ in	
mm	max. min.	max.	min.	0.0001"	max.	min.	0.0001"	max.	min.	0.0001"	max.	min.	0.0001"	
4	0.1575 0.1572	0.1581	0.1578		_	_		_	_		_	_		
5	0.1969 0.1966		0.1972	3 T	_	_		_	_		_	_		
6	0.2362 0.2359		0.2365	9 T	_	_		_	_		_	_		
	0.2302 0.2337	0.2300	0.2505											
7	0.2756 0.2753	0.2763	0.2760		_	_		_	_		_	_		
8	0.3150 0.3147		0.3154	4 T	_	_		_	_		_	_		
9	0.3543 0.3540		0.3547	10 T	_	_		_	_		_	_		
10	0.3937 0.3934		0.3941	10.	_	_		_	_		_	_		
	0.0707	0.0711	0.07.12											
12	0.4724 0.4721	0.4733	0.4729		_	_		_	_		_	_		
15	0.5906 0.5903		0.5911	5 T	_	_		_	_		_	_		
17	0.6693 0.6690		0.6698	12 T	_	_		_	_		_	_		
	0.0070	0.0702	0.0070											
20	0.7874 0.7870	0.7885	0.7880		_	_		_	_		_	_		
25	0.9843 0.9839		0.9849	6 T	_	_		_	_		_	_		
30	1.1811 1.1807		1.1817	15 T	_	_		_	_		_	_		
	1.1011 1.1007	1.1022	1.1017											
35	1.3780 1.3775	1.3793 1	1.3787		_	_		_	_		_	_		
40	1.5748 1.5743		1.5755	7 T	_	_		_	_		_	_		
45	1.7717 1.7712		1.7724	18 T	_	_		_	_		_	_		
50	1.9685 1.9680		1.9692		_	_		_	_		_	_		
	217000	1.7070	1.,0,2											
55	2.1654 2.1648	2.1669 2	2.1662		_	_		_	_		_	_		
60	2.3622 2.3616		2.3630		_	_		_	_		_	_		
65	2.5591 2.5585		2.5599	8T	_	_		_	_		_	_		
70	2.7559 2.7553		2.7567	21 T	_	_		_	_		_	_		
75	2.9528 2.9522		2.9536		_	_		_	_		_	_		
80	3.1496 3.1490		3.1504		_	_		_	_		_	_		
85	3.3465 3.3457	3.3483	3.3474		3.3488	3.3480		_	_		_	_		
90	3.5433 3.5425		3.5442		3.5456	3.5448		_	_		_	_		
95	3.7402 3.7394		3.7411		3.7425	3.7417		_	_		_	_		
100	3.9370 3.9362		3.9379	9T	3.9393	3.9385	15 T	_	_		_	_		
105	4.1339 4.1331		4.1348	26 T	4.1362	4.1354	31 T	_	_		_	_		
110	4.3307 4.3299		4.3316		4.3330	4.3322		_	_		_	_		
115	4.5276 4.5268		4.5285		4.5299	4.5291		_	_		_	_		
120	4.7244 4.7236		4.7253		4.7267	4.7259		_	_		_	_		
125	4.9213 4.9203	4.9233	4.9224		4.9240	4.9230		4.9248	4.9239		-	_		
130	5.1181 5.1171		5.1192		5.1208	5.1198		5.1216	5.1207		-	-		
140	5.5118 5.5108		5.5129		5.5145	5.5135		5.5153	5.5144		-	_		
150	5.9055 5.9045		5.9066	11 T	5.9082	5.9072	17 T	5.9090	5.9081	26 T	_	_		
160	6.2992 6.2982		6.3003	30 T	6.3019	6.3009	37 T	6.3027	6.3018	45 T	_	_		
170	6.6929 6.6919		6.6940		6.6956	6.6946		6.6964	6.6955		_	_		
180	7.0866 7.0856		7.0877		7.0893	7.0883		7.0901	7.0892		-	_		
190	7.4803 7.4791	7.4827	7.4815		7.4834	7.4823		7.4845	7.4833	30 T	-	-		
200	7.8740 7.8728	7.8764	7.8752	12 T	7.8771	7.8760	20 T	7.8782	7.8770	54 T	-	-		
220	8.6614 8.6602	8.6638	8.6626	36 T	8.6645	8.6634	43 T	8.6657	8.6645	31/55 T/T	8.6664	8.6645	31/62 T/T	
240	9.4488 9.4476	9.4512	9.4500		9.4519	9.4508		9.4532	9.4521	33 T	9.4539	9.4521	33 T	
250	9.8425 9.8413	9.8449	9.8437		9.8456	9.8445		9.8469	9.8458	56 T	9.8476	9.8458	63 T	

Note: To convert inches to mm, multiply inches by 25.4 $^{1)}$ L indicates "LOOSE" fit, T indicates "TIGHT" fit

Bearing bore		n6			p6			r6			r7			
	diameter				Resultant		•	Resultant			Resultant			Resultant
	in	ches	Sha	aft dia.	fit ¹⁾ in	Sha	ft dia.	fit ¹⁾ in	Shat	ft dia.	fit ¹⁾ in	Shaf	t dia.	fit ¹⁾ in
mm	max.	min.	max.	min.	0.0001"	max.	min.	0.0001"	max.	min.	0.0001"	max.	min.	0.0001"
2/0	40.22/2	40.2270	40 2200	40.2275		40 2207	40.2207		40.2/42	40.2200	27.7	40.2/40	40.2200	27.7
260	10.2362	10.2348		10.2375	42 T		10.2384	22.T		10.2399	37 T		10.2399	37 T
280	11.0236	11.0222		11.0249	13 T		11.0258	22 T	11.0286	11.0273	64 T	11.0293	11.0273	71 T
300	11.8110	11.8096		11.8123	40 T		11.8132	49 T	11.8161	11.8149	39 T		11.8149	39 T
310	12.2047	12.2033	12.20/3	12.2060		12.2082	12.2069		12.2098	12.2086	65 T	12.2106	12.2086	73 T
320	12.5984	12.5968	12 6013	12.5999		12 6023	12.6008		12.6041	12.6027	43 T	12 60/49	12.6027	43 T
340	13.3858	13.3842		13.3873			13.3882		13.3915	13.3901	73 T	13.3923	13.3901	81 T
350	13.7795	13.7779		13.7810	15 T		13.7819	24 T	13.7852	13.7838	751	13.7860	13.7838	011
360	14.1732	14.1716		14.1747	45 T		14.1756	55 T	14.1791	14.1777	45 T		14.1777	45 T
380	14.9606	14.9590		14.9621	451		14.9630	331	14.9665	14.9651	75 T		14.9651	83 T
400	15.7480	15.7464		15.7495			15.7504		15.7539	15.7525	/31		15.7525	051
400	15.7460	15.7404	13.7307	13.7473		13.7317	13.7304		13.7337	13.7323		15.7547	13.7323	
420	16.5354	16.5336	16.5385	16.5370		16.5397	16.5381		16.5419	16.5404	50 T	16.5428	16.5404	50 T
440	17.3228	17.3210		17.3244	16 T		17.3255	27 T	17.3293	17.3278	83 T		17.3278	92 T
460	18.1102	18.1084		18.1118	49 T		18.1129	61 T	18.1170	18.1154	52 T	18.1179		52 T
480	18.8976	18.8958		18.8992			18.9003		18.9044	18.9028	86 T		18.9028	95 T
500	19.6850	19.6832		19.6866			19.6877		19.6918	19.6902	00 1		19.6902	, , ,
	27.0000	2710002	17.0001			27.0070	17.0077		1710710	17.0702		17.0727		
530	20.8661	20.8641	20.8696	20.8678		20.8709	20.8692		20.8737	20.8720	59 T	20.8748	20.8720	59 T
560	22.0472	22.0452	22.0507	22.0489	17 T	22.0520	22.0503	31 T	22.0548	22.0531	96 T	22.0559	22.0531	107 T
600	23.6220	23.6200	23.6255	23.6237	55 T	23.6268	23.6251	68 T	23.6298	23.6281	61 T	23.6309	23.6281	61 T
630	24.8031	24.8011	24.8066	24.8048		24.8079	24.8062		24.8109	24.8092	98 T	24.8120	24.8092	109 T
660	25.9843	25.9813		25.9863			25.9878		25.9932	25.9912	69 T	25.9943		68 T
670	26.3780	26.3750		26.3800			26.3815		26.3869	26.3849	119 T	26.3880	26.3848	130 T
710	27.9528	27.9498		27.9548	20 T		27.9563	35 T	27.9617	27.9597		27.9628	27.9596	
750	29.5276	29.5246		29.5296	69 T		29.5311	84 T	29.5369	29.5349	73 T	29.5380	29.5349	73 T
780	30.7087	30.7057		30.7107			30.7122		30.7180	30.7160	123 T		30.7160	134 T
800	31.4961	31.4931	31.5000	31.4981		31.5015	31.4996		31.5054	31.5034		31.5065	31.5034	
850	33.4646	33.4607	33 / 490	33.4668		33 // 707	33.4685		33.4751	33.4729	83 T	33 /.76/	33.4729	83 T
900	35.4331	35.4292		35.4353	22 T		35.4370	39 T	35.4436	35.4414	144 T	35.4449		157 T
950	37.4016	37.3977		37.4038	83 T		37.4055	100 T	37.4125	37.4103	87 T	37.4138	37.4103	87 T
1000	39.3701	37.3977		39.3723	03 1		39.3740	1001	39.3810	37.4103	148T		37.4103	161 T
1000	37.3/01	37.3002	37.3743	37.3723		37.3702	37.3740		37.3010	37.3700	140 1	37.3023	37.3700	1011
1060	41.7323	41.7274	41.7375	41.7349		41.7396	41.7370		41.7447	41.7421	98 T	41.7463	41.7421	98 T
1120	44.0945	44.0896		44.0971	26 T		44.0992	47 T	44.1069	44.1043	173 T	44.1085		189 T
1180	46.4567	46.4518		46.4593	101 T		46.4614	122 T	46.4695	46.4669	102 T	46.4711	46.4669	102 T
1250	49.2126	49.2077		49.2152			49.2173		49.2254	49.2226	177T		49.2228	193T
_										_				

Note: To convert inches to mm, multiply inches by 25.4 $^{1)}\,L$ indicates "LOOSE" fit, T indicates "TIGHT" fit

								Table 8		
Shaft bear	ring-seat o	diameters (va	lues in inch	es)						
	aring bore			s6		s7				
ď	iameter				Resultant			Resultant		
	in	ches	Sha	ft dia.	fit ¹⁾ in	Sha	ft dia.	fit ¹⁾ in		
mm	max.	min.	max.	min.	0.0001"	max.	min.	0.0001"		
4	0.1575	0.1572	_	_		1	_			
5	0.1969	0.1966	_	_		_	_			
6	0.2362	0.2359	_	_		_	_			
7	0.2756	0.2753	-	-		-	-			
8	0.3150	0.3147	-	-		-	-			
9	0.3543	0.3540	-	-		-	-			
10	0.3937	0.3934	-	-		-	-			
12	0.4724	0.4721	_	_		_	_			
15	0.5906	0.5903	_	_		_	_			
17	0.6693	0.6690	_	_		_	_			
_,										
20	0.7874	0.7870	_	-		-	-			
25	0.9843	0.9839	-	-		-	-			
30	1.1811	1.1807	-	-		-	-			
35	1.3780	1.3775	_							
40	1.5748	1.5743								
45	1.7717	1.7712					_			
50	1.9685	1.9680	_	_		_	_			
55	2.1654	2.1648	-	-		-	-			
60	2.3622	2.3616	-	-		-	-			
65	2.5591	2.5585	-	-		-	-			
70	2.7559	2.7553	-	-		-	-			
75	2.9528	2.9522	-	-		-	-			
80	3.1496	3.1490	-	-		-	-			
85	3.3465	3.3457	_	_		_	_			
90	3.5433	3.5425	_	_		_	_			
95	3.7402	3.7394	_	_		_	_			
100	3.9370	3.9362	_	_		_	_			
105	4.1339	4.1331	_	_		_	_			
110	4.3307	4.3299	_	_		_	_			
115	4.5276	4.5268	_	_		_	_			
120	4.7244	4.7236	-	-		-	-			
40-	4.0515	4.0000								
125	4.9213	4.9203	_	-		-	-			
130	5.1181	5.1171	_	_		-	-			
140	5.5118	5.5108	_	_		-	-			
150	5.9055	5.9045	_	_		-	-			
160	6.2992	6.2982	_	_		-	_			
170	6.6929	6.6919	_	_		-	_			
180	7.0866	7.0856	_	_		_	_			
190	7.4803	7.4791	_	_		-	_			
200	7.8740	7.8728	-	-		-	-			
220	8.6614	8.6602	-	-		-	-			
	9.4488	9.4476	_	_		_	_			
240	7.4400	,,,,,								

Note: To convert inches to mm, multiply inches by 25.4 $^{1)}\, L$ indicates "L00SE" fit, T indicates "TIGHT" fit

Tab	le 8
-----	------

Shaft bearing-seat diameters (values in inches)

	earing bore		, s6		s7			
	diameter			Resultant		_ -	Resultant	
	inches	Ch:	aft dia.	fit ¹⁾ in	Shar	ft dia.	fit ¹⁾ in	
			min.	0.0001"		min.	0.0001"	
mm	max. min.	max.	111111.	0.0001	max.	111111.	0.0001	
260	10.2362 10.2348	_	_	62T	_	_	62 T	
280	11.0236 11.0222	11.0311	11.0298	89 T	11.0319	11.0298	97 T	
300	11.8110 11.8096	11.8190	11.8177	67 T	11.8198	11.8177	67 T	
310	12.2047 12.2033	12.2127	12.2114	94 T	12.2135	12.2114	102 T	
320	12.5984 12.5968	12.6073	12.6059	75 T	12.6081	12.6059	75 T	
340	13.3858 13.3842	13.3947	13.3933	105 T	13.3956	13.3933	114 T	
350	13.7795 13.7779	13.7884	13.7870		13.7893	13.7870		
360	14.1732 14.1716	14.1828	14.1814		14.1837	14.1814		
380	14.9606 14.9590	14.9702	14.9688	82 T	14.9711	14.9688	82 T	
400	15.7480 15.7464	15.7576	15.7562	112T	15.7585	15.7562	121 T	
420	16.5354 16.5336	16.5461	16.5446	92 T	16.5470	16.5446	92 T	
440	17.3228 17.3210	17.3335	17.3320	125 T	17.3344	17.3320	134 T	
460	18.1102 18.1084	18.1217	18.1202		18.1226	18.1202		
480	18.8976 18.8958	18.9091	18.9076	100 T	18.9100	18.9076	100 T	
500	19.6850 19.6832	19.6965	19.6950	133 T	19.6974	19.6950	142T	
	2710000 2710002	27.0700	17.0700	100 1	2710771	17.0700		
530	20.8661 20.8641	20.8789	20.8772	111 T	20.8799	20.8772	111 T	
560	22.0472 22.0452	22.0600	22.0583	148T	22.0610	22.0583	158T	
600	23.6220 23.6200	23.6360	23.6343	123 T	23.6370	23.6343	123 T	
630	24.8031 24.8011	24.8171	24.8154	160 T	24.8181	24.8154	170 T	
660	25.9843 25.9813	25.9996	25.9976		26.0008	25.9976		
670	26.3780 26.3750	26.3933	26.3913	133 T	26.3945	26.3913	133 T	
710	27.9528 27.9498	27.9681	27.9661	183 T	27.9693	27.9661	195 T	
750	29.5276 29.5246	29.5445	29.5425		29.5457	29.5425		
780	30.7087 30.7057	30.7256	30.7236	149T	30.7268	30.7236	149T	
800	31.4961 31.4931	31.5130	31.5110	199T	31.5142	31.5110	211 T	
850	33.4646 33.4607	33.4837	33.4815	169T	33.4850	33.4815	169T	
900	35.4331 35.4292	35.4522	35.4500	230 T	35.4535	35.4500	243 T	
950	37.4016 37.3977	37.4223	37.4201	185 T	37.4236	37.4201	185 T	
1000	39.3701 39.3662	39.3908	39.3886	246 T	39.3921	39.3886	259 T	
1060	41.7323 41.7274	41.7554	41.7528	205 T	41.7569	41.7528	205 T	
1120	44.0945 44.0896	44.1176	44.1150	280 T	44.1191	44.1150	295 T	
1180	46.4567 46.4518	46.4821	46.4795	228 T	46.4837	46.4795	228 T	
1250	49.2126 49.2077	49.2380	49.2354	303T	49.2396	49.2354	319T	

Note: To convert inches to mm, multiply inches by 25.4 $^{1)}\, L$ indicates "LOOSE" fit, T indicates "TIGHT" fit

														Table 9	
	pearing-seat	diameters	(values in ir	•								117			
	ring outside			F7	Desultant		G7	Desultant		H6	Desultant		H7	Desultant	
d	liameter		11		Resultant fit ¹⁾ in	Harris		Resultant fit ¹⁾ in	Harris		Resultant fit ¹⁾ in	Hamilia		Resultant fit ¹⁾ in	
	inch			ing bore		Housing			Housir	•	0.0001"	Housin	-		
mm	max.	min.	min.	max.	0.0001"	min.	max.	0.0001"	min.	max.	0.0001	min.	max.	0.0001"	
16	0.6299	0.6296	0.6305	0.6312	16 L 6 L	0.6301	0.6308	12 L 2 L	0.6299	0.6303	7 L 0 L	0.6299	0.6306	10 L 0 L	
19	0.7480	0.7476	0.7488	0.7496		0.7483	0.7491		0.7480	0.7485		0.7480	0.7488		
22	0.8661	0.8657	0.8669	0.8677		0.8664	0.8672		0.8661	0.8666		0.8661	0.8669		
24	0.9449	0.9445	0.9457	0.9465	20 L	0.9452	0.9460	15 L	0.9449	0.9454	9 L	0.9449	0.9457	12 L	
26	1.0236	1.0232	1.0244	1.0252	8 L	1.0239	1.0247	3 L	1.0236	1.0241	0 L	1.0236	1.0244	0 L	
28	1.1024	1.1020	1.1032	1.1040		1.1027	1.1035		1.1024	1.1029		1.1024	1.1032		
30	1.1811	1.1807	1.1819	1.1827		1.1814	1.1822		1.1811	1.1816		1.1811	1.1819		
32	1.2598	1.2594	1.2608	1.2618		1.2602	1.2611		1.2598	1.2604		1.2598	1.2608		
35	1.3780	1.3776	1.3790	1.4000		1.3784	1.3793		1.3780	1.3786		1.3780	1.3790		
37	1.4567	1.4563	1.4577	1.4587	24 L	1.4571	1.4580	17 L	1.4567	1.4573	10 L	1.4567	1.4577	14 L	
40	1.5748	1.5744	1.5758	1.5768	10 L	1.5752	1.5761	4 L	1.5748	1.5754	0 L	1.5748	1.5758	0 L	
42	1.6535	1.6531	1.6545	1.6555	10 L	1.6539	1.6548	4 L	1.6535	1.6541	O L	1.6535	1.6545	O L	
47	1.8504	1.8500	1.8514	1.8524		1.8508	1.8517		1.8504	1.8510		1.8504	1.8514		
52	2.0472	2.0467	2.0484	2.0496		2.0476	2.0488		2.0472	2.0479		2.0472	2.0484		
55	2.1654	2.1649	2.1666	2.1678		2.1658	2.1670		2.1654	2.1661		2.1654	2.1666		
62	2.4409	2.4404	2.4421	2.4433	29 L	2.4413	2.4425	21 L	2.4409	2.4416	12 L	2.4409	2.4421	17 L	
68	2.6772	2.6767	2.6784	2.6796	12 L	2.6776	2.6788	4 L	2.6772	2.6779	0 L	2.6772	2.6784	0 L	
72	2.8346	2.8341	2.8358	2.8370		2.8350	2.8362		2.8346	2.8353		2.8346	2.8358		
75	2.9527	2.9522	2.9539	2.9551		2.9532	2.9543		2.9527	2.9534		2.9527	2.9539		
80	3.1496	3.1491	3.1508	3.1520		3.1500	3.1512		3.1496	3.1503		3.1496	3.1508		
85	3.3465	3.3459	3.3479	3.3493		3.3470	3.3484		3.3465	3.3474		3.3465	3.3479		
90	3.5433	3.5427	3.5447	3.5461		3.5438	3.5452		3.5433	3.5442		3.5433	3.5447		
95	3.7402	3.7396	3.7416	3.7430		3.7407	3.7421		3.7402	3.7411		3.7402	3.7416		
100	3.9370	3.9364	3.9384	3.9398	34 L	3.9375	3.9389	25 L	3.9370	3.9379	15 L	3.9370	3.9384	20 L	
110	4.3307	4.3301	4.3321	4.3335	14 L	4.3312	4.3326	5 L	4.3307	4.3316	0 L	4.3307	4.3321	0 L	
					14 L		4.5295	3 L	4.5276		UL		4.5290	UL	
115 120	4.5276 4.7244	4.5270 4.7238	4.5290 4.7258	4.5304 4.7272		4.5281 4.7249	4.7263		4.5276	4.5285 4.7253		4.5276 4.7244	4.7258		
	4.7244	4.7230	4.7230	4.7272		4.7247	4.7203		7.7277	4.7233		4.7244	4.7230		
125	4.9213	4.9206	4.9230	4.9246		4.9219	4.9234		4.9213	4.9223		4.9213	4.9229		
130	5.1181	5.1174	5.1198	5.1214		5.1187	5.1202		5.1181	5.1191		5.1181	5.1197		
140	5.5118	5.5111	5.5135	5.5151	40 L	5.5124	5.5139	28 L	5.5118	5.5128	17 L	5.5118	5.5134	23 L	
145	5.7087	5.7080	5.7104	5.7120	17 L	5.7093	5.7108	6 L	5.7087	5.7097	0 L	5.7087	5.7103	0 L	
150	5.9055	5.9048	5.9072	5.9088		5.9061	5.9076		5.9055	5.9065		5.9055	5.9071		
160	6.2992	6.2982	6.3009	6.3025		6.2998	6.3013		6.2992	6.3002		6.2992	6.3008		
165	6.4961	6.4951	6.4978	6.4994	43 L	6.4967	6.4982	31 L	6.4961	6.4971	20 L	6.4961	6.4977	26 L	
170	6.6929	6.6919	6.6946	6.6962	17 L	6.6935	6.6950	6 L	6.6929	6.6939	0 L	6.6929	6.6945	0 L	
180	7.0866	7.0856	7.0883	7.0899	1/ [7.0872	7.0887	O L	7.0866	7.0876	O L	7.0866	7.0882	0 L	
190	7.4803	7.4791	7.4823	7.4841		7.4809	7.4827		7.4803	7.4814		7.4803	7.4821		
200	7.8740	7.8728	7.8760	7.8778		7.8746	7.8764		7.8740	7.8751		7.8740	7.8758		
210	8.2677	8.2665	8.2697	8.2715		8.2683	8.2701		8.2677	8.2688		8.2677	8.2695		
215	8.4646	8.4634	8.4666	8.4684	50 L	8.4652	8.4670	36 L	8.4646	8.4657	23 L	8.4646	8.4664	30 L	
220	8.6614	8.6602	8.6634	8.6652	20 L	8.6620	8.6638	6 L	8.6614	8.6625	0 L	8.6614	8.6632	0 L	
225	8.8583	8.8571	8.8603	8.8621		8.8589	8.8607		8.8583	8.8594		8.8583	8.8601		
230	9.0551	9.0539	9.0571	9.0589		9.0557	9.0575		9.0551	9.0562		9.0551	9.0569		
240	9.4488	9.4476	9.4508	9.4526		9.4494	9.4512		9.4488	9.4499		9.4488	9.4506		
250	9.8425	9.8413	9.8445	9.8463		9.8431	9.8449		9.8425	9.8436		9.8425	9.8443		

Note: To convert inches to mm, multiply inches by 25.4 $^{1)}\,L$ indicates "L00SE" fit, T indicates "TIGHT" fit

Table 9

			, ,		
Housing	hoarina-c	eat diamet	erc (val	II 20II	inchecl

Housing	bearing-sea	at diameters	(values in i	nches)										
Bea	aring outside	2		F7	1		G7		1	H6			H7	
	diameter				Resultant			Resultant			Resultant			Resultant
	ind	ches	Hous	sing bore	fit ¹⁾ in	Housin	g bore	fit ¹⁾ in	Housi	ng bore	fit ¹⁾ in	Housir	ig bore	fit ¹⁾ in
mm	max.	min.	min.	max.	0.0001"	min.	max.	0.0001"	min.	max.	0.0001"	min.	max.	0.0001"
260	10.2362	10.2348	10.2384	10.2405		10.2369	10.2389		10.2362	10.2375		10.2362	10.2382	
270	10.6299	10.6285	10.6321	10.6342		10.6306	10.6326		10.6299	10.6312		10.6299	10.6319	
280	11.0236	11.0222		11.0279	57 L	11.0243	11.0263	41 L	11.0236	11.0249	27 L	11.0236	11.0256	34 L
290	11.4173	11.4159		11.4216	22 L	11.4180	11.4200	7 L	11.4173	11.4186	0 L		11.4193	0 L
300	11.8110	11.8096		11.8153		11.8117	11.8137		11.8110	11.8123			11.8130	
310	12.2047	12.2033	12.2069	12.2090		12.2054	12.2074		12.2047	12.2060			12.2067	
320	12.5984	12.5968		12.6031			12.6014		12.5984	12.5998			12.6006	
340	13.3858	13.3842		13.3905		13.3865	13.3888		13.3858	13.3872			13.3880	
360	14.1732	14.1716		14.1779	63 L	14.1739	14.1762	46 L	14.1732	14.1746	30 L		14.1754	38 L
370	14.5669	14.5654	14.5694	14.5717	24 L	14.5677	14.5700	7 L	14.5669	14.5684	0 L		14.5692	0 L
380	14.9606	14.9590	14.9630	14.9653		14.9613	14.9636		14.9606	14.9620		14.9606	14.9628	
400	15.7480	15.7464	15.7504	15.7527		15.7487	15.7510		15.7480	15.7494		15.7480	15.7502	
420	16.5354	16.5336	16.5381	16.5406		16.5362	16.5387		16.5354	16.5370		16.5354	16 5270	
440	17.3228	17.3210		17.3280	70 L	17.3236	17.3261	51 L	17.3228	17.3244	34 L	17.3228		43 L
	18.1102	18.1084	18.1129	18.1154	27 L		18.1135	8 L			0 L	18.1102		
460					2/ L	18.1110		O L	18.1102	18.1118	UL			0 L
480	18.8976	18.8958		18.9028		18.8984	18.9009		18.8976	18.8992		18.8976		
500	19.6850	19.6832	19.6877	19.6902		19.6858	19.6883		19.6850	19.6866		19.6850	19.6875	
520	20.4724	20.4704	20.4754	20.4781		20.4733	20.4760		20.4724	20.4741		20.4724	20.4752	
540	21.2598	21.2578	21.2628	21.2655		21.2607	21.2634		21.2598	21.2615			21.2626	
560	22.0472	22.0452		22.0529	77 L	22.0481	22.0508	56 L	22.0472	22.0489	37 L		22.0500	48 L
580	22.8346	22.8326	22.8376	22.8403	30 L	22.8355	22.8382	9 L	22.8346	22.8363	0 L		22.8374	0 L
600	23.6220	23.6200	23.6250	23.6277		23.6229	23.6256		23.6220	23.6237			23.6248	
620	24.4094	24.4074	24.4124			24.4103	24.4130		24.4094	24.4111			24.4122	
	2111071					2111200			2 111071					
650	25.5906	25.5876		25.5969		25.5915	25.5947		25.5906	25.5926		25.5906		
670	26.3780	26.3750	26.3811	26.3843		26.3789	26.3821		26.3780	26.3800			26.3811	
680	26.7717	26.7687	26.7748	26.7780		26.7726	26.7758		26.7717	26.7737			26.7748	
700	27.5591	27.5561	27.5622	27.5654		27.5600	27.5632		27.5591	27.5611		27.5591	27.5622	
720	28.3465	28.3435	28.3496	28.3528	93 L	28.3474	28.3506	71 L	28.3465	28.3485	50 L	28.3465	28.3496	61 L
750	29.5276	29.5246	29.5307	29.5339	31 L	29.5285	29.5317	9 L	29.5276	29.5296	0 L	29.5276	29.5307	0 L
760	29.9213	29.9183	29.9244	29.9276		29.9222	29.9254		29.9213	29.9233		29.9213	29.9244	
780	30.7087	30.7057	30.7118	30.7150		30.7096	30.7128		30.7087	30.7107		30.7087	30.7118	
790	31.1024	31.0994	31.1055	31.1087		31.1033	31.1065		31.1024	31.1044		31.1024	31.1055	
800	31.4961	31.4931	31.4992	31.5024		31.4970	31.5002		31.4961	31.4981		31.4961	31.4992	
920	22 2025	22.270/	22.20/0	22.2007		22.20/5	22 2001		22 2025	22 2057		22 2025	22 2070	
820 830	32.2835 32.6772	32.2796 32.6733	32.2869	32.2904 32.6841		32.2845	32.2881		32.2835	32.2857 32.6794			32.2870 32.6807	
850	33.4646	33.4607		33.4715	1001		33.4692	0.5.1		33.4668	(1)		33.4681 34.2555	7/ 1
870	34.2520	34.2481		34.2589	108 L		34.2566	85 L	34.2520		61 L			74 L
920	36.2205	36.2166		36.2274	34 L		36.2251	10 L		36.2227	0 L		36.2240	0 L
950	37.4016	37.3977		37.4085			37.4062		37.4016	37.4038		37.4016		
980	38.5827	38.5788		38.5896			38.5873		38.5827	38.5849			38.5862	
1000	39.3701	39.3662	39.3/35	39.3770		39.3/11	39.3747		39.3701	39.3723		39.3701	39.3736	
1150	45.2756	45.2707	45.2795	45.2836	129 L	45.2767	45.2808	101 L	45.2756	45.2782	75 L	45.2756	45.2797	90 L
1250	49.2126	49.2077		49.2206	39 L		49.2178	11 L	49.2126	49.2152	0 L		49.2167	0 L
1400	55.1181	55.1118		55.1274	156 L		55.1242	124 L	55.1181	55.1212	94 L		55.1230	112 L
1600	62.9921	62.9858	62.9964	63.0014	43 L	62.9933	62.9982	12 L	62.9921	62.9952	0 L	62.9921	62.9970	0 L
1800	70.8661	70.8582	70.8708	70.8767	185 L	70.8674	70.8733	151 L	70.8661	70.8697	115 L	70.8661	70,8720	138 L
2000	78.7402	78.7323		78.7508	47 L		78.7474	13 L	78.7402	78.7438	0 L	78.7402		0 L
	7 3.7 402	. 5.7 525	75.7447	, 5.7 550	.,,_	, 3., 413	, 5., 7, 7		, 5.7 402	, 5.7 450		, 5.7 402	, 5., 401	0 L
2300	90.5512	90.5414	90.5563	90.5632	218 L	90.5525	90.5594	180 L	90.5512	90.5555	141 L	90.5512	90.5581	167 L
2500	98.4252	98.4154	98.4303	98.4372	51 L	98.4265	98.4334	13 L	98.4252	98.4295	0 L	98.4252	98.4321	0 L

Note: To convert inches to mm, multiply inches by 25.4

¹⁾ L indicates "LOOSE" fit, T indicates "TIGHT" fit

														Table 9
	bearing-seat	diameters	(values in in	•										
	ring outside			H8	I		H9			H10	I		J6	I
C	liameter				Resultant			Resultant			Resultant			Resultant
	inch	ies	Housi	ng bore	fit ¹⁾ in	Housing	g bore	fit ¹⁾ in	Housin	g bore	fit ¹⁾ in	Housin	g bore	fit ¹⁾ in
mm	max.	min.	min.	max.	0.0001"	min.	max.	0.0001"	min.	max.	0.0001"	min.	max.	0.0001"
16	0.6299	0.6296	0.6299	0.6310	14L 0 L	0.6299	0.6316	20L 0 L	0.6299	0.6327	31L 0 L	0.6297	0.6301	5L 2 T
19	0.7480	0.7476	0.7480	0.7493		0.7480	0.7500		0.7480	0.7513		0.7478	0.7483	
22	0.8661	0.8657	0.7480	0.8674		0.8661	0.7300		0.8661	0.7515		0.8659	0.8664	
		0.9445			471			2/1			271			7.1
24	0.9449		0.9449	0.9462	17 L	0.9449	0.9469	24 L	0.9449	0.9482	37 L	0.9447	0.9452	7 L
26	1.0236	1.0232	1.0236	1.0249	0 L	1.0236	1.0256	0 L	1.0236	1.0269	0 L	1.0234	1.0239	2T
28	1.1024	1.1020	1.1024	1.1037		1.1024	1.1044		1.1024	1.1057		1.1022	1.1027	
30	1.1811	1.1807	1.1811	1.1824		1.1811	1.1831		1.1811	1.1844		1.1809	1.1814	
32	1.2598	1.2594	1.2598	1.2613		1.2598	1.2622		1.2598	1.2637		1.2596	1.2602	
35	1.3780	1.3776	1.2378	1.3795		1.3780	1.3804		1.2378	1.3819		1.3778	1.3784	
					401			20.1			(2)			0.1
37	1.4567	1.4563	1.4567	1.4582	19 L	1.4567	1.4591	28 L	1.4567	1.4606	43 L	1.4565	1.4571	8 L
40	1.5748	1.5744	1.5748	1.5763	0 L	1.5748	1.5772	0 L	1.5748	1.5787	0 L	1.5746	1.5752	2T
42	1.6535	1.6531	1.6535	1.6550		1.6535	1.6559		1.6535	1.6574		1.6533	1.6539	
47	1.8504	1.8500	1.8504	1.8519		1.8504	1.8528		1.8504	1.8543		1.8502	1.8508	
52	2.0472	2.0467	2.0472	2.0490		2.0472	2.0501		2.0472	2.0519		2.0470	2.0477	
													2.1659	
55	2.1654	2.1649	2.1654	2.1672	22.1	2.1654	2.1683	27.1	2.1654	2.1701	521	2.1652		401
62	2.4409	2.4404	2.4409	2.4427	23 L	2.4409	2.4438	34 L	2.4409	2.4456	52 L	2.4407	2.4414	10 L
68	2.6772	2.6767	2.6772	2.6790	0 L	2.6772	2.6801	0 L	2.6772	2.6819	0 L	2.6770	2.6777	2T
72	2.8346	2.8341	2.8346	2.8364		2.8346	2.8375		2.8346	2.8393		2.8344	2.8351	
75	2.9527	2.9522	2.9527	2.9545		2.9527	2.9556		2.9527	2.9574		2.9525	2.9532	
80	3.1496	3.1491	3.1496	3.1514		3.1496	3.1525		3.1496	3.1543		3.1494	3.1501	
85	3.3465	3.3459	3.3465	3.3486		3.3465	3.3499		3.3465	3.3520		3.3463	3.3471	
90	3.5433	3.5427	3.5433	3.5454		3.5433	3.5467		3.5433	3.5488		3.5431	3.5439	
95	3.7402	3.7396	3.7402	3.7423		3.7402	3.7436		3.7402	3.7457		3.7400	3.7408	
100	3.9370	3.9364	3.7402	3.9391	27 L	3.9370	3.9404	40 L	3.9370	3.9425	61 L	3.9368	3.9376	12 L
110	4.3307	4.3301	4.3307	4.3328	0 L	4.3307	4.3341	0 L	4.3307	4.3362	0 L	4.3305	4.3313	2T
115	4.5276	4.5270	4.5276	4.5297		4.5276	4.5310		4.5276	4.5331		4.5274	4.5282	
120	4.7244	4.7238	4.7244	4.7265		4.7244	4.7278		4.7244	4.7299		4.7242	4.7250	
125	4.9213	4.9206	4.9213	4.9238		4.9213	4.9252		4.9213	4.9276		4.9210	4.9220	
130	5.1181	5.1174	5.1181	5.1206		5.1181	5.1220		5.1181	5.1244		5.1178	5.1188	
140	5.5118		5.5118	5.5143	32 L	5.5118	5.1220	461	5.5118	5.5181	70 L	5.5115	5.5125	14 L
								46 L						
145	5.7087	5.7080	5.7087	5.7112	0 L	5.7087	5.7126	0 L	5.7087	5.7150	0 L	5.7084	5.7094	3 T
150	5.9055	5.9048	5.9055	5.9080		5.9055	5.9094		5.9055	5.9118		5.9052	5.9062	
160	6.2992	6.2982	6.2992	6.3017		6.2992	6.3031		6.2992	6.3055		6.2989	6.2999	
165	6.4961	6.4951	6.4961	6.4986	35 L	6.4961	6.5000	49 L	6.4961	6.5024	73 L	6.4958	6.4968	17 L
170	6.6929	6.6919	6.6929	6.6954	0 L	6.6929	6.6968	0 L	6.6929	6.6992	0 L	6.6926	6.6936	3 T
180	7.0866	7.0856	7.0866	7.0891		7.0866	7.0905	3.	7.0866	7.0929		7.0863	7.0873	5 1
190	7.4803	7.4791	7.4803	7.4831		7.4803	7.4848		7.4803	7.4876		7.4800	7.4812	
200	7.8740	7.8728	7.8740	7.8768		7.8740	7.8785		7.8740	7.8813		7.8737	7.8749	
210	8.2677	8.2665	8.2677	8.2705		8.2677	8.2722		8.2677	8.2750		8.2674	8.2686	
215	9 / 6 / 6	8 4634	8 / 6 / 6	8 //67//	401	8 4646	8 / 6 9 1	571	8 4646	2 / 710	851	8 4643	8 4655	21

Note: To convert inches to mm, multiply inches by 25.4

8.4646

8.6614

8.8583

9.0551

9.4488

9.8425

8.4674

8.6642

8.8611

9.0579

9.4516

9.8453

8.4646 8.4634

8.6614 8.6602

8.8583 8.8571

9.0551 9.0539

9.4488 9.4476

9.8425 9.8413

215

220

225

230

240

250

72 **5KF**

8.4691

8.6659

8.8628

9.0596

9.4533

9.8470

57 L

0 L

8.4646

8.6614

8.8583

9.0551

9.4488

9.8425

8.4719

8.6687

8.8656

9.0624

9.4561

9.8498

85 L

0 L

8.4643

8.6611

8.8580

9.0548

9.4485

9.8422

21 L

3 T

8.4655

8.6623

8.8592

9.0560

9.4497

9.8434

40 L

0 L

8.4646

8.6614

8.8583

9.0551

9.4488

9.8425

 $^{^{1)}\,\}mathrm{L}$ indicates "LOOSE" fit, T indicates "TIGHT" fit

Table 9

bearing-sea		

Housing bearing-seat diameters (values in inches)										
Bea	aring outside	H8		H9		H10)	J6		
	diameter		Resultant		Resultant		Resultant		Resultant	
	inches	Housing bore	fit ¹⁾ in	Housing bore	fit ¹⁾ in	Housing bore	fit ¹⁾ in	Housing bore	fit ¹⁾ in	
mm	max. min.	min. max.	0.0001"	min. max.	0.0001"	min. ma	x. 0.0001"	min. max.	0.0001"	
260	10.2362 10.2348	10.2362 10.2394		10.2362 10.2413		10.2362 10.2	445	10.2359 10.2372		
270	10.6299 10.6285	10.6299 10.6331		10.6299 10.6350		10.6299 10.6		10.6296 10.6309		
280	11.0236 11.0222	11.0236 11.0268	46 L	11.0236 11.0287	65 L	11.0236 11.0		11.0233 11.0246	24 L	
290	11.4173 11.4159	11.4173 11.4205	0 L	11.4173 11.4224	0 L	11.4173 11.4		11.4170 11.4183	3T	
300	11.8110 11.8096	11.8110 11.8142	O L	11.8110 11.8161	O L	11.8110 11.8		11.8107 11.8120	31	
310	12.2047 12.2033	12.2047 12.2079		12.2047 12.2098		12.2047 12.2		12.2044 12.2057		
310	12.2047 12.2055	12.2047 12.2077		12.2047 12.2070		12.2047 12.2	130	12.2044 12.2037		
320	12.5984 12.5968	12.5984 12.6019		12.5984 12.6039		12.5984 12.6	075	12.5981 12.5995		
340	13.3858 13.3842	13.3858 13.3893		13.3858 13.3913		13.3858 13.3	949	13.3855 13.3869		
360	14.1732 14.1716	14.1732 14.1767	51 L	14.1732 14.1787	71 L	14.1732 14.1	823 107 L	14.1729 14.1743	27 L	
370	14.5669 14.5654	14.5670 14.5705	0 L	14.5669 14.5724	0 L	14.5670 14.5	761 0 L	14.5666 14.5681	3 T	
380	14.9606 14.9590	14.9606 14.9641		14.9606 14.9661		14.9606 14.9	697	14.9603 14.9617		
400	15.7480 15.7464	15.7480 15.7515		15.7480 15.7535		15.7480 15.7	571	15.7477 15.7491		
420	16.5354 16.5336	16.5354 16.5392	5	16.5354 16.5415		16.5354 16.5		16.5351 16.5367	24.	
440	17.3228 17.3210	17.3228 17.3266	56 L	17.3228 17.3289	79 L	17.3228 17.3		17.3225 17.3241	31 L	
460	18.1102 18.1084	18.1102 18.1140	0 L	18.1102 18.1163	0 L	18.1102 18.1		18.1099 18.1115	3 T	
480	18.8976 18.8958	18.8976 18.9014		18.8976 18.9037		18.8976 18.9		18.8973 18.8989		
500	19.6850 19.6832	19.6850 19.6888		19.6850 19.6911		19.6850 19.6	948	19.6847 19.6863		
520	20.4724 20.4704	20.4724 20.4767		20.4724 20.4793		20.4724 20.4	834	20.4721 20.4739		
540	21.2598 21.2578	21.2598 21.2641		21.2598 21.2667		21.2598 21.2		21.2595 21.2613		
560	22.0472 22.0452	22.0472 22.0515	63 L	22.0472 22.0541	89 L		582 130 L	22.0469 22.0487	35 L	
580	22.8346 22.8326	22.8346 22.8389	0 L	22.8346 22.8415	0 L	22.8346 22.8		22.8343 22.8361	37 T	
600	23.6220 23.6200	23.6220 23.6263	O L	23.6220 23.6289	O L		330	23.6217 23.6235	31	
620	24.4094 24.4074	24.4094 24.4137		24.4094 24.4163			204	24.4091 24.4109		
020	24.4074 24.4074	24.4074 24.4137		24.4074 24.4103		24.4074 24.4	204	24.4071 24.4107		
650	25.5906 25.5876	25.5906 25.5955		25.5906 25.5985		25.5906 25.6	032	25.5902 25.5922		
670	26.3780 26.3750	26.3780 26.3829		26.3780 26.3859		26.3780 26.3	906	26.3776 26.3796		
680	26.7717 26.7687	26.7717 26.7766		26.7717 26.7796		26.7717 26.7	843	26.7713 26.7733		
700	27.5591 27.5561	27.5591 27.5640		27.5591 27.5670		27.5591 27.5	717	27.5587 27.5607		
720	28.3465 28.3435	28.3465 28.3514	79 L	28.3465 28.3544	109 L	28.3465 28.3	591 156 L	28.3461 28.3481	46 L	
750	29.5276 29.5246	29.5276 29.5325	0 L	29.5276 29.5355	0 L	29.5276 29.5	402 0 L	29.5272 29.5292	4 T	
760	29.9213 29.9183	29.9213 29.9262		29.9213 29.9292		29.9213 29.9	339	29.9209 29.9229		
780	30.7087 30.7057	30.7087 30.7136		30.7087 30.7166		30.7087 30.7	213	30.7083 30.7103		
790	31.1024 31.0994	31.1024 31.1073		31.1024 31.1103		31.1024 31.1	150	31.1020 31.1040		
800	31.4961 31.4931	31.4961 31.5010		31.4961 31.5040		31.4961 31.5	087	31.4957 31.4968		
020	22 2025 22 2707	22 2025 22 2000		22 2025 22 2027		22 2025 22 2	077	22 2024 22 2052		
820	32.2835 32.2796	32.2835 32.3890		32.2835 32.2926		32.2835 32.2		32.2831 32.2853		
830	32.6772 32.6733	32.6772 32.6827		32.6772 32.6863		32.6772 32.6		32.6768 32.6790		
850	33.4646 33.4607	33.4646 33.4701	0/ 1	33.4646 33.4737	1201	33.4646 33.4		33.4642 33.4664	F7.	
870	34.2520 34.2481	34.2520 34.2575	94 L	34.2520 34.2611	130 L		662 181 L	34.2516 34.2538	57 L	
920	36.2205 36.2166	36.2205 36.2260	0 L	36.2205 36.2296	0 L	36.2205 36.2		36.2201 36.2223	4 T	
950	37.4016 37.3977	37.4016 37.4071		37.4016 37.4107		37.4016 37.4		37.4012 37.4034		
980	38.5827 38.5788	38.5827 38.5882		38.5827 38.5918			969	38.5823 38.5845		
1000	39.3701 39.3662	39.3701 39.3756		39.3701 39.3792		39.3701 39.3	843			
1150	45.2756 45.2707	45.2756 45.2821	114 L	45.2756 45.2858	151 L	45.2756 45.2	921 214 L			
1250	49.2126 49.2077	49.2126 49.2191	0 L	49.2126 49.2228	0 L	49.2126 49.2				
1400	55.1181 55.1118	55.1181 55.1258	140 L	55.1181 55.1303	185 L		378 260 L			
1600	62.9921 62.9858	62.9921 62.9998	0 L	62.9921 63.0043	0 L	62.9921 63.0	118 OL			
1800	70.8661 70.8582	70.8661 70.8752	170 L	70.8661 70.8807	225 L	70.8661 70.8	897 315 L			
2000	78.7402 78.7323	78.7402 78.7493	0 L	78.7402 78.7548	0 L	78.7402 78.7				
	. 5 52 7 6.7 525	75.7.52 75.7475	0 2	. 5.7.152 75.7540			-30			
2300	90.5512 90.5414	90.5512 90.5622	208 L	90.5512 90.5685	271 L	90.5512 90.5	788 374 L			
2500	98.4252 98.4154	98.4252 98.4362	0 L	98.4252 98.4425	0 L	98.4252 98.4	528 0 L			

Note: To convert inches to mm, multiply inches by 25.4

¹⁾ L indicates "LOOSE" fit, T indicates "TIGHT" fit

														Table 9
	bearing-seat	diameters	(values in ir	•			ICE			I/F		1	1//	
	ring outside			J7	Desultant		JS5	Desultant		K5	Dagultant		K6	Daguilta
(diameter		Hamai		Resultant fit ¹⁾ in	Harris	6	Resultant fit ¹⁾ in			Resultant fit ¹⁾ in	Harris	ar la serie	Resulta fit ¹⁾ ir
	inch			ing bore			ng bore		Housin	~			ig bore	
mm	max.	min.	min.	max.	0.0001"	min.	max.	0.0001"	min.	max.	0.0001"	min.	max.	0.0001
16	0.6299	0.6296	0.6296	0.6303	7 L 3 T	0.6297	0.6301	2 T 5 L	0.6297	0.6300	4 L 2 T	0.6295	0.6300	4 L 4 T
19	0.7480	0.7476	0.7476	0.7485		0.7478	0.7481		0.7477	0.7480		0.7476	0.7481	
22	0.8661	0.8657	0.8657	0.8666		0.8659	0.8662		0.8658	0.8661		0.8657	0.8662	
24	0.9449	0.9445	0.9445	0.9454	9 L	0.9447	0.9450	2T	0.9446	0.9449	4 L	0.9445	0.9450	5 L
26	1.0236	1.0232	1.0232	1.0241	4 T	1.0234	1.0237	5 L	1.0233	1.0236	3 T	1.0232	1.0237	4 T
28	1.1024	1.1020	1.1020	1.1029		1.1022	1.1025		1.1021	1.1024		1.1020	1.1025	
30	1.1811	1.1807	1.1807	1.1816		1.1809	1.1812		1.1808	1.1811		1.1807	1.1812	
32	1.2598	1.2594	1.2594	1.2604		1.2596	1.2600		1.2594	1.2599		1.2593	1.2599	
35	1.3780	1.3776	1.3776	1.3786		1.3778	1.3782		1.3776	1.3781		1.3775	1.3781	
37	1.4567	1.4563	1.4563	1.4573	10 L	1.4565	1.4569	2T	1.4563	1.4568	5 L	1.4562	1.4568	5 L
40	1.5748	1.5744	1.5744	1.5754	4 T	1.5746	1.5750	6 L	1.5744	1.5749	4 T	1.5743	1.5749	5 T
42	1.6535	1.6531	1.6531	1.6541		1.6533	1.6537		1.6531	1.6536		1.6530	1.6536	
47	1.8504	1.8500	1.8500	1.8510		1.8502	1.8506		1.8500	1.8505		1.8499	1.8505	
52	2.0472	2.0467	2.0467	2.0479		2.0469	2.0475		2.0468	2.0473		2.0466	2.0474	
55	2.1654	2.1649	2.1649	2.1661		2.1651	2.1657		2.1650	2.1655		2.1648	2.1656	
62	2.4409	2.4404	2.4404	2.4416	12 L	2.4406	2.4412	3 T	2.4405	2.4410	6 L	2.4403	2.4411	7 L
68	2.6772	2.6767	2.6767	2.6779	5 T	2.6769	2.6775	8 L	2.6768	2.6773	4 T	2.6766	2.6774	6 T
72	2.8346	2.8341	2.8341	2.8353		2.8343	2.8349	0 2	2.8342	2.8347	7.	2.8340	2.8348	0 1
75	2.9527	2.9522	2.9522	2.9534		2.9524	2.9530		2.9523	2.9528		2.9521	2.9529	
80	3.1496	3.1491	3.1491	3.1503		3.1493	3.1499		3.1492	3.1497		3.1490	3.1498	
85	3.3465	3.3459	3.3460	3.3474		3.3462	3.3468		3.3460	3.3466		3.3458	3.3467	
90	3.5433	3.5427	3.5428	3.5442		3.5430	3.5436		3.5428	3.5434		3.5426	3.5435	
95	3.7402	3.7396	3.7397	3.7411		3.7399	3.7405		3.7397	3.7403		3.7395	3.7404	
100	3.9370	3.9364	3.9365	3.9379	15 L	3.9367	3.9373	3 T	3.9365	3.9371	7 L	3.9363	3.9372	8 L
110	4.3307	4.3301	4.3302	4.3316	5 T	4.3304	4.3310	9 L	4.3302	4.3308	5 T	4.3300	4.3309	7 T
115	4.5276	4.5270	4.5271	4.5285		4.5273	4.5279		4.5271	4.5277		4.5269	4.5278	
120	4.7244	4.7238	4.7239	4.7253		4.7241	4.7247		4.7239	4.7245		4.7237	4.7246	
125	4.9213	4.9206	4.9207	4.9223		4.9209	4.9217		4.9207	4.9214		4.9205	4.9215	
130	5.1181	5.1174	5.1175	5.1191		5.1177	5.1185		5.1175	5.1182		5.1173	5.1183	
140	5.5118	5.5111	5.5112	5.5128	17 L	5.5114	5.5122	4 T	5.5112	5.5119	8 L	5.5110	5.5120	9 L
145	5.7087	5.7080	5.7081	5.7097	6 T	5.7083	5.7091	11 L	5.7081	5.7088	6 T	5.7079	5.7089	8T
150	5.9055	5.9048	5.9049	5.9065		5.9051	5.9059		5.9049	5.9056		5.9047	5.9057	
160	6.2992	6.2982	6.2986	6.3002		6.2988	6.2995		6.2986	6.2993		6.2984	6.2994	
165	6.4961	6.4951	6.4955	6.4971	20 L	6.4957	6.4964	4 T	6.4955	6.4962	11 L	6.4953	6.4963	12 L
170	6.6929	6.6919	6.6923	6.6939	6 T	6.6925	6.6932	13 L	6.6923	6.6930	6 T	6.6921	6.6931	8 T
180	7.0866	7.0856	7.0860	7.0876		7.0862	7.0869		7.0860	7.0867		7.0858	7.0868	
190	7.4803	7.4791	7.4797	7.4815		7.4799	7.4807		7.4796	7.4804		7.4794	7.4805	
200	7.8740	7.8728	7.8734	7.8752		7.8736	7.8744		7.8733	7.8741		7.8731	7.8742	
210	8.2677	8.2665	8.2671	8.2689		8.2673	8.2681		8.2670	8.2678		8.2668	8.2679	
215	8.4646	8.4634	8.4640	8.4658	24 L	8.4642	8.4650	4 T	8.4639	8.4647	13 L	8.4637	8.4648	14 L
220	8.6614	8.6602	8.6608	8.6626	6 T	8.6610	8.6618	16 L	8.6607	8.6615	7 T	8.6605	8.6616	9 T
225	8.8583	8.8571	8.8577	8.8595		8.8579	8.8587		8.8576	8.8584		8.8574	8.8585	
230	9.0551	9.0539	9.0545	9.0563		9.0547	9.0555		9.0544	9.0552		9.0542	9.0553	
240	9.4488	9.4476	9.4482	9.4500		9.4484	9.4492		9.4481	9.4489		9.4479	9.4490	
250	9.8425	9.8413	9.8419	9.8437		9.8421	9.8429		9.8418	9.8426		9.8416	9.8427	

Note: To convert inches to mm, multiply inches by 25.4 $^{1)}\, L$ indicates "LOOSE" fit, T indicates "TIGHT" fit

Table 9

					٠
Housing	hearing	-seat diameters	(value)	s in inches	١

Housing													
Bea	aring outside	9		J7	I		JS5			K5	1	K6	
	diameter				Resultant			Resultant			Resultant		Resultant
	ind	ches	Hous	ing bore	fit ¹⁾ in	Housi	ng bore	fit ¹⁾ in	Housin	g bore	fit ¹⁾ in	Housing bore	fit ¹⁾ in
mm	max.	min.	min.	max.	0.0001"	min.	max.	0.0001"	min.	max.	0.0001"	min. max.	0.0001"
260	10.2362	10.2348	10.2356	10.2376		10.2357	10.2366		10.2354	10.2363		10.2351 10.2364	
270	10.6299	10.6285	10.6293				10.6303		10.6291	10.6300		10.6288 10.6301	
280	11.0236	11.0222	11.0230		28 L		11.0240	5 T	11.0228	11.0237	15 L	11.0225 11.0238	16 L
290	11.4173	11.4159	11.4167		6T	11.4168		18 L	11.4165	11.4174	8T	11.4162 11.4175	11 T
300	11.4173	11.8096	11.4107		01	11.4105		10 L	11.4103	11.4174	01	11.8099 11.8112	111
310	12.2047	12.2033	12.2041				12.2051		12.2039	12.2048		12.2036 12.2049	
310	12.2047	12.2033	12.2041	12.2001		12.2042	12.2031		12.2039	12.2040		12.2030 12.2049	
320	12.5984	12.5968	12.5977	12.5999		12.5979	12.5989		12.5975	12.5985		12.5973 12.5986	
340	13.3858	13.3842	13.3851	13.3873		13.3853	13.3863		13.3849	13.3859		13.3847 13.3860	
360	14.1732	14.1716	14.1725	14.1747	31 L	14.1727	14.1737	5 T	14.1723	14.1733	17 L	14.1721 14.1734	19 L
370	14.5669	14.5654	14.5662		7 T		14.5675	21 L	14.5660	14.5670	9 T	14.5658 14.5672	11 T
380	14.9606	14.9590	14.9599			14.9601			14.9597	14.9607		14.9595 14.9608	
400	15.7480	15.7464	15.7473				15.7485		15.7471	15.7481		15.7469 15.7482	
	2011 100		2017 170	1017 170		1017 170	1017 100		1017 171	1017 101		2017 107 2017 102	
420	16.5354	16.5336	16.5346	16.5371		16.5349	16.5359		16.5344	16.5355		16.5341 16.5356	
440	17.3228	17.3210	17.3220	17.3245	35 L	17.3223	17.3233	5 T	17.3218	17.3229	19 L	17.3215 17.3230	21 L
460	18.1102	18.1084	18.1094	18.1119	8T	18.1097	18.1107	23 L	18.1092	18.1103	10 T	18.1089 18.1104	13 T
480	18.8976	18.8958	18.8968	18.8993		18.8971	18.8981		18.8966	18.8977		18.8963 18.8978	
500	19.6850	19.6832	19.6842	19.6867		19.6845	19.6855		19.6840	19.6851		19.6837 19.6852	
520	20.4724	20.4704	20.4715			-	-		_	-		20.4707 20.4724	
540	21.2598	21.2578		21.2617		-	-		-	-		21.2581 21.2598	
560	22.0472	22.0452	22.0463	22.0491	39 L	-	-		-	-		22.0455 22.0472	20 L
580	22.8346	22.8326	22.8337	22.8365	9 T	-	-		-	-		22.8329 22.8346	17 T
600	23.6220	23.6200	23.6211	23.6239		-	-		-	-		23.6203 23.6220	
620	24.4094	24.4074	24.4085	24.4113		-	-		-	-		24.4077 24.4094	
(FO	25 5007	25 507/	25 5007	25.5928								25.5886 25.5906	
650	25.5906	25.5876				_	_		_	_			
670	26.3780	26.3750		26.3802		_	_		_	_		26.3760 26.3780	
680	26.7717	26.7687		26.7739		_	-		_	-		26.7697 26.7717	
700	27.5591	27.5561	27.5582			_	-		_	-		27.5571 27.5591	
720	28.3465	28.3435	28.3456		52 L	-	-		-	-		28.3445 28.3465	30 L
750	29.5276	29.5246	29.5267		9 T	-	-		_	-		29.5256 29.5276	20 T
760	29.9213	29.9183	29.9204			-	-		-	-		29.9193 29.9213	
780	30.7087	30.7057	30.7078			-	-		-	-		30.7067 30.7087	
790	31.1024	31.0994		31.1046		-	-		-	-		31.1004 31.1024	
800	31.4961	31.4931	31.4952	31.4974		-	-		-	-		31.4941 31.4952	
920	22 2025	22 2704	32.2825	22.2040								22 2012 22 2025	
820 830	32.2835 32.6772	32.2796 32.6733	32.2825			_			_	_		32.2813 32.2835 32.6750 32.6772	
						_	_		_	_			
850	33.4646	33.4607		33.4671	(/)	_	_		_	_		33.4624 33.4646	20.1
870	34.2520	34.2481	34.2510		64 L	_	_		_	-		34.2498 34.2520	39 L
920	36.2205	36.2166	36.2195		10 T	_	_		_	_		36.2183 36.2205	22 T
950	37.4016	37.3977	37.4006			_	_		_	-		37.3994 37.4016	
980	38.5827	38.5788		38.5852		-	-		-	-		38.5805 38.5827	
1000	39.3701	39.3662	-	-		-	-		-	-			
1150	45.2756	45.2707	_	_	_	_		_	_		_	-	
1250	49.2126	49.2077	_	_	_	_		_	_		_	_	
1230	77.2120	77.2077									_		
1400	55.1181	55.1118	-	-	-	-		-	-		-	-	
1600	62.9921	62.9858	-	-	-	-		-	-		-	-	
4655	70.5111	70.6555											
1800	70.8661	70.8582	-	-	_	_		-	-		-	-	
2000	78.7402	78.7323	-	-	-	-		-	-		-	-	
2300	90.5512	90.5414	_	_	_	_		_	_		_	_	
2500		98.4154	_	_	_	_		_	_		_	_	
2300	70.7232	70.7137											

Note: To convert inches to mm, multiply inches by $25.4\,$

¹⁾ L indicates "LOOSE" fit, T indicates "TIGHT" fit

														Table 9
Housing I	bearing-seat	diameters	(values in i	nches)										
Bear	ring outside			K7			M5	_		M6	_		M7	
C	diameter				Resultant			Resultant			Resultant			Resultant
	inch	es	Hous	ing bore	fit ¹⁾ in	Housir	ng bore	fit ¹⁾ in	Housin	g bore	fit ¹⁾ in	Housin	g bore	fit ¹⁾ in
mm	max.	min.	min.	max.	0.0001"									
16	0.6299	0.6296	0.6294	0.6301	5 L 5 T	0.6294	0.6298	2 L 5 T	0.6293	0.6297	1 L 6 T	0.6292	0.6299	3 L 7 T
19 22 24 26 28	0.7480 0.8661 0.9449 1.0236 1.1024	0.7476 0.8657 0.9445 1.0232 1.1020	0.7474 0.8655 0.9443 1.0230 1.1018	0.7482 0.8663 0.9451 1.0238 1.1026	6 L 6 T	0.7474 0.8655 0.9443 1.0230 1.1018	0.7478 0.8659 0.9447 1.0234 1.1022	2 L 6 T	0.7473 0.8654 0.9442 1.0229 1.1017	0.7478 0.8659 0.9447 1.0234 1.1022	2 L 7 T	0.7472 0.8653 0.9441 1.0228 1.1016	0.7480 0.8661 0.9449 1.0236 1.1024	4 L 8 T
30 32 35 37 40 42 47	1.1811 1.2598 1.3780 1.4567 1.5748 1.6535 1.8504	1.2594 1.3776 1.4563 1.5744 1.6531 1.8500	1.2591 1.3773 1.4560 1.5741 1.6528 1.8497	1.1813 1.2601 1.3783 1.4570 1.5751 1.6538 1.8507	7 L 7 T	1.1805 1.2592 1.3774 1.4561 1.5742 1.6529 1.8498	1.1809 1.2596 1.3778 1.4565 1.5746 1.6533 1.8502	2 L 6 T	1.1804 1.2590 1.3772 1.4559 1.5740 1.6527 1.8496	1.1809 1.2596 1.3778 1.4565 1.5746 1.6533 1.8502	2 L 8 T	1.1803 1.2588 1.3770 1.4557 1.5738 1.6525 1.8494	1.1811 1.2598 1.3780 1.4567 1.5748 1.6535 1.8504	4 L 10 T
52 55 62 68 72 75 80	2.0472 2.1654 2.4409 2.6772 2.8346 2.9527 3.1496	2.0467 2.1649 2.4404 2.6767 2.8341 2.9522 3.1491	2.0464 2.1646 2.4401 2.6764 2.8338 2.9519 3.1488	2.0476 2.1658 2.4413 2.6776 2.8350 2.9531 3.1500	9 L 8 T	2.0465 2.1647 2.4402 2.6765 2.8339 2.9520 3.1489	2.0470 2.1652 2.4407 2.6770 2.8344 2.9525 3.1494	3 L 7 T	2.0463 2.1645 2.4400 2.6763 2.8337 2.9518 3.1487	2.0470 2.1652 2.4407 2.6770 2.8344 2.9525 3.1494	3 L 9 T	2.0460 2.1642 2.4397 2.6760 2.8334 2.9516 3.1484	2.0472 2.1654 2.4409 2.6772 2.8346 2.9528 3.1496	5 L 12 T
85 90 95 100 110 115 120	3.3465 3.5433 3.7402 3.9370 4.3307 4.5276 4.7244	3.3459 3.5427 3.7396 3.9364 4.3301 4.5270 4.7238	3.3455 3.5423 3.7392 3.9360 4.3297 4.5266 4.7234	3.3469 3.5437 3.7406 3.9374 4.3311 4.5280 4.7248	10 L 10 T	3.3456 3.5424 3.7393 3.9361 4.3298 4.5267 4.7235	3.3462 3.5430 3.7399 3.9367 4.3304 4.5273 4.7241	3 L 9 T	3.3454 3.5422 3.7391 3.9359 4.3296 4.5265 4.7233	3.3463 3.5431 3.7400 3.9368 4.3305 4.5274 4.7242	4 L 11 T	3.3451 3.5419 3.7388 3.9356 4.3293 4.5262 4.7230	3.3465 3.5433 3.7402 3.9370 4.3307 4.5276 4.7244	6 L 14 T
125 130 140 145 150	4.9213 5.1181 5.5118 5.7087 5.9055	4.9206 5.1174 5.5111 5.7080 5.9048	4.9202 5.1170 5.5107 5.7076 5.9044	4.9218 5.1186 5.5123 5.7092 5.9060	12 L 11 T	4.9202 5.1170 5.5107 5.7076 5.9044	4.9210 5.1178 5.5115 5.7084 5.9052	4 L 11 T	4.9200 5.1168 5.5105 5.7074 5.9042	4.9210 5.1178 5.5115 5.7084 5.9052	4 L 13 T		4.9213 5.1181 5.5118 5.7087 5.9055	7 L 16 T
160 165 170 180	6.2992 6.4961 6.6929 7.0866	6.2982 6.4951 6.6919 7.0856	6.2981 6.4950 6.6918 7.0855	6.2997 6.4966 6.6934 7.0871	15 L 11 T	6.2981 6.4950 6.6918 7.0855	6.2988 6.4957 6.6925 7.0862	6 L 11 T	6.2979 6.4948 6.6916 7.0853	6.2989 6.4958 6.6926 7.0863	7 L 13 T	6.2976 6.4945 6.6913 7.0850	6.2992 6.4961 6.6929 7.0866	10 L 16 T
190 200 210 215 220 225	7.4803 7.8740 8.2677 8.4646 8.6614 8.8583	7.4791 7.8728 8.2665 8.4634 8.6602 8.8571	7.4790 7.8727 8.2664 8.4633 8.6601 8.8570	7.4808 7.8745 8.2682 8.4651 8.6619 8.8588	17 L 13 T	7.4791 7.8728 8.2665 8.4634 8.6602 8.8571	7.4798 7.8735 8.2672 8.4641 8.6609 8.8578	7 L 12 T	7.4788 7.8725 8.2662 8.4631 8.6599 8.8568	7.4800 7.8737 8.2674 8.4643 8.6611 8.8580	9 L 15 T	7.4785 7.8722 8.2659 8.4628 8.6596 9.0571	7.4803 7.8740 8.2677 8.4646 8.6614 8.8583	12 L 18 T

Note: To convert inches to mm, multiply inches by 25.4

9.0539

9.4476

9.8413

9.0538

9.4475

9.8412

9.0556

9.4493

9.8430

230

240

250

9.0551

9.4488

9.8425

76 **SKF**

9.0546

9.4483

9.8420

9.0548

9.4485

9.8422

9.0536

9.4473

9.8410

9.0533 9.0551

9.8407 9.8425

9.4488

9.4470

9.0539

9.4476

9.8413

 $^{^{1)}\,}L$ indicates "LOOSE" fit, T indicates "TIGHT" fit

Table 9

				. ,		
Ηr	nucina	hearing	ı-seat diame	tore Iva	liiec in	inchecl

Housing	bearing-sea	it diameters	(values in i	nches)									
Bea	aring outside	:		K7	1		M5			M6		M7	
	diameter				Resultant			Resultant			Resultant		Resultant
	inc	hes	Hous	ing bore	fit ¹⁾ in	Housir	ng bore	fit ¹⁾ in	Housin	g bore	fit ¹⁾ in	Housing bore	fit ¹⁾ in
mm	max.	min.	min.	max.	0.0001"	min.	max.	0.0001"	min.	max.	0.0001"	min. max.	0.0001"
260	10.2362	10.2348	10.2348	10.2368		10.2348	10.2357		10.2346	10.2364		10.2342 10.2362	
270	10.6299	10.6285	10.6285	10.6305		10.6285	10.6294		10.6283	10.6301		10.6279 10.6299	
280	11.0236	11.0222	11.0222	11.0242	20 L	11.0222		9 L	11.0220	11.0238	10 L	11.0216 11.0236	14 L
	11.0236			11.0242			11.0231		11.0220				
290		11.4159	11.4159		14 T	11.4159		14 T		11.4175	16 T	11.4153 11.4173	20 T
300	11.8110	11.8096	11.8096	11.8116			11.8105		11.8094	11.8112		11.8090 11.8110	
310	12.2047	12.2033	12.2033	12.2053		12.2033	12.2042		12.2031	12.2049		12.2027 12.2047	
320	12.5984	12.5968	12.5968	12.5991		12.5969	12.5978		12.5966	12.5986		12.5962 12.5984	
340	13.3858	13.3842	13.3842	13.3865		13.3843	13.3852		13.3840	13.3860		12.3836 12.3858	
360	14.1732	14.1716	14.1716	14.1739	23 L		14.1726	10 L	14.1714	14.1734	12 L	14.1710 14.1732	16 L
370	14.5669	14.5654	14.5653	14.5677	16 T	14.5654	14.5664	15 T	14.5651	14.5672	18 T	14.5647 14.5669	22 T
380	14.9606	14.9590	14.9590	14.9613		14.9591	14.9600		14.9588	14.9608		14.9584 14.9606	
400	15.7480	15.7464	15.7464	15.7487		15.7465	15.7474		15.7462	15.7482		15.7458 15.7480	
	2017 100		10.7 10 1	2017 107		10.7 100	2017 17 1		1017 102	1017 102		10.7 100 10.7 100	
420	16.5354	16.5336	16.5336	16.5361		16.5337	16.5347		16.5334	16.5356		16.5329 16.5354	
440	17.3228	17.3210	17.3210	17.3235	25 L	17.3211	17.3221	11 L	17.3208	17.3230	14 L	17.3203 17.3228	18 L
460	18.1102	18.1084	18.1084	18.1109	18 T	18.1085	18.1095	17 T	18.1082	18.1104	20 T	18.1077 18.1102	25 T
480	18.8976	18.8958	18.8958	18.8983		18.8959	18.8969		18.8956	18.8978		18.8951 18.8976	
500	19.6850	19.6832	19.6832	19.6857		19.6833	19.6843		19.6830	19.6852		19.6825 19.6850	
520	20.4724	20.4704	20.4696	20.4724		-	-		20.4696	20.4714		20.4686 20.4714	
540	21.2598	21.2578	21.2570	21.2598		-	-		21.2570	21.2588		21.2560 21.2588	
560	22.0472	22.0452	22.0444	22.0472	20 L	-	-		22.0444	22.0462	10 L	22.0435 22.0462	10 L
580	22.8346	22.8326	22.8318	22.8346	28 T	-	-		22.8318	22.8336	28 T	22.8308 22.8336	38 T
600	23.6220	23.6200	23.6192	23.6220		-	-		23.6192	23.6210		23.6182 23.6210	
620	24.4094	24.4074	24.4066	24.4094		-	-		24.4066	24.4084		24.4056 24.4084	
650	25.5906	25.5876	25.5875	25.5906		_			25.5875	25.5894		25.5863 25.5894	
670	26.3780	26.3750	26.3749	26.3780					26.3749	26.3768		26.3737 26.3768	
680	26.7717	26.7687	26.7686	26.7717		_	_		26.7686	26.7705		26.7674 26.7705	
700	27.5591	27.5561	27.5560	27.5591		_	_		27.5560	27.5579		27.5548 27.5579	
700	28.3465	28.3435	28.3434	28.3465	30 L	_	_		28.3434	28.3453	18 L	28.3422 28.3453	18 L
750	29.5276		29.5245	29.5276	30 L 31 T	_	_		29.5245	29.5264	31 T	29.5233 29.5264	43 T
		29.5246			311	_	_				311		45 1
760	29.9213	29.9183	29.9182	29.9213		-	_		29.9182	29.9201		29.9169 29.9201	
780	30.7087	30.7057	30.7056	30.7087		_	_		30.7056	30.7075		30.7044 30.7075	
790	31.1024	31.0994	31.0993	31.1024		_	_		31.0993	31.1012		31.0981 31.1012	
800	31.4961	31.4931	31.4930	31.4952		_	-		31.4930	31.4940		31.4917 31.4949	
820	32.2835	32.2796	32.2800	32.2835		-	-		32.2800	32.2822		32.2786 32.2822	
830	32.6772	32.6733	32.6737			_	_			32.6759		32.6723 32.6758	
850	33.4646	33.4607		33.4646		_	_			33.4633		33.4597 33.4633	
870	34.2520	34.2481		34.2520	39 L	_	_		34.2485		26 L	34.2471 34.2507	26 L
920	36.2205	36.2166		36.2205	35 T	_	_			36.2192	35 T	36.2156 36.2192	49T
950	37.4016	37.3977		37.4016		_	_			37.4003		37.3967 37.4003	
980	38.5827	38.5788		38.5827		_	_			38.5814		38.5778 38.5814	
1000	39.3701	39.3662	-	-		_	_		-	-		39.3652 39.3688	
1150	45.2756	45.2707	-	-		-	-		-	-		45.2699 45.2740	33 L
1250	49.2126	49.2077	-	-		-	-		-	-		49.2069 49.2110	57 T
1/00	EE 1101	EE 1110										EE 1112 EE 11/2	67.1
1400		55.1118	_	_		_	_		_	_		55.1113 55.1162	44 L
1600	62.9921	62.9858	_	-		-	-		-	_		62.9853 62.9902	68 T
1800	70.8661	70.8582	_	-		_	_		-	_		70.8579 70.8638	56 L
2000	78.7402	78.7323	_	_		_	_		_	_		78.7320 78.7379	82 T
2300	90.5512	90.5414	-	-		-	-		-	-		90.5416 90.5485	71 L
2500	98.4252	98.4154	-	-		-	-		-	-		98.4156 98.4225	96 T
			•		•								

Note: To convert inches to mm, multiply inches by 25.4

 $^{^{1)}}$ L indicates "LOOSE" fit, T indicates "TIGHT" fit

Tab	le	9

Housing bearing-seat diameters	(values in inches)
--------------------------------	--------------------

Housing	Housing bearing-seat diameters (values in inches) Bearing outside N6 N7 P6 P7												
	•		N6	ı		N7			P6	1		P7	
	diameter 	.		Resultant			Resultant			Resultant			Resultant
	inches .		ing bore	fit ¹⁾ in	Housing		fit ¹⁾ in	Housin	•	fit ¹⁾ in	Housin		fit ¹⁾ in
mm	max. min.	min.	max.	0.0001"									
				1T			1 L			3 T			1T
16	0.6299 0.6296	0.6291	0.6295	8T	0.6290	0.6297	9 T	0.6289	0.6293	10 T	0.6288	0.6295	11 T
19	0.7480 0.7476	0.7471	0.7476		0.7469	0.7477		0.7468	0.7473		0.7466	0.7474	
22	0.8661 0.8657	0.8652	0.8657		0.8650	0.8658		0.8649	0.8654		0.8647	0.8655	
24	0.9449 0.9445	0.9440	0.9445	0 T	0.9438	0.9446	1 L	0.9437	0.9442	3 T	0.9435	0.9443	2 T
26	1.0236 1.0232	1.0227	1.0232	9 T	1.0225	1.0233	11 T	1.0224	1.0229	12 T	1.0222	1.0230	14 T
28	1.1024 1.1020	1.1015	1.1020		1.1013	1.1021		1.1012	1.1017		1.1010	1.1018	
30	1.1811 1.1807	1.1802	1.1807		1.1800	1.1808		1.1799	1.1804		1.1797	1.1805	
32	1.2598 1.2594	1.2587	1.2593		1.2585	1.2595		1.2583	1.2590		1.2581	1.2591	
35	1.3780 1.3776	1.3769	1.3775		1.3767	1.3777		1.3765	1.3772		1.3763	1.3773	
37	1.4567 1.4563	1.4556	1.4562	1T	1.4554	1.4564	1 L	1.4552	1.4559	4 T	1.4550	1.4560	3 T
40	1.5748 1.5744	1.5737	1.5743	11 T	1.5735	1.5745	13 T	1.5733	1.5740	15 T	1.5731	1.5741	17 T
42	1.6535 1.6531	1.6524	1.6530		1.6522	1.6532		1.6520	1.6527		1.6518	1.6528	
47	1.8504 1.8500	1.8493	1.8499		1.8491	1.8501		1.8489	1.8496		1.8487	1.8497	
	0.0470	20150	20111		20:	20115		20:5:	20112		20:50	2611	
52	2.0472 2.0467	2.0459	2.0466		2.0457	2.0468		2.0454	2.0462		2.0452	2.0464	
55	2.1654 2.1649	2.1641	2.1648	4.7	2.1639	2.1650	4.1	2.1636	2.1644		2.1634	2.1646	2.7
62 68	2.4409 2.4404 2.6772 2.6767	2.4396 2.6759	2.4403 2.6766	1T 13T	2.4394 2.6760	2.4405 2.6770	1 L 15 T	2.4391 2.6750	2.4399 2.6760	5 T 18 T	2.4389 2.6752	2.4401 2.6763	3 T 20 T
72	2.8346 2.8341	2.8333	2.8340	131	2.8331	2.8342	151	2.8328	2.8336	101	2.8326	2.8338	20 1
75	2.9527 2.9522	2.9515	2.9522		2.9510	2.9520		2.9510	2.9520		2.9507	2.9519	
80	3.1496 3.1491	3.1483	3.1490		3.1481	3.1492		3.1478	3.1486		3.1476	3.1488	
85	3.3465 3.3459	3.3450	3.3459		3.3447	3.3461		3.3445	3.3453		3.3442	3.3456	
90	3.5433 3.5427	3.5418	3.5427		3.5415	3.5429		3.5413	3.5421		3.5410	3.5424	
95	3.7402 3.7396	3.7387	3.7396		3.7380	3.7400		3.7380	3.7390		3.7378	3.7392	
100	3.9370 3.9364	3.9355	3.9364	0T	3.9352	3.9366	2 L	3.9350	3.9358	6T	3.9347	3.9361	3 T
110 115	4.3307 4.3301 4.5276 4.5270	4.3292 4.5261	4.3301 4.5270	15 T	4.3289 4.5258	4.3303 4.5272	18 T	4.3287 4.5256	4.3295 4.5264	20 T	4.3284 4.5253	4.3298 4.5267	23 T
120	4.7244 4.7238	4.7229	4.7238		4.7226	4.7240		4.7224	4.7232		4.7221	4.7235	
	2.1		200		, 220			,			,		
125	4.9213 4.9206	4.9195	4.9205		4.9193	4.9208		4.9189	4.9199		4.9186	4.9202	
130	5.1181 5.1174	5.1163	5.1173		5.1161	5.1176		5.1157	5.1167		5.1154	5.1170	
140	5.5118 5.5111	5.5100	5.5110	1T	5.5098	5.5113	2 L	5.5094	5.5104	7 T	5.5091	5.5107	4 T
145	5.7087 5.7080	5.7069	5.7079	18 T	5.7067	5.7082	20 T	5.7063	5.7073	24 T	5.7060	5.7076	27 T
150	5.9055 5.9048	5.9037	5.9047		5.9035	5.9050		5.9031	5.9041		5.9028	5.9044	
160	6.2992 6.2982	6.2974	6.2984		6.2972	6.2987		6.2968	6.2978		6.2965	6.2981	
165	6.4961 6.4951	6.4943	6.4953	2 L	6.4940	6.4960	5 L	6.4940	6.4950	4 T	6.4934	6.4950	1T
170	6.6929 6.6919	6.6911	6.6921	18 T	6.6909	6.6924	20 T	6.6905	6.6915	24 T	6.6902	6.6918	27 T
180	7.0866 7.0856	7.0848	7.0858		7.0846	7.0861		7.0842	7.0852		7.0839	7.0855	
			_		_			_	_		_		
190	7.4803 7.4791	7.4783	7.4794		7.4779	7.4797		7.4775	7.4787		7.4772	7.4790	
200	7.8740 7.8728	7.8720	7.8731		7.8716	7.8734		7.8712	7.8724		7.8709	7.8727	
210 215	8.2677 8.2665	8.2657	8.2668	21	8.2653 8.4622	8.2671	4.1	8.2649	8.2661	/ T	8.2646	8.2664	1 T
215	8.4646 8.4634 8.6614 8.6602	8.4626 8.6594	8.4637 8.6606	3 L 20 T	8.4622 8.6590	8.4640 8.6610	6 L 24 T	8.4618 8.6590	8.4630 8.6600	4 T 28 T	8.4615 8.6583	8.4633 8.6601	1T 31T
225	8.8583 8.8571	8.8563	8.8574	201	8.8559	8.8577	Z+1	8.8555	8.8567	201	8.8552	8.8570	311
230	9.0551 9.0539	9.0531	9.0543		9.0530	9.0550		9.0520	9.0540		9.0520	9.0538	
240	9.4488 9.4476	9.4468	9.4479		9.4464	9.4482		9.4460	9.4472		9.4457	9.4475	
250	9.8425 9.8413	9.8405	9.8416		9.8401	9.8419		9.8397	9.8409		9.8394	9.8412	

Note: To convert inches to mm, multiply inches by 25.4 $^{1)}$ L indicates "LOOSE" fit, T indicates "TIGHT" fit

Table 9

	bearing-seat of		

	Housing bearing-seat diameter Bearing outside				1			ı			1		
Bea	-		N6			N7			P6	l		P7	
	diameter			Resultant			Resultant			Resultant			Resultant
	inches		ing bore	fit ¹⁾ in	Housin	g bore	fit ¹⁾ in		ig bore	fit ¹⁾ in	Housin	•	fit ¹⁾ in
mm	max. min.	min.	max.	0.0001"	min.	max.	0.0001"	min.	max.	0.0001"	min.	max.	0.0001"
260	10.2362 10.2348	10.2340	10.2352		10.2336	10.2356		10.2331	10.2343		10.2327	10.2348	
270	10.6299 10.6285	10.6277	10.6289		10.6270	10.6290		10.6270	10.6280		10.6265	10.6285	
280	11.0236 11.0222	11.0214	11.0226	4 L	11.0210	11.0230	8 L	11.0205	11.0217	5 T	11.0201	11.0222	0 T
290	11.4173 11.4159	11.4151	11.4163	22 T	11.4150	11.4170	26 T	11.4140	11.4150	31 T	11.4139	11.4159	35 T
300	11.8110 11.8096	11.8088	11.8100		11.8084	11.8104		11.8079	11.8091		11.8075	11.8096	
310	12.2047 12.2033	12.2025	12.2037		12.2021	12.2041		12.2016	12.2028		12.2012	12.2033	
320	12.5984 12.5968	12.5960	12.5974		12.5955	12.5978		12.5950	12.5964		12.5945	12.5968	
340	13.3858 13.3842	13.3834	13.3848		13.3829	13.3852	40.1	13.3824	13.3838		13.3819	13.3842	
360	14.1732 14.1716	14.1708	14.1722	6 L	14.1703	14.1726	10 L	14.1698	14.1712	4 T	14.1693	14.1716	0 T
370	14.5669 14.5654	14.5645	14.5659	24 T	14.5640	14.5660	29 T	14.5640	14.5650	34 T	14.5631	14.5653	39 T
380	14.9606 14.9590	14.9582	14.9596		14.9577	14.9600		14.9572	14.9586		14.9567	14.9590	
400	15.7480 15.7464	15.7456	15.7470		15.7451	15.7474		15.7446	15.7460		15.7441	15.7464	
420	16.5354 16.5336	16.5328	16.5343		16.5323	16.5347		16.5317	16.5332		16.5311	16.5336	
440	17.3228 17.3210	17.3202	17.3217	7 L	17.3197	17.3221	11 L	17.3191	17.3206	4 T	17.3185	17.3210	0 T
460	18.1102 18.1084	18.1076	18.1091	26 T	18.1071	18.1095	31 T	18.1065	18.1080	37 T	18.1059	18.1084	43 T
480	18.8976 18.8958	18.8950	18.8965		18.8945	18.8969		18.8939	18.8954		18.8933	18.8958	
500	19.6850 19.6832	19.6824	19.6839		19.6819	19.6843		19.6813	19.6828		19.6807	19.6832	
520	20.4724 20.4704	20.4689	20.4707		20.4679	20.4707		20.4676	20.4693		20.4666	20.4693	
540	21.2598 21.2578	21.2563	21.2581		21.2553	21.2581		21.2550	21.2567		21.2540	21.2567	
560	22.0472 22.0452	22.0438	22.0455	3 L	22.0430	22.0460	3 L	22.0420	22.0440	11 T	22.0414	22.0442	11 T
580	22.8346 22.8326	22.8311	22.8329	35 T	22.8301	22.8329	45 T	22.8298	22.8315	48 T	22.8288	22.8315	58T
600	23.6220 23.6200	23.6185	23.6203	331	23.6175	23.6203	451	23.6172	23.6189	401	23.6162	23.6189	30 1
620	24.4094 24.4074	24.4059	24.4077		24.4049	24.4077		24.4046	24.4063		24.4036	24.4063	
	24.4074 24.4074	24.4037	24.4077		24.4047	24.4077		24.4040	24.4003		24.4030	24.4003	
650	25.5906 25.5876	25.5867	25.5886		25.5855	25.5886		25.5852	25.5871		25.5840	25.5871	
670	26.3780 26.3750	26.3741	26.3760		26.3729	26.3760		26.3726	26.3745		26.3714	26.3745	
680	26.7717 26.7687	26.7678	26.7697		26.7666	26.7697		26.7663	26.7682		26.7651	26.7682	
700	27.5591 27.5561	27.5552	27.5571		27.5540	27.5571		27.5537	27.5556		27.5525	27.5556	
720	28.3465 28.3435	28.3426	28.3445	10 L	28.3414	28.3445	10 L	28.3411	28.3430	5 T	28.3399	28.3430	5 T
750	29.5276 29.5246	29.5237	29.5256	39 T	29.5225	29.5256	51 T	29.5222	29.5241	54 T	29.5210	29.5241	66 T
760	29.9213 29.9183	29.9173	29.9193		29.9160	29.9190		29.9160	29.9180		29.9146	29.9178	
780	30.7087 30.7057	30.7048	30.7067		30.7036	30.7077		30.7033	30.7052		30.7021	30.7052	
790	31.1024 31.0994	31.0985	31.1004		31.0973	31.1004		31.0970	31.0989		31.0958	31.0989	
800	31.4961 31.4931	31.4921	31.4941		31.4910	31.4940		31.4910	31.4930		31.4894	31.4926	
820	32.2835 32.2796	32.2791	32.2813		31.2778	32.2813		32.2774	32.2796		32.2760	32.2796	
830	32.6772 32.6733	32.6728	32.6750		32.6710	32.6750		32.6710	32.6730		32.6697	32.6732	
850	33.4646 33.4607	33.4602	33.4624		33.4589	33.4624		33.4585	33.4607		33.4571	33.4607	
870	34.2520 34.2481	34.2476	34.2498	17 L	34.2463	34.2498	17 L	34.2459	34.2481	0 T	34.2445	34.2481	0 T
920	36.2205 36.2166	36.2161	36.2183	44 T	36.2148	36.2183	57 T	36.2144	36.2166	61 T	36.2130	36.2166	75 T
950	37.4016 37.3977		37.3994		37.3959	37.3994		37.3955	37.3977		37.3941	37.3977	
980	38.5827 38.5788	38.5783			38.5770	38.5805		38.5766	38.5788		38.5752	38.5788	
1000	39.3701 39.3662	39.3657	39.3679		39.3644	39.3679		39.3640	39.3662		39.3626	39.3662	
1150	45.2756 45.2707	45.2704	45.2730	23 L	45.2689	45.2730	23 L	45.2683	45.2709	2 L	45.2667	45.2709	2 L
1250	49.2126 49.2077		49.2100	52 T	49.2059	49.2100	67 T	49.2053		73 T	40.2037		89 T
	FF 4404 FF 4460	FF 4430	FF 4450	221	FF 4404	FF 44 F0	22.1	FF 400F		0.1	FF 4077	FF 4424	0.1
1400	55.1181 55.1118		55.1150	32 L	55.1101	55.1150	32 L	55.1095	55.1126	8 L	55.1077	55.1126	8 L
1600	62.9921 62.9858	02.9860	62.9890	61 T	62.9841	62.9890	80 T	62.9835	62.9866	86 T	62.9817	62.9866	104 T
1800	70.8661 70.8582	70.8589	70.8625	43 L	70.8566	70.8625	43 L	70.8558	70.8594	12 L	70.8535	70.8594	12 L
2000	78.7402 78.7323	78.7330	78.7366	72 T	78.7307	78.7366	95 T	78.7299	78.7335	103 T	78.7276	78.7335	126T
2300	90.5512 90.5414	90 5425	90.5469	55 L	90.5400	90.5469	55 L	90.5392	90.5435	21 L	90.5366	90.5435	21 L
2500	98.4252 98.4154		98.4209	87 T		98.4209		98.4132		120 T		98.4175	
2300	70.7232 70.4134	70.7103	70.7207	5/	70.7140	70.7207	114	70.7132	,0.7113	1201	70.7100	,0.71/3	1701

Note: To convert inches to mm, multiply inches by 25.4

 $^{^{1)}}$ L indicates "LOOSE" fit, T indicates "TIGHT" fit


														Table 10
Limits	for ISO to	olerance g	grades fo	r dimens	sions									
Nomina dimensi		Toleran	ce grades											
over	incl.	IT0	IT1	IT2	IT3	IT4	IT5	IT6	IT7	IT8	IT9	IT10	IT11	IT12
mm		μm (0.0	001 mm)*											
1	3	0.5	0.8	1.2	2	3	4	6	10	14	25	40	60	100
3	6	0.6	1	1.5	2.5	4	5	8	12	18	30	48	75	120
6	10	0.6	1	1.5	2.5	4	6	9	15	22	36	58	90	150
10	18	0.8	1.2	2	3	5	8	11	18	27	43	70	110	180
18	30	1	1.5	2.5	4	6	9	13	21	33	52	84	130	210
30	50	1	1.5	2.5	4	7	11	16	25	39	62	100	160	250
50	80	1.2	2	3	5	8	13	19	30	46	74	120	190	300
80	120	1.5	2.5	4	6	10	15	22	35	54	87	140	220	350
120	180	2	3.5	5	8	12	18	25	40	63	100	160	250	400
180	250	3	4.5	7	10	14	20	29	46	72	115	185	290	460
250	315	4	6	8	12	16	23	32	52	81	130	210	320	520
315	400	5	7	9	13	18	25	36	57	89	140	230	360	570
400	500	6	8	10	15	20	27	40	63	97	155	250	400	630
500	630	-	-	-	-	-	28	44	70	110	175	280	440	700
630	800	-	-	-	-	-	32	50	80	125	200	320	500	800
800	1000	-	_	-	-	-	36	56	90	140	230	360	560	900
1000	1250	-	-	-	-	-	42	66	105	165	260	420	660	1,050
1250	1600	-	-	-	-	-	50	78	125	195	310	500	780	1,250
1600	2000	-	_	-	_	_	60	92	150	230	370	600	920	1,500
2000	2500	_	_	-	-	_	70	110	175	280	440	700	1,100	1,750

^{*}For values in inches, divide by 25.4

							Table 11
Shaft	tolerance	es for be	arings r	mounted o	n met	ric slee	ves
Shaft		Diame	eter and fo	orm toleranc	es		
Diamet	ter						
d .		h9		IT5/2	h10		IT7/2
Nomina		Deviat				ations	
over	incl.	high	low	max	high	low	max
mm		μm					
10	18	0	-43	4	0	-70	9
18	30	0	-52	4.5	0	-84	10.5
30	50	0	-62	5.5	0	-100	12.5
50	80	0	-74	6.5	0	-120	15
80	120	0	-87	7.5	0	-140	17.5
120	180	0	-100	9	0	-160	20
180	250	0	-115	10	0	-185	23
250	250 315	0	-115 -130	10 11.5	0	-185 -210	23 26
315	400	0	-130 -140	12.5	0	-210 -230	28.5
313	400	O	-140	12.5	U	-250	20.5
400	500	0	-155	13.5	0	-250	31.5
500	630	0	-175	14	0	-280	35
630	800	0	-200	16	0	-320	40
800	1 000	0	-230	18	0	-360	45
1 000	1 250	0	-260	21	0	-420	52.2

seatin d (D)	-		Diameter tolerance to								
over	incl.	IT7 μm (.001mi (μ in) (.000 l		IT5							
_	80	1.6 (63)	0.8 (32)	0.4 (16)							
80	500	1.6 (63)	1.6 (63)	0.8 (32)							
500	1250	3.2 (126)	1.6 (63)	1.6 (63)							

80 **5KF**

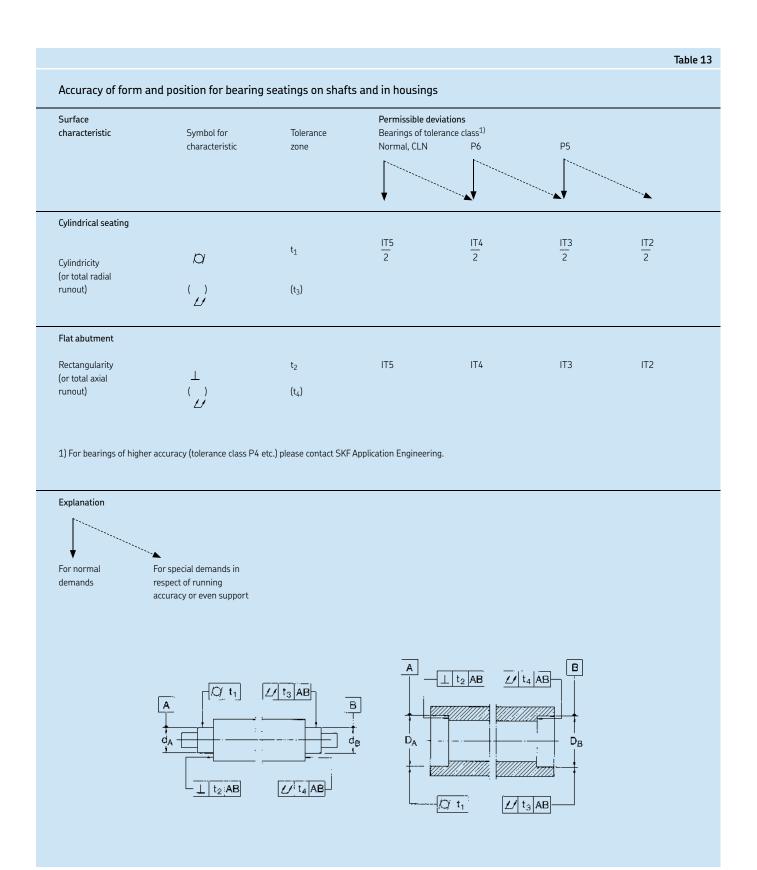

Shaft tolerances for standard inch size tapered roller bearings $^{1\ 2)}$

sizes and values in inches (classes 4 and 2)

Cone bore (Inner ring)	Shaft seat deviation fron	n minimum cone bore and the	resultant fit			
d	Rotating cone			Stationary cone		
u	moderate loads ³⁾ no shock	heavy loads ⁴⁾ or high speed or shock	heavy loads ⁴⁾ or high speed or shock	moderate loads ³⁾ no shock	wheel spindles	
over incl. tolerance	shaft seat resultant	shaft seat resultant	shaft seat resultant	shaft seat resultant	shaft seat resultant	
	deviation fit	deviation fit	deviation fit	deviation fit	deviation fit	
0 3 +0.0005	+0.0015 0.0005T	+0.0025 0.0010T	+0.0025 0.0010T	0 0.0010 L	-0.0002 0.0012 L	
0	+0.0010 0.0015T	+0.0015 0.0025T	+0.0015 0.0025T	- 0.0005 0	-0.0007 0.0002 L	
3 12 +0.0010	+0.0025 0.0005T	0.0005"/Inch	0.0005"/Inch	0 0.0020 L	- 0.0002 0.0022 L	
0	+0.0015 0.0025T	Bearing Bore	Bearing Bore	0.0010 0	- 0.0012 0.0002 L	
12 24 +0.0020 0	+0.0050 0.0010T +0.0030 0.0050T	Avg. Tight Fit	Avg. Tight Fit	0 0.0040 L - 0.0020 0		
24 36 +0.0030	+0.0075 0.0015T	+0.0150 0.0090T	+0.0150 0.0090T	0 0.0060 L		
0	+0.0045 0.0075T	+0.0120 0.0150T	+0.0120 0.0150T	- 0.0030 0		

¹⁾ For fitting practice for metric and J-prefix part number tapered roller bearings, see Table 15.

C is the basic load rating, P is the equivalent load. T indicates tight fit, L indicates loose fit. \geq equal or greater than. < less than.

					Table 15							
Housing tolerance for standard inch size tapered roller bearings ¹⁾ sizes and values in inches												
Cup O.D. (Outer ring) Housing seat deviation from minimum cup O.D. and the resultant fit												
D	Stationary cup			Rotating cup								
_	floating or clamped	adjustable	non-adjustable or in carriers	non-adjustable or in carriers, sheaves-clamped	sheaves-unclamped							
	housing	housing	housing	housing	housing							
over incl. tolerance	seat resultant deviation fit	seat resultant deviation fit	seat resultant deviation fit	seat resultant deviation fit	seat resultant deviation fit							
0 3 +0.0010	+0.0035	+0.0010 0.0010L	-0.0005 0.0005T	-0.0005 0.0005T	-0.0020 0.0020T							
0 3 5 +0.0010	+0.0020 0.0010L +0.0030 0.0030L	0 0.0010T +0.0010 0.0010L	-0.0015 0.0025T -0.0010 0.0010T	-0.0015 0.0015T -0.0010 0.0010T	-0.0030 0.0040T -0.0020 0.0020T							
0	+0.0020 0.0010L	0 0.0010T	-0.0020 0.0030T	-0.0020 0.0030T	-0.0030 0.0040T							
5 12 +0.0010	+0.0030 0.0030L	+0.0020 0.0020L	-0.0010 0.0010T	-0.0010 0.0010T	-0.0020 0.0020T							
0	+0.0020 0.0010L	0 0.0010T	-0.0020 0.0030T	-0.0020 0.0030T	-0.0030 0.0040T							
12 24 +0.0020	+0.0060 0.0060L	+0.0020 0.0030L	-0.0010 0.0010T	-0.0010 0.0010T	-0.0020 0.0020T							
0	+0.0040 0.0020L	+0.0010 0.0010T	-0.0030 0.0050T	-0.0030 0.0050T	-0.0040 0.0060T							
24 36 +0.0030	+0.0090 0.0090L	+0.0050 0.0050L	-0.0010 0.0010T	-0.0010 0.0010T								
0	+0.0060 0.0030L	+0.0020 0.0010T	-0.0040 0.0070T	-0.0040 0.0070T								

Recommended fits above are for cast iron or steel housing. For housings of light metal, tolerances are generally selected which give a slightly tighter fit than those in the table. 1) For fitting practice for metric and J-prefix part number tapered roller bearings, see Table 16. T indicates tight fit, L indicates loose fit.

 $²⁾ These \ recommendations \ not \ applicable \ to \ tapered \ bore \ cones. For \ recommendations, \ consult \ your \ SKF \ representative.$

 $^{3) \}frac{C}{P} \ge 8.3$ $4) \frac{C}{P} < 8.3$

Shaft tolerances for metric and J-prefix inch series tapered roller bearings¹⁾

ISO class normal and ABMA class \boldsymbol{K} and \boldsymbol{N}

values in inches

			Rotating co	one					Stationary	cone				
d			constant lo	pads ²⁾ with		heavy load	s ³⁾ or high		tension pul rope sheav moderate l	es		wheel spind		
			moderate	shock		speed or sl	nock		no shock			no shock		
over in mm	incl. in mm	toler- ance (in)	shaft seat deviation	resultant fit	toler- ance symbol	shaft seat deviation	resultant fit	toler- ance symbol	shaft seat deviation	resultant fit	toler- ance symbol	shaft seat deviation	resultant fit	toler- ance symbo
0.3937 10	0.7087 18	0 - 0.0005	+0.0004 +0.0001	0.0001T 0.0009T	k5	+0.0009 +0.0005	0.0005T 0.0014T	n6	0 - 0.0004	0.0004 L 0.0005T	h6	- 0.00025 - 0.00065	0.00065 L 0.00025T	g6
0.7087 18	1.1811 30	0 - 0.0005	+0.0005 +0.0001	0.0001T 0.0010T	k5	+0.0011 +0.0006	0.0006T 0.0016T	n6	0 - 0.0005	0.0005 L 0.0005T	h6	- 0.0003 - 0.0008	0.0008 L 0.0002T	g6
1.1811 30	1.9685 50	0 - 0.0005	+0.0008 +0.0004	0.0004T 0.0013T	m5	+0.0013 +0.0007	0.0007T 0.0018T	n6	0 - 0.0006	0.0006 L 0.0005T	h6	- 0.0004 - 0.0010	0.0010 L 0.0001T	g6
1.9685 50	3.1496 80	0 - 0.0006	+0.0010 +0.0005	0.0005T 0.0016T	m5	+0.0015 +0.0008	0.0008T 0.0021T	n6	0 - 0.0007	0.0007 L 0.0006T	h6	- 0.0004 - 0.0011	0.0011 L 0.0002T	g6
3.1496 80	4.7244 120	0 - 0.0008	+0.0014 +0.0005	0.0005T 0.0022T	m6	+0.0019 +0.0010	0.0010T 0.0027T	n6	0 - 0.0009	0.0009 L 0.0008T	h6	- 0.0005 - 0.0014	0.0014 L 0.0003T	g6
4.7244 120	7.0866 180	0 - 0.0010	+0.0022 +0.0012	0.0012T 0.0032T	n6	+0.0034 +0.0018	0.0018T 0.0044T	р6	0 - 0.0010	0.0010 L 0.0010T	h6	- 0.0006 - 0.0016	0.0016 L 0.0004T	g6
7.0866 180	9.8425 250	0 - 0.0012	+0.0026 +0.0014	0.0014T 0.0038T	n6	+0.0042 +0.0030	0.0030T 0.0054T	r6	0 - 0.0012	0.0012 L 0.0012T	h6	- 0.0006 - 0.0018	0.0018 L 0.0006T	g6
9.8425 250	12.4016 315	0 - 0.0014	+0.0034 +0.0022	0.0022T 0.0048T	p6	+0.0047 +0.0035	0.0035T 0.0061T	r6	0 - 0.0012	0.0012 L 0.0014T	h6	- 0.0007 - 0.0019	0.0019 L 0.0007T	g6
12.4016 315	15.7480 400	0 - 0.0016	+0.0039 +0.0025	0.0025T 0.0055T	р6	+0.0059 +0.0045	0.0045T 0.0065T	r6	0 - 0.0014	0.0014 L 0.0016T	h6	- 0.0007 - 0.0029	0.0029 L 0.0009T	g7
15.7480 400	19.6850 500	0 - 0.0018	+0.0044	0.0028T 0.0062T	р6	+0.0066	0.0050T 0.0084T	(0 - 0.0016	0.0016 L 0.0018T	h6	- 0.0008 - 0.0033	0.0033 L 0.0010T	q7

Recommended fits above are for ground shaft seats.

Note: Assembly conditions may dictate tighter fits than recommended above. Consult your SKF representative where application conditions call for fitting practices not covered by these recommendations.

C is the basic load rating, P is the equivalent load. T indicates tight fit, L indicates loose fit. \geq equal or greater than. < less than.

 $¹⁾ These \ recommendations \ not \ applicable \ to \ tapered \ bore \ cones. For \ recommendations, \ consult \ your \ SKF \ representative.$

^{2) &}lt;u>C</u> ≥8.3

Housing tolerances for metric and J-prefix inch series tapered roller bearing

ISO class normal and ABMA class K and N values in inches

Cup O.D. (Outer rir	ng)		Housing s	eat deviatio	n from n	naximum cu	p O.D. and t	he resulta	nt fit					
			Stationary	cup					Rotating cup					
D			floating or	floating or clamped		adjustable		non-adjust or in carrier			sheaves- unclamped			
over in mm	incl. in mm	toler- ance (in)	housing seat deviation	resultant fit	toler- ance symbol	housing seat deviation	resultant fit	toler- ance symbol	housing seat deviation	resultant fit	toler- ance symbol	housing seat deviation	resultant fit	toler- ance symbol
0.7087 18	1.1811 30	0 - 0.0005	+ 0.0008 0	0.0013 L 0	H7	+ 0.0005 - 0.0003	0.0010 L 0.0003T	J7	- 0.0005 - 0.0013	0 0.0013T	P7	- 0.0009 - 0.0017	0.0004T 0.0017T	R7
1.1811 30	1.9685 50	0 - 0.0006	+ 0.0010 0	0.0016 L 0	H7	+ 0.0006 - 0.0004	0.0012 L 0.0004T	J7	- 0.0006 - 0.0016	0 0.0016T	P7	- 0.0010 - 0.0020	0.0004T 0.0020T	R7
1.9685 50	3.1496 80	0 - 0.0006	+ 0.0012 0	0.0018 L 0	H7	+ 0.0008 - 0.0004	0.0014 L 0.0004T	J7	- 0.0009 - 0.0021	0.0003T 0.0021T	P7	- 0.0011 - 0.0023	0.0005T 0.0023T	R7
3.1496 80	4.7244 120	0 - 0.0007	+ 0.0014 0	0.0021 L 0	H7	+ 0.0009 - 0.0005	0.0016 L 0.0005T	J7	- 0.0011 - 0.0025	0.0004T 0.0025T	P7	- 0.0015 - 0.0029	0.0008T 0.0029T	R7
4.7244 120	5.9055 150	0 - 0.0008	+ 0.0016 0	0.0024 L 0	H7	+ 0.0010 - 0.0006	0.0018 L 0.0006T	J7	- 0.0012 - 0.0028	0.0004T 0.0028T	P7	- 0.0019 - 0.0035	0.0011T 0.0035T	R7
5.9055 150	7.0866 180	0 - 0.0010	+ 0.0016 0	0.0026 L 0	H7	+ 0.0010 - 0.0006	0.0020 L 0.0006T	J7	- 0.0012 - 0.0028	0.0002T 0.0028T	P7	- 0.0019 - 0.0035	0.0009T 0.0035T	R7
7.0866 180	9.8424 250	0 -0.0012	+ 0.0018 0	0.0030 L 0	H7	+ 0.0011 - 0.0007	0.0023 L 0.0007T	J7	- 0.0014 - 0.0032	0.0002T 0.0032T	P7	- 0.0024 - 0.0042	0.0012T 0.0042T	R7
9.8425 250	12.4016 315	0 - 0.0014		0.0041 L 0.0007 L	G7	+ 0.0013 - 0.0007	0.0027 L 0.0007T	J7	- 0.0014 - 0.0034	0 0.0034T	P7	- 0.0027 - 0.0047	0.0013T 0.0047T	R7
12.4016 315	15.7480 400	0 - 0.0016		0.0045 L 0.0007 L	G7	+ 0.0015 - 0.0007	0.0031 L 0.0007T	J7	- 0.0017 - 0.0039	0.0001T 0.0039T	P7	- 0.0037 - 0.0059	0.0021T 0.0059T	R7
15.7480 400	19.6850 500	0 - 0.0018		0.0051 L 0.0008 L	G7	+ 0.0016 - 0.0009	0.0034 L 0.0009T	J7	- 0.0019 - 0.0044	0.0001T 0.0044T	P7	- 0.0041 - 0.0066	0.0023T 0.0066T	R7

Recommendations above are for cast iron or steel housing. For housings of light metal, tolerances are generally selected which give a slightly tighter fit than those in the table. T indicates tight fit. L indicates loose fit.

Bearing shaft – seat diameters¹⁾

Precision (ABEC 5) deep groove ball bearings

	Bearing bore o	liameter	Shaft/seat diam	neter	
mm	inches maximum	minimum	inches maximum	minimum	Fit ²⁾ in .0001"
10	.3937	.3935	.3937	.3935	2 L, 2T
12	.4724	.4722	.4724	.4722	2 L, 2T
15	.5906	.5904	.5906	.5904	2 L, 2T
17	.6693	.6691	.6693	.6691	2 L, 2T
20	.7874	.7872	.7875	.7873	1 L, 3T
25	.9843	.9841	.9844	.9842	1 L, 3T
30	1.1811	1.1809	1.1812	1.1810	1 L, 3T
35	1.3780	1.3777	1.3782	1.3779	1 L, 5T
40	1.5748	1.5745	1.5750	1.5747	1 L, 5T
45	1.7717	1.7714	1.7719	1.7716	1 L, 5T
50	1.9685	1.9682	1.9687	1.9684	1 L, 5T
55	2.1654	2.1650	2.1656	2.1652	2 L, 6T
60	2.3622	2.3618	2.3624	2.3620	2 L, 6T
65	2.5591	2.5587	2.5593	2.5589	2 L, 6T
70	2.7559	2.7555	2.7561	2.7557	2 L, 6T
75	2.9528	2.9524	2.9530	2.9526	2 L, 6T
80	3.1496	3.1492	3.1498	3.1494	2 L, 6T
85	3.3465	3.3461	3.3467	3.3463	2 L, 6T
90	3.5433	3.5429	3.5435	3.5431	2 L, 6T
95	3.7402	3.7398	3.7404	3.7400	2 L, 6T
100	3.9370	3.9366	3.9372	3.9368	2 L, 6T
105	4.1339	4.1335	4.1341	4.1337	2 L, 6T
110	4.3307	4.3303	4.3309	4.3305	2 L, 6T
120	4.7244	4.7240	4.7246	4.7242	2 L, 6T

¹⁾ Use this table for ABEC 5 bearings; for higher precision bearings, other recommendations apply. contact SKF Application Engineering.

²⁾ L indicates "LOOSE" fit. T indicates "TIGHT" fit

^{*}Note – These shaft dimensions are to be used when C/P > = 14.3 and the inner ring rotates in relation to the direction of the radial load. For heavier loads contact SKF Application Engineering.

Bearing housing – seat diameters¹⁾
Precision (ABEC 5) deep groove ball bearings

	Bearing outsid	de diameter	Housing/seat di	ameter	
mm	inches maximum	minimum	inches minimum	maximum	Fit ²⁾ in .0001"
30	1.1811	1.1809	1.1810	1.1813	4 L, 1T
32	1.2598	1.2595	1.2597	1.2600	5 L, 1T
35	1.3780	1.3777	1.3779	1.3782	5 L, 1T
37	1.4567	1.4564	1.4566	1.4569	5 L, 1T
40	1.5748	1.5745	1.5747	1.5750	5 L, 1T
42	1.6535	1.6532	1.6534	1.6537	5 L, 1T
47	1.8504	1.8501	1.8503	1.8506	5 L, 1T
52	2.0472	2.0468	2.0471	2.0474	6 L, 1T
62	2.4409	2.4405	2.4408	2.4411	6 L, 1T
72	2.8346	2.8342	2.8345	2.8348	6 L, 1T
80	3.1496	3.1492	3.1495	3.1498	6 L, 1T
85	3.3465	3.3461	3.3464	3.3468	7 L, 1T
90	3.5433	3.5429	3.5432	3.5436	7 L, 1T
100	3.9370	3.9366	3.9369	3.9373	7 L, 1T
110	4.3307	4.3303	4.3306	4.3310	7 L, 1T
120	4.7244	4.7240	4.7243	4.7247	7 L, 1T
125	4.9213	4.9209	4.9211	4.9216	7 L, 2T
130	5.1181	5.1177	5.1179	5.1184	7 L, 2T
140	5.5118	5.5114	5.5116	5.5121	7 L, 2T
150	5.9055	5.9051	5.9053	5.9058	7 L, 2T
160	6.2992	6.2987	6.2990	6.2995	8 L, 2T
170	6.6929	6.6924	6.6927	6.6932	8 L, 2T
180	7.0866	7.0861	7.0864	7.0869	8 L, 2T
190	7.4803	7.4797	7.4801	7.4807	10 L, 2T
200	7.8740	7.8734	7.8738	7.8744	10 L, 2T

¹⁾ Use this table for ABEC 5 bearings; for higher precision bearings, other recommendations apply. contact SKF Application Engineering. 2) L indicates "LOOSE" fit. T indicates "TIGHT" fit

^{*}Note – These housing dimensions are to be used when the outer ring is stationary in relation to the direction of the radial load. For applications with rotating outer ring loads contact SKF Application Engineering.

Lubrication

Functions of a lubricant

If rolling bearings are to operate reliably they must be adequately lubricated to prevent metal-to-metal contact between the rolling elements, raceways and cages. Separation of the surfaces in the bearing is the primary function of the lubricant, which must also inhibit wear and protect the bearing surfaces against corrosion. In some applications the lubricant is also used to carry away heat. The choice of a suitable lubricant and method of lubrication for each individual bearing application is therefore important, as is correct maintenance.

Lubricants for rolling bearings serve the following functions:

- Separate the rolling contact surfaces in the bearing;
- Separate the sliding contact surfaces in the bearing:
- Protect highly finished bearing surfaces from corrosion;
- Provide sealing against contaminants (in the case of grease);
- Provide a heat transfer medium (in the case of oil).

A wide selection of oils and greases are available for the lubrication of rolling bearings. There are also various types of solid lubricants available on the market for extreme temperature conditions. The actual choice of a lubricant depends primarily on the operating conditions, i.e. the temperature range, speeds, and the influence of the surroundings.

Rolling bearings will generate the least amount of heat when the minimum amount of lubricant needed for reliable bearing lubrication is provided. However, it is generally impractical to use such small amounts of lubricant since the lubricant is also performing other functions such as sealing and heat removal. The lubricant in a bearing arrangement gradually loses its lubricating properties as a result of mechanical working, aging and the build-up of contamination. It is therefore necessary for oil to be filtered and changed at regular intervals and grease to be replenished or renewed. Details regarding relubrication intervals and quantities appear elsewhere in this section.

SKF on-line programs for lubrication

Viscosity calculations can be made with the "SKF Interactive Engineering" Catalog accessed through www.skf.com. Select the "Calculations" icon and select "Viscosity."

Relubrication intervals can be calculated in the same manner as above:
SKF Interactive Engineering Catalog accessed through www.skf.com.
Select the "Calculations" icon and select "Relubrication intervals."

Grease selection can be made by using SKF LubeSelect, available on-line through the @ptitudeXchange subscription service.

SKF greases can be found on-line at www.skf.com under "SKF Maintenance and Lubrication Products". The program SKF LubeSelect, available through the @ptitudeXchange subscription service, can also be used to select greases for specific applications or sets of application conditions.

Selection of oil


Oil is generally used for rolling bearing lubrication when high speeds, high temperatures, or lubricant life preclude the use of grease. It is also used when heat has to be removed from the bearing position, or when adjacent components (gears etc.) are lubricated with oil.

The most important property of lubricating oil is its viscosity. Viscosity is a measure of a fluid's resistance to flow. A high viscosity oil will flow less readily than a thinner, low viscosity oil. The viscosity of a lubricant is directly related to the amount of film thickness it can generate, and film thickness is the most critical component to separate the rolling and sliding surfaces within a bearing. This separation is critical to reduce friction and heat, and to minimize wear. The units of measurement for oil viscosity are Saybolt Universal Seconds (SUS) and centistokes (mm²/s, cSt). The viscosity-temperature relationship of oil is characterized by the viscosity index VI. For rolling bearing lubrication, oils having a high viscosity index (little change with temperature) of at least 95 are recommended.

Mineral oils are generally favored for rolling bearing lubrication. Rust and oxidation inhibitors are typical additives. Synthetic oils are generally considered for bearing lubrication in extreme cases, e.g. at very low or very high operating temperatures. The term synthetic oil covers a wide range of different base stocks. The main ones are polyalphaolefins (PAO), esters and polyalkylene glycols (PAG). These synthetic oils have different properties than mineral oils. Accurate information should always be sought from the individual lubricant supplier.

In order for a sufficiently thick oil film to be formed in the contact area between rolling elements and raceways, the oil must have a specific kinematic viscosity, n_1 , at the bearing operating temperature. That minimum viscosity can be determined from **Figure 1**, provided a mineral oil is used and the bearing size and speed are known.

Bearing size is expressed along the horizontal axis as the mean diameter (d_m) in

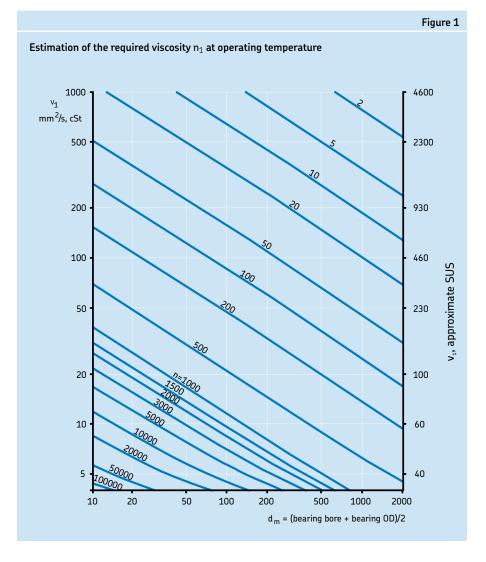

millimeters, where d_m = (bearing bore + bearing OD)/2. Speed, in rpm, is given on the diagonal lines. To determine the minimum required viscosity at the bearing operating temperature, find the point where the mean diameter and speed lines intersect – then read across horizontally to the vertical axis on the left to determine the minimum required viscosity in centistokes, or to the right to determine the minimum required viscosity on Saybolt Universal Seconds.

The effectiveness of a particular lubricant is determined by the viscosity ratio, or Kappa value, **k**. **k** is the ratio of the actual operating viscosity, **n**, to the required kinematic vis-

cosity, \mathbf{n}_1 found from **Figure 1**. If $\mathbf{k} \ge 1$ the rolling contact surfaces in the bearing are fully separated by a film of oil. Both \mathbf{n} and \mathbf{n}_1 are to be considered at the bearing operating temperature.

 $k = n / n_1$ where


k = viscosity ratio

n =actual operating viscosity of the lubricant (mm²/s, cSt)

 n_1 = minimum required viscosity depending on bearing size and speed (mm²/s, cSt)

Bearing life may be extended by selecting an oil that provides a $k \ge 1$, or when $n > n_1$. This can be obtained by choosing a mineral oil with a higher ISO VG or by

88 **5KF**

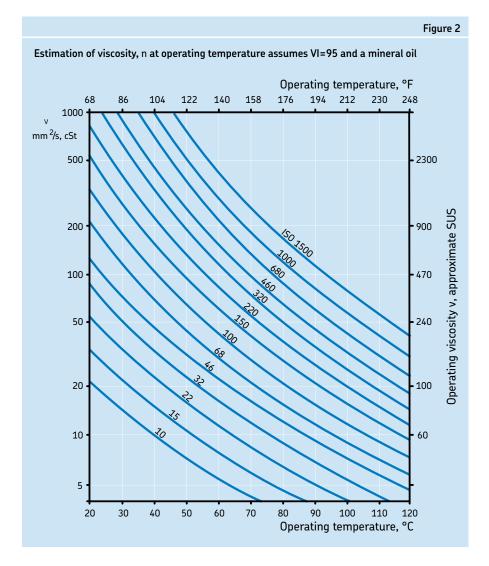

using an oil with a higher viscosity index VI. However, since increasing viscosity can raise the bearing operating temperature, there is a practical limit to the lubrication improvement that can be obtained by this means.

When k<1, an oil containing EP/AW additives is recommended. It should also be noted that some EP additives may cause adverse effects, see section "Load carrying ability, EP and AW additives" page 94. For exceptionally low or high speeds, for critical loading conditions, or for unusual lubricating conditions, please consult SKF Application Engineering.


For cases where bearing size or operating speed are unknown or cannot be determined, several "rules of thumb" have traditionally been applied. For ball bearings and

cylindrical roller bearings, a minimum of 70 SUS (13 centistokes) viscosity at the bearing operating temperature is required. For spherical roller bearings, toroidal roller bearings, and taper roller bearings, a minimum of 100 SUS (21 centistokes) viscosity at the bearing operating temperature is required. For spherical roller thrust bearings, a minimum of 150 SUS (32 centistokes) viscosity at the bearing operating temperature is required. These "rules of thumb" values are typically not appropriate for relatively slow or high rotational speeds. Many operating considerations are involved in the proper viscosity selection. Therefore, the "rules of thumb" should be used sparingly and only in the absence of sufficient information for a proper selection.

The viscosity obtained from Figure 1 or from the "rules of thumb" is the viscosity required at the bearing operating temperature. Since viscosity is temperature dependent, it is necessary to reference temperature when referring to viscosity. Manufacturers of oil and grease typically publish the viscosity of the oil, or base oil, at reference temperatures 40° C (104° F) and 100° C (212° F). With this information it is possible to calculate that specific oil's viscosity at all other temperatures. ISO also has an established standard for referring to the viscosity of oil: the ISO Viscosity Grade (VG) is simply the oil viscosity at 40° C (104° F). As an example, an ISO VG 68 oil or grease has a viscosity of approximately 68 cSt at 40° C.

Figure 2 can be used to select the appropriate ISO Viscosity Grade (VG) for an application. It shows the relationship between viscosity and temperature for common industrial mineral oils or base oils in greases. To determine the appropriate ISO VG for an application, find the point where the previously determined minimum required viscosity intersects the expected bearing operating temperature. The first diagonal line to the right of this point is the minimum ISO VG that should be used in the application. Note that the viscosity lines on Figure 2 represent oils and base oils with a Viscosity Index of 95 (VI 95). Some lubricants have viscosity indexes other than the VI 95. In these cases, plot the two reference points on the chart and connect with a straight line to determine their profile.

For all calculations, the viscosity should be expressed in mm²/s (cSt). See **Figure 3** for conversion to other viscosity units and grades.

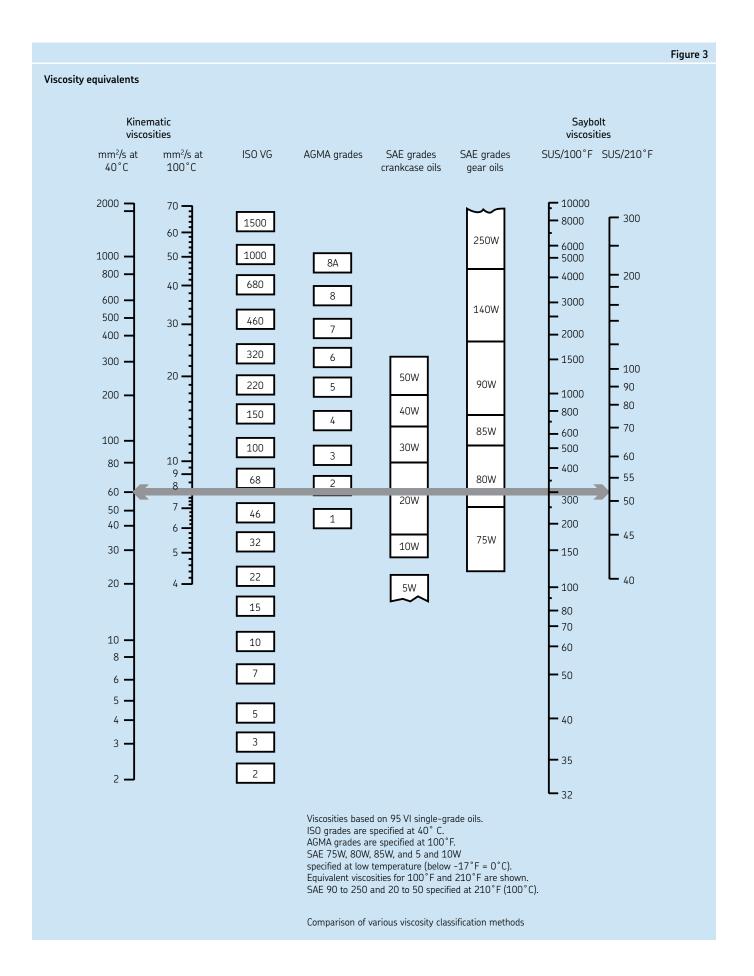

5KF

Methods of oil lubrication

Since oils are liquid, suitable enclosures must be provided to prevent leakage and they should receive careful consideration.

Oil bath

A simple oil bath method, shown in **Figure 4**, is satisfactory for low and moderate speeds. The oil, which is picked up by the rotating components of the bearing, is distributed within the bearing and then flows back to the oil bath. The oil level at standstill must not be higher than the center of the lowest ball or roller. The static oil level must be checked only at standstill. A reliable sightglass gauge should be provided to permit an easy check. It is common to have two levels marked on the sight glass, one for static and one for dynamic conditions. They should be clearly labeled to avoid confusion.

Oil pick-up ring

For those bearing applications with higher speeds and operating temperatures, an oil pick-up ring lubrication method may be more appropriate than a simple static oil bath, shown in Figure 5. The pick-up ring serves to bring about oil circulation. The ring hangs loosely on a sleeve on the shaft at one side of the bearing and dips into the oil in the lower half of the housing. As the shaft rotates, the ring follows and transports oil from the bottom to a collecting trough. The oil then flows through the bearing back into the reservoir at the bottom. This method eliminates the bearing "plowing" through the static oil level in the sump and reduces the bearing operating temperature. This method of oil lubrication is only effective for horizontal applications because of the oil ring dynamics.


Circulating systems


Operation at high speeds will cause the operating temperature to increase and will accelerate aging of the oil. To avoid frequent oil changes as well as achieve a k ratio of 1, the circulating oil lubrication method is generally preferred, shown in **Figure 6**. Circulating oil simplifies maintenance, particularly on large machines, and prolongs the life of the oil where operating conditions are


usually severe, such as high ambient temperatures and steadily increasing power inputs and speeds. Oil is circulated to the bearing with the aid of a pump. The oil flows through the bearing, drains from the housing, returns to the reservoir where it is filtered and, if required, cooled before being returned to the bearing.


If the bearing is provided with a relubrication feature such as an oil groove and holes in the outer or inner ring, supplying the oil through the relubrication feature in the center of the bearing near the top of the housing is preferred. Draining the oil for the center feed method is best done by a two drain system, one on each side of the housing leading downward immediately outside the housing. Horizontal drains should be avoided to prevent back up of the oil in the housing. An alternate method is to have the inlet on one side, below the horizontal center, and drain from the opposite side of the bearing. The outlet should be larger than the inlet to prevent accumulation of oil in the bearing housing.


The amount of oil retained in the housing is controlled by the location of the outlet(s). For a "wet sump", the oil level at a standstill must not be higher than the center of the lowest ball or roller. A reliable sight-glass gauge should be provided to permit an easy check. Where there is extreme heat, the "dry sump" design is preferred, permitting the oil to drain out immediately after it has passed through the bearing. The outlets are then located at the lowest point on both sides of the housing. It has been found that with this arrangement the bearings remain cleaner since there is less chance of carbonized oil being retained in the housing. When the outlets, or drains, are located at the lowest point on both sides of the housing, an arrangement is necessary to indicate when oil flow is impaired or stopped. Electrically interlocking the oil pump motor with the motor driving the machine can provide this protection. Note that with many bearing types, the groove or sphere in the outer ring on horizontal mountings will always retain some oil. The bearing will therefore have some oil when it starts to rotate.

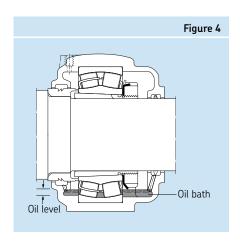

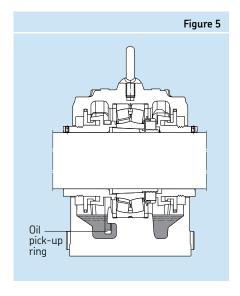

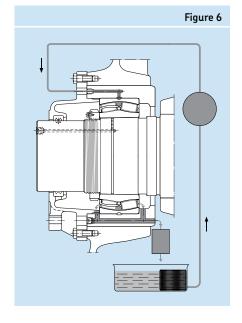

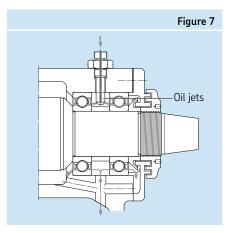

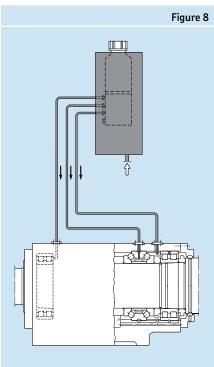

Oil jet

For very high-speed operation, a sufficient but not excessive amount of oil must be supplied to the bearing to provide adequate lubrication without increasing the operating temperature more than necessary. One particularly efficient method of achieving this is the oil jet method shown in **Figure 7**, where a jet of oil under high pressure is directed at the side of the bearing. The velocity of the oil jet must be high enough (at least 15 m/s) to penetrate the turbulence surrounding the rotating bearing.

Oil mist

This method consists of a mixture of air and atomized oil being supplied to the bearing housing under suitable pressure. It is important that the air be sufficiently clean and dry. Oil mist lubrication vents into the atmosphere, resulting in unpleasant surroundings and possible environmental effects. As a result, it should only be utilized in specific applications and, when used, certain precautions should be employed. New oil mist generators and special seal designs limit the amount of stray mist. In case synthetic non-toxic oil is used, the environmental effects are even further reduced. Oil mist lubrication today is used in unique applications.

Air/oil lubrication

The air/oil method of lubrication, sometimes called the oil-spot method, uses compressed air to transport a very precise amount of lubricant directly to a bearing. This minimum quantity of oil enables bearings to operate at lower temperatures or at higher speeds than any other method of lubrication. Oil is metered into the airstream of the supply lines to the bearing housings at set time intervals, monitored by a programmable controller. The oil coats the inside of the supply lines and "spirals/creeps" in the direction of the airflow.

Figure 8 shows a typical air/oil system configuration.

In contrast to oil mist methods, the air/oil method involves no atomization of the air and oil. Air/oil allows more effective use of higher viscosity base oils and air oil uses less oil. Both the oil mist and air/oil methods build and maintain internal bearing pressures, which help repel contaminants.

Oil relubrication intervals

The frequency at which the oil must be changed is mainly dependent on the operating conditions and on the quantity of oil used. Oil sample analysis will help establish an appropriate oil change schedule. Generally, the oil should be changed once a year, provided the operating temperature does not exceed 122° F (50° C) and there is little risk of contamination. Higher temperatures call for more frequent oil changes, e.g. for operating temperatures around 212° F (100° C), the oil should be changed every three months. Frequent oil changes are also needed if other operating conditions are more demanding.

With circulating oil lubrication, the period between oil changes is determined by how frequently the total oil quantity is circulated and whether or not the oil is cooled. It is generally only possible to determine a suitable interval by test runs and by regular inspection of the condition of the oil to see that it is not contaminated and is not excessively oxidized. The same applies for oil jet lubrication. With oil spot lubrication the oil only passes through the bearing once and is not re-circulated.

92 **5KF**

Grease lubrication

Lubricating greases usually consist of a mineral or synthetic oil suspended in a thickener, with the oil typically making up 75% or more of the grease volume. Chemicals (additives) are added to grease to achieve or enhance certain performance properties. As a result of having a thickener package, grease is more easily retained in the bearing arrangement, particularly where shafts are inclined or vertical. Grease also helps to seal bearings against solid and moisture contamination.

Excessive amounts of grease, as well as oil, will cause the operating temperature in the bearing to rise rapidly, particularly when running at high speeds. As a general rule for grease lubricated bearings, only the bearing should be completely filled with grease prior to start-up and the free space in the housing should be partially filled. Before operating at full speed, the excess grease in the bearing must be allowed to settle or escape into the housing cavity during a running-in period. At the end of the running-in period, the operating temperature will drop considerably indicating that the grease has been distributed in the bearing arrangement.

Where bearings are to operate at very low speeds and good protection against contamination and corrosion is required, it is advisable to fill the housing completely with grease.

Grease selection

When selecting a grease for bearing lubrication, the base oil viscosity, consistency, operating temperature range, oil bleed rate, rust inhibiting properties and the load carrying ability are the most important factors to be considered.

Grease thickener

There are a wide variety of different thickeners available, each with specific benefits directed at application problems. The thickener composition is critical to grease performance, particularly with respect to temperature capability, water resistance, and bleed rates. The broadest classification of thickeners is divided into two classes: soaps and non-soaps. Soap, in grease terminology, refers to a fatty acid and a metal. Common metals include Aluminum, Lithium, Calcium, and Sodium. Non-soap thickeners include organic and inorganic. Organic thickeners include ureas, amides, and dyes. Inorganic thickeners include various clays such as bentonite. Since each specific thickener type has its own advantages and disadvantages, the lubricant manufacturer should be consulted when selecting a specific grease type based on the application conditions.

Grease consistency

Greases are divided into various consistency classes according to the National Lubricating Grease Institute (NLGI) scale. Greases that soften at elevated temperatures may leak from the bearing arrangement. Those that stiffen at low temperatures may restrict rotation of the bearing or have insufficient oil bleeding.

Metallic soap thickened greases, with an NLGI consistency of 1, 2 or 3 are used for rolling bearings, with the most common being NLGI 2. Lower consistency greases are preferred for low temperature applications, or for improved pumpability. NLGI 3 greases are recommended for bearing arrangements with a vertical shaft, where a baffle plate is arranged beneath the bearing to prevent the grease from leaving the bearing.

In applications subjected to vibration, a grease with very good mechanical stability is required to prevent hardening or softening under conditions of vibration and shear. Higher consistency greases may help here, but stiffness alone does not guarantee good performance. Lithium and lithium complex greases typically have good mechanical stability.

Operating temperature

The temperature range over which a grease can be used depends largely on the type of base oil and thickener used as well as the additives. Very low temperatures may result in excessive rotating torque or insufficient oil bleed from the grease pack. At very high temperatures the rate of oxidation (deterioration) of the grease is accelerated and evaporation losses are magnified. Oxidation by-products are detrimental to bearing lubrication. When bearing operating temperatures are below -4° F (-20° C) or above 250° F (121° C) grease lubrication with conventional grease may not be acceptable. Specialty greases or other lubrication methods (i.e. circulating oil) should be considered at that time. In these cases it is advisable to consult with SKF Application Engineering and the grease supplier to determine the lubricant that will be most suitable for the application.

NOTE: The operating temperature limits that a lubricant manufacturer provides are based on grease chemical properties. This does not mean that the grease will properly lubricate bearings within those same temperature ranges. The viscosity of the base oil is usually too low to adequately lubricate a bearing at the temperature limits the lubricant manufacturer provides. For low operating temperatures, the oil bleed rate needs to be considered when selecting a grease.

Oil bleed rate

Grease must release some of its oil during operation to properly lubricate the bearing. The rate at which the oil is released is the bleed rate or the oil separation rate. One industry standard test for determining oil bleed rate is DIN Standard 51817. Typical oil bleed rates of greases used for bearing lubrication are 1 to 5%. The base oil viscosity of the greases normally used for rolling bearings lies between 15 and 500 mm²/s at 104° F (40° C). Greases with base oils having higher viscosities than 1000 mm²/s at 104° F (40° C) bleed oil so slowly that the bearing may not be adequately lubricated. Therefore, if the calculated minimum required viscosity is above 1000 mm²/s, it is better to use a grease with a maximum viscosity of 1000 mm²/s at the operating temperature and good oil bleeding properties or to apply oil lubrication.

Rust/corrosion protection and behavior in the presence of water

Grease should protect the bearing against corrosion and should not be washed out of the bearing arrangement in cases of water penetration. The thickener type solely determines the resistance to water: lithium complex, calcium complex and polyurea greases usually have very good resistance to washout. Most sodium soap greases emulsify and thin out when mixed with water. No lubricating grease is completely water resistant. Even those classified as water insoluble or water resistant can be washed out if exposed to large volumes of water. The type of rust inhibitor additive mainly determines the rust inhibiting properties of greases.

At very low speeds, a full grease pack of the bearing and housing is beneficial for corrosion protection and preventing water ingress, and frequent relubrication is also recommended to flush out contaminated grease.

Load carrying ability: EP and AW additives

Bearing life is shortened if the lubricant film thickness is not sufficient to fully separate the rolling contact surfaces. This is usually very common for very slow rotating bearings. One option to overcome this is to use a lubricant with Extreme Pressure (EP) and Anti-Wear (AW) additives. High temperatures induced by local asperity contact, activate these additives promoting mild wear at the points of contact. The result is a smoother surface with lower contact stresses and an increase in service life. However, if the lubricant film thickness is sufficient, SKF does not generally recommend the use of EP and AW additives. The reason is that some of these additives can become reactive at temperatures as low as 180° F (82° C). When they become reactive, they can promote corrosion and micro-pitting. Therefore, SKF recommends the use of less reactive EP additives for operating temperatures above 180° F (82° C) and does not recommend EP additives at all above 210° F (99° C).

AW additives have a function similar to that of EP additives, i.e. to prevent severe metal-to-metal contact. AW additives build a protective layer that adheres to the surface. The asperities are then sliding over each other without metallic contact. The roughness is therefore not reduced by mild wear as in the case of EP additives. AW additives may contain elements that, in the same way as the EP additives, can migrate into the bearing steel and weaken the structure.

For very low speeds, solid lubricant additives such as graphite and molybdenum disulphide (MoS_2) are sometimes included in the additive package to enhance the EP effect. These additives should have a high purity level and a very small particle size; otherwise dents due to over rolling of the particles might reduce bearing fatigue life.

Compatibility

If it becomes necessary to change from one grease to another, the compatibility of the greases should be considered.

CAUTION: If incompatible greases are mixed, the resulting consistency can change significantly and bearing damage due to lubricant leakage or lubricant hardening can result.

Greases having the same thickener and similar base oils can generally be mixed without any problems, e.g. a lithium thickener/mineral oil grease can generally be mixed with another lithium thickener/mineral oil grease. Also, some greases with different thickeners, e.g. calcium complex and lithium complex greases, can be mixed. However, it is generally good practice not to mix greases. The only way to be absolutely certain about the compatibility of two different greases is to perform a compatibility test with the two specific greases in question. Often the lubricant manufacturers for common industrial greases have already performed these tests and they can provide those results if requested.

The preservative with which SKF bearings are treated is compatible with the majority of rolling bearing greases with the possible exception of polyurea greases. Modern polyurea greases tend to be more compatible with preservatives than some of the older polyurea greases.

SKF greases

SKF has a full range of bearing lubricating greases covering virtually all application requirements. These greases have been developed based on the latest information regarding rolling bearing lubrication and have been thoroughly tested both in the laboratory and in the field. Their quality is regularly monitored by SKF.

Grease relubrication

In order for a bearing to be properly lubricated with grease, oil must bleed from the grease. The oil that is picked up by the bearing components is gradually broken down by oxidation or lost by evaporation, centrifugal force, etc. In time, the grease will oxidize or the oil in the grease near the bearing will be depleted. Therefore, depending upon the life requirement for the bearing, relubrication may be necessary. There are two critical factors to proper relubrication: the quantity of grease supplied and the frequency at which it is supplied.

If the service life of the grease is shorter than the expected service life of the bearing, the bearing has to be relubricated. Relubrication should occur when the condition of the existing lubricant is still satisfactory. The relubrication interval depends on many related factors. These include bearing type and size, speed, operating temperature, grease type, space around the bearing, and the bearing environment. The relubrication charts and information provided are based on statistical rules. The SKF relubrication intervals are defined as the time period, at the end of which 99% of the bearings are still reliably lubricated. This represents the L₁ grease life.

Bearings with integral seals and shields

The information and recommendations below relate to bearings without integral seals or shields. Bearings and bearing units with integral seals and shields on both sides are typically already supplied with grease from the manufacturer. Bearings with integral seals and shields are very difficult to regrease. Therefore, when estimating the service life of sealed or shielded bearings, consideration needs to be given to bearing fatigue life and grease life. The service life of a bearing with integral seals or shields is determined by the shorter of the two lives. For information about the grease life of a bearing with integral seals or shields, SKF should be contacted.


Relubrication intervals

The relubrication intervals t_f for bearings with rotating inner ring on horizontal shafts under normal and clean conditions can be obtained from **Figure 9** as a function of:

- the bearing rotational speed (n), rpm
- the bearing pitch diameter (d_m)
 d_m = [bearing bore(mm) + bearing OD(mm)]/2
- the relevant bearing factor, b_f, depending on bearing type and load conditions, (see Table 1)
- the load ratio (Dynamic capacity / Applied resultant load), C/P

The relubrication interval $t_{\rm f}$ is an estimated value based on an operating temperature of 70°C (158°F), using good quality lithium thickener/mineral oil greases. When bearing operating conditions differ, adjust the relubrication intervals obtained from **Figure 9**, according to the information given under "Relubrication interval adjustments" (page 96).

If the n x d_m exceeds 70% of the recommended limit according to **Table 1** (page 96) or if ambient temperatures are high, then extra consideration should be given to the lubrication methods. When using high performance greases, a longer relubrication interval can be achieved. SKF Application Engineering should be consulted in these instances.

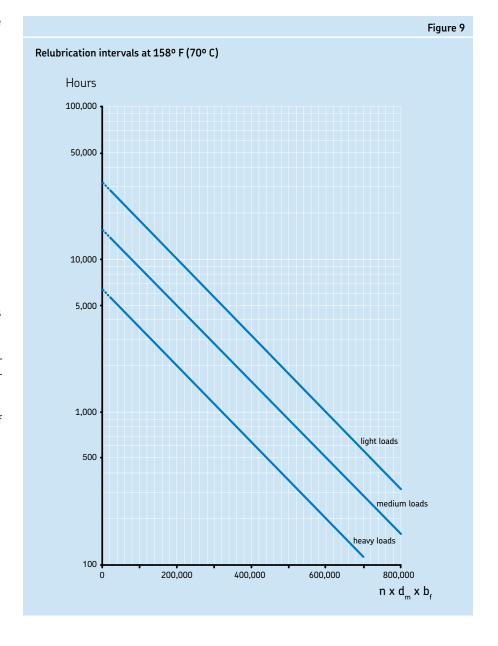

Relubrication interval adjustments

Operating temperature

Since grease aging is accelerated with increasing temperature, it is recommended to halve the intervals obtained from Figure 9 for every 27° F (15° C) increase in operating temperature above 158° F (70° C). The alternate also applies for lower temperatures. The relubrication interval tf may be extended at temperatures below 158° F

(70°C) if the temperature is not so low as to prevent the grease from bleeding oil. In the case of full complement bearings and thrust roller bearings, tf values obtained from Figure 9 should not be extended. It is also not advisable to use relubrication intervals in excess of 30,000 hours.

In general, specialty greases are required for bearing temperatures in excess of 210° F (100° C). In addition, the material limitations of the bearing components should also be taken into consideration such as the cage, seals, and the temperature stability of the bearing steel.

Vertical shaft

For bearings on vertical shafts, the intervals obtained from Figure 9 should be halved. A good seal or retaining shield below the bearing is required to prevent the grease from exiting the bearing cavity. As a reminder, NLGI 3 greases help reduce the amount of grease leakage and churning that occurs in vertical shaft applications.

Vibration

Moderate vibration should not have a negative effect on grease life. But high vibration

				Tab
Bearing factors and recommended limits for n x d_m				
Bearing type ¹⁾	Bearing factor b _f	Recommended limit for $n \times d_m$	S	
		light load	medium load	heavy load
Deep groove ball bearings	1	500,000	400,000	300,000
Y-bearings	1	500,000	400,000	300,000
Angular contact ball bearings	1	500,000	400,000	300,000
Self-aligning ball bearings	1	500,000	400,000	300,000
Cylindrical roller bearings — non-locating bearing — locating bearing, without external axial loads or with light but alternating axial loads	1,5 2	450,000 300,000	300,000	150,000
 locating bearing, with constantly acting light axial load without a cage, full complement²⁾ 	4 Contact the	200,000 SKF application enginee	120,000 ring service.	60,000
Needle roller bearings — with a cage — without a cage, full complement	3 1,5	350,000 450,000	200,000 300,000	100,000 150,000
Tapered roller bearings	2	350,000	300,000	200,000
Spherical roller bearings - when load ratio Fa/Fr ≤ e and dm ≤ 800 mm series 213, 222, 238, 239 series 223, 230, 231, 232, 240, 248, 249 series 241 - when load ratio Fa/Fr ≤ e and dm > 800 mm series 238, 239 series 230, 231, 232, 240, 248, 249 series 241 - when load ratio Fa/Fr > e all series	2 2 2 2 2 2 2 2	350,000 250,000 150,000 230,000 170,000 100,000	200,000 150,000 80,000 ⁴⁾ 130,000 100,000 50,000 ⁴⁾	100,000 80,000 50,000 ⁴⁾ 65,000 50,000 30,000 ⁴⁾
CARB toroidal roller bearings — with cage — without cage, full complement ²⁾	2 4	350,000 NA ³⁾	200,000 NA ³⁾	100,000 20,000
Thrust ball bearings	2	200,000	150,000	100,000
Cylindrical roller thrust bearings	10	100,000	60,000	30,000
Needle roller thrust bearings	10	100,000	60,000	30,000
Spherical roller thrust bearings – rotating shaft washer	4	200,000	120,000	60,000

¹⁾ The bearing factors and recommended practical n x dm limits apply to bearings with standard internal geometry and standard cage execution.

For alternative internal bearing design and special cage execution, please contact the SKF application engineering service

²⁾ The t_f value obtained from Figure 9 needs to be divided by a factor of 10

³⁾ Not applicable, for these C/P values a caged bearing is recommended instead

⁴⁾ For higher speeds oil lubrication is recommended

and shock levels, such as those in vibrating screen applications, can cause the grease to "slump" more quickly, resulting in churning. In these cases the relubrication interval should be reduced. If the grease becomes too soft, grease with a better mechanical stability or grease with higher stiffness up to NLGI 3 should be used.

Outer ring rotation

In applications where the outer ring rotates or where there is an eccentric shaft weight, the speed factor n x $d_{\rm m}$ is calculated differently: in this case use the bearing outside diameter D instead of $d_{\rm m}.$ The use of a good sealing mechanism is also required to avoid grease loss.

Under conditions of high outer ring speeds (i.e. > 40% of the bearing reference speed), greases with reduced bleed rates should be selected. For spherical roller thrust bearings with a rotating housing washer, oil lubrication is recommended.

Contamination

When considering contamination, grease aging isn't as much an issue as the detrimental effects of the contaminants to the bearing surfaces. Therefore, more frequent relubrication than indicated by the relubrication interval will reduce the negative effects of foreign particles on the grease while reducing the damaging effects caused by over-rolling the particles. Fluid contaminants (water, process fluids, etc.) also call for a reduced interval. In case of severe contamination, continuous relubrication should be considered.

Since there are no formulas to determine the frequency of relubrication because of contamination, experience is the best indicator of how often to relubricate. It is generally accepted that the more frequent the relubrication the better. However, care should be taken to avoid overgreasing a bearing in an attempt to flush out contaminated grease. Using less grease on a more freguent basis rather than the full amount of grease each time is recommended. Excessive regreasing without the ability to purge will cause higher operating temperatures because of churning. The grease amount required for relubrication is discussed later in this section.

Very low speeds

Bearings that operate at very low speeds under light loads call for a grease with low consistency while bearings that operate at low speeds and heavy loads require a grease having a high viscosity, and if possible, good EP characteristics. Selecting the proper grease and grease fill is important in low speed applications. In some cases, 100% fills may be appropriate. In general, grease aging is not an issue for very low speed applications when bearing temperatures are less than 158° F (70° C), so relubrication is rarely needed unless contamination is an issue.

High speeds

Relubrication intervals for bearings used at high speeds, i.e. above the speed factor $n \times d_m$ in **Table 1**, only apply when using special greases or special bearings, e.g. hybrid bearings. In these cases continuous relubrication techniques such as circulating oil, oil–spot, etc. are more suitable than grease lubrication.

Very heavy loads

For bearings operating at a speed factor $n \times d_m > 20,000$ and with a load ratio C/P < 4, the relubrication interval should be reduced. Under these very heavy load conditions, continuous grease relubrication or oil bath lubrication is recommended.

In applications where the speed factor $n \times d_m < 20,000$ and the load ratio C/P = 1-2, see information under "Very low speeds", above. For heavy loads and high speeds, circulating oil lubrication with cooling is generally recommended.

Very light loads

In many cases the relubrication interval may be extended if the loads are light (C/P = 30 to 50). Be aware that bearings do have minimum load requirements for satisfactory operation.

Misalignment

A constant misalignment within the permissible limits of the bearing does not adversely affect the grease life in self-aligning type bearings. However, misalignment in other

bearing types will typically generate higher operating temperatures and require more frequent relubrication. Reference "Operating temperature" (page 96).

Large bearings

To establish a proper relubrication interval for large roller bearings (d > 300 mm) used in critical bearing arrangements in process industries, an interactive procedure is recommended. In these cases it is advisable to initially relubricate more frequently and adhere strictly to the recommended regreasing quantities (see "grease relubrication procedures", page 98). Before regreasing, the appearance of the used grease and the degree of contamination due to particles and water should be checked. The seals should also be checked for wear, damage and leaks. When the condition of the grease and associated components is found to be satisfactory, the relubrication interval can be gradually increased.

Very short intervals

If the determined value for the relubrication interval t_f is too short for a particular application, it is recommended to:

- check the bearing operating temperature.
- check whether the grease is contaminated by solid particles or fluids,
- check the bearing application conditions such as load or misalignment,
- consider a more suitable grease.

Grease relubrication procedures


The choice of the relubrication procedure generally depends on the application and on the relubrication interval t_f obtained. There are three primary options for grease relubrication including: replenishment, renewal, and continuous relubrication.


Replenishment is a convenient and preferred procedure if the relubrication interval is shorter than six months. It allows uninterrupted operation and provides a lower steady state temperature than continuous relubrication.

Renewing the grease fill is generally recommended when the relubrication interval is longer than six months. This procedure is often applied as part of a bearing maintenance schedule, e.g. in railway applications.

Continuous relubrication is used when the estimated relubrication interval is short, e.g. due to the adverse effects of contamination, or when other procedures of relubrication are inconvenient because access to the bearing is difficult. However, continuous relubrication is not recommended for applications with high rotational speeds since the intensive churning of the grease can lead to very high operating temperatures and destruction of the grease thickener structure.

When using different bearings in an assembly, it is common practice to apply the lowest estimated relubrication interval for both bearings. The guidelines and grease quantities for the three alternative procedures are given in the following sections.

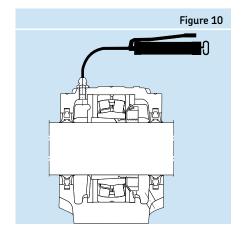

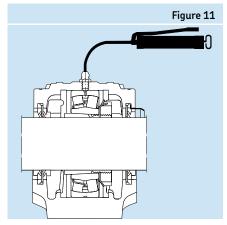

Replenishment

At initial installation, the bearing should be completely filled with grease, while the free space in the housing should be partly filled. Depending on the intended method of replenishment, the following grease fill percentages for this free space in the housing are recommended:

- 40% when grease is added from the side of the bearing (**Figure 10**),
- 20% when grease is added through the annular groove and lubrication holes in the bearing outer or inner ring (Figure 11).

Suitable quantities for replenishment are as follows:

- G_p (oz)= D(in) x B(in) x 0.1 for relubrication from the side of a bearing
- G_p (g)= D(mm) x B(mm) x 0.005 for relubrication from the side of a bearing
- G_p (oz)= D(in) x B(in) x 0.04 for relubrication through the outer or inner ring
- G_p (g)= D(mm) x B(mm) x 0.002 for relubrication through the outer or inner ring where
- G_p (oz)= grease quantity in ounces to be added when replenishing G_p (g)= grease quantity in grams to be
- added when replenishing
 D = bearing outside diameter
- B = total bearing width

98 **5K**F

If contact seals are used in the bearing arrangement, attention should be given to the direction of the contact lip. If the lip is facing the bearing, then purging is unlikely and an exit hole in the housing should also be provided (Figure 10) so that excessive amounts of grease will not build up in the space surrounding the bearing. An excessive build-up of grease can result in a permanent increase in bearing temperature. The exit hole should be plugged if high-pressure water is used for cleaning.

To be sure that fresh grease actually reaches the bearing and replaces the old grease, the lubrication duct in the housing should either feed the grease adjacent to the outer ring side face (Figure 10 and Figure 12) or, better still, into the bearing. To facilitate efficient lubrication of some bearing types, e.g. spherical roller bearings, are provided with an annular groove and/or lubrication holes in the outer or inner ring (Figure 11 and Figure 13).

To effectively replace old grease, replenish while the machine is operating. In cases where the machine is not in operation, if possible, the bearing should be rotated during replenishment. When lubricating the bearing directly through the inner or outer ring, the fresh grease is most effective in replenishment; therefore, the amount of grease needed is reduced when compared with relubricating from the side. It is assumed that the lubrication ducts were already filled with grease during the mounting process. If not, a greater relubrication quantity during the first replenishment is needed to compensate for the empty ducts.

Where long lubrication ducts are used, check whether the grease can be adequately pumped if ambient temperatures are low.

The complete grease fill should be replaced when the free space in the housing can no longer accommodate additional grease, i.e. approximately above 75% of the housing free volume. When relubricating from the side and starting with 40% initial fill of the housing, the complete grease fill should be replaced after approximately five replenishments. Since replenishment involves a lower initial fill of the housing and a reduced topping-up quantity when relubricating the bearing directly through inner or outer ring, renewal will only be required in exceptional cases.

Renewing the grease fill

When renewal of the grease fill is made at the estimated relubrication interval or after a certain number of replenishments, the used grease in the bearing arrangement should be completely removed and replaced by fresh grease. Filling the bearing and housing with grease should be done in accordance with the guidelines given under "Replenishment", page 98.

To enable renewal of the grease fill, the bearing housing should be easily accessible and easily opened. The cap of split housings and the covers of one-piece housings can usually be removed to expose the bearing cavity. After removing the used grease, fresh grease should first be packed into the bearing (between the rolling elements). Care should be taken to see that contaminants are not introduced into the bearing or housing when relubricating, and the grease itself should be protected. The use of grease resistant gloves is recommended to prevent any allergic skin reactions.


When housings are less accessible but are provided with grease nipples and exit holes, it is possible to completely renew the grease fill by relubricating several times in close succession until it can be assumed that all old grease has been pressed out of the housing. This procedure requires much more grease than is needed for manual renewal of the grease fill. In addition, this method of renewal has a limitation with respect to operational speeds: at high speeds it can lead to unacceptably high operating temperatures caused by excessive churning of the grease.


Continuous relubrication

This procedure is used when the calculated relubrication interval is very short, i.e. due to the adverse effects of contamination, or when other procedures of relubrication are inconvenient, e.g. access to the bearing is difficult. Due to the excessive churning of the grease, which can lead to increased temperature, continuous lubrication is only recommended when rotational speeds are low i.e. at speed factor:

- n x d_m < 150,000 for ball bearing
- $n \times d_m < 75,000$ for roller bearings

In these cases the initial grease fill of the housing may be 100% and the quantity for

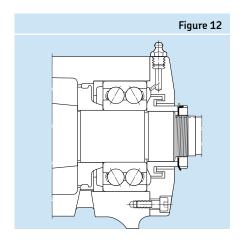

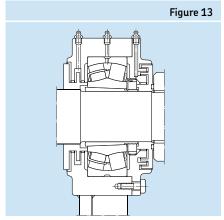

relubrication per time unit is derived from the equations for G_p under "Replenishment" by spreading the relevant quantity over the relubrication interval. When using continuous relubrication, check whether the grease can be adequately pumped if ambient temperatures are low. Continuous lubrication can be achieved via single-point or multi-point automatic lubricators, e.g. SKF SYSTEM $24^{\$}$ or SYSTEM MultiPoint.

SKF solid oil (W64)

SKF Solid Oil - The third lubrication choice

SKF Solid Oil has been developed specifically for applications where conventional lubrication either cannot be used or has been unsuccessful and extended service life is desired. These can include applications where lack of accessibility makes lubrication impossible or when very good contaminant exclusion is required.

Solid Oil is a polymer matrix, saturated with a lubricating oil, which completely fills the internal space in a bearing, and encapsulates the cage and rolling elements. The oil-filled polymer material is pressed into the bearing. Solid Oil uses the cage as a reinforcement element and rotates with the cage. The oil within the Solid Oil pack is released and retained on the bearing surfaces by surface tension. Oil comprises approximately 70% of the weight of the Solid Oil pack.

Limitations

The operating range for Solid Oil is -40° F to 185° F (-40° to 85° C), although brief periods of operation up to 200° F (93° C) can be tolerated. The limiting speed is lower than standard grease lubrication, and this speed depends on the bearing type.

Unique advantages of solid oil

- It keeps the oil in position
- It keeps contaminants out
- It makes maintenance unnecessary (no relubrication needed)
- It is environmentally friendly
- It is resistant to most chemicals
- It can withstand large "g" forces

SKF bearing type	Maximum Nd _m with Solid Oil
Single row deep groove ball	300,000
Angular contact ball	150,000
Self-aligning ball	150,000
Cylindrical roller	150,000
Spherical roller "E" type	42,500
Spherical roller "non-E" type	85,000
Taper roller	45,000
Ball bearing with nylon cages (included Y-range unit ball bearings)	40,000
Needle roller	not recommended
Toroidal roller	not recommended
Ndm = RPM x (bore+OD)/2 in mm	
* Maximum Ndm values are for open and shielded bearings.	For sealed bearings, use 80% of the value listed.

Version	Description	Approximate (@ 104° F (40° C)	oil viscosity (cSt) @ 212° F (100° C)
W64	Standard	143	18
W64E	Medium load	430	49
W64H	Heavy load	933	80
W64F	Food grade (USDA H1)	214	25
W64J	Low temperature	2	6
W64JW	Silicon free	150	28

SKF lubrication systems

SKF offers a variety of lubrication systems for industrial machinery. These systems are categorized as centralized and minimum quantity lubrication.

Centralized lubrication


A pump delivers grease or oil from a central reservoir to the friction points and machine elements in a fully automated manner. The lubrication is supplied as often as necessary and in the correct quantity, providing all lube points with an optimal supply of lubricant. These types of systems considerably reduce the consumption of lubricant.


- Total loss lubrication systems (single-line)
- Total loss lubrication systems (dual-line)
- Total loss progressive systems
- Circulating oil lubrication systems
- Hydrostatic lubrication systems
- Special solutions (chain)





With minimal quantity lubrication, it's possible to achieve effective lubrication of the cutting process with extremely small quantities of oil. The result is not only higher productivity due to faster cutting speeds but also longer tool lives and savings on cooling lubricants in the value-added process.

Air-oil lubrication systems Compressed air-oiling LubriLean®

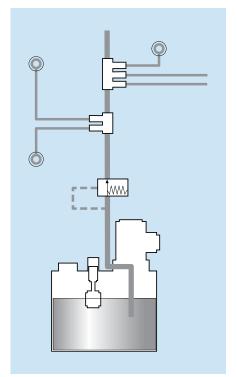

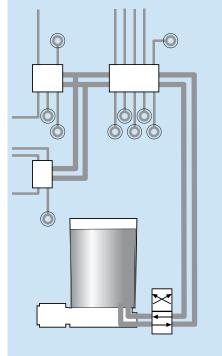

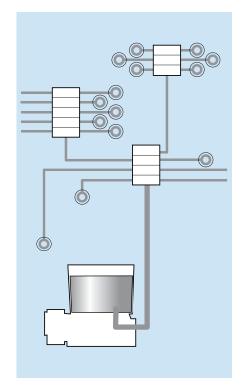

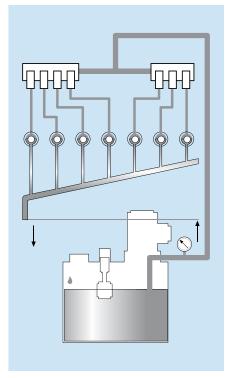

5KF

Troubleshooting

Bearings that are not operating properly usually exhibit identifiable symptoms. This section presents some useful hints to help identify the most common causes of these symptoms as well as practical solutions wherever possible. Depending on the degree of bearing damage, some symptoms may be misleading and in many cases are the result of secondary damage. To effectively trouble-shoot bearing problems, it is necessary to analyze the symptoms according to those first observed in the applications. Symptoms of bearing trouble can usually be reduced to a few classifications, which are listed below.

Each symptom shown below is broken down into categories of conditions that lead to those symptoms. Each condition has a numerical code that can be referenced for practical solutions to that specific condition. Additional solutions appear throughout this guide.

Note: Troubleshooting information shown on these pages should be used as guidelines only. Consult your SKF representative or machine manufacturer for specific maintenance information.

Common bearing symptoms

Excessive heat
Excessive noise
Excessive vibration
Excessive shaft movement
Excessive torque to rotate shaft

Common bearing symptoms

Solution code	
	Excessive heat
	Lubrication
1	Wrong type of lubricant, i.e. NLGI # of grease or Viscosity Grade (VG) of oil
2	Wrong lubrication system – Ex. circulating oil required but bearing is on static oil
3	Insufficient lubrication – Too low oil level or too little grease, e.g. excessive leakage
4	Excessive lubrication – Too high oil level or too much grease without a chance to purge
	Insufficient bearing internal clearance
5	Wrong bearing internal clearance selection
6	Excessive shaft interference fit or oversized shaft diameter
7	Excessive housing interference fit or undersized housing bore diameter
8	Excessive out-of-round condition of shaft or housing - Bearing is pinched in warped housing
9	Excessive drive-up on tapered seat
10	Large temperature difference between shaft and housing (housing is much cooler than shaft)
11	Shaft material expands more than bearing steel (300 series stainless steel shaft)
	Improper bearing loading
12	Skidding rolling elements as a result of insufficient load
13	Bearings are excessively preloaded as a result of adjustment
14	Bearings are cross-located and shaft can no longer expand, inducing excessive thrust loads on bearings
15	Unbalanced or out-of-balance condition creating increased loading on bearing
16	Overloaded bearings as a result of changing application parameters, ex. going from a coupling to a belt drive
17	Linear misalignment of shaft relative to the housing is generating multiple load zones and higher internal loads
18	Angular misalignment of shaft relative to the housing is generating a rotating misalignment condition
19	Wrong bearing is fixed
20	Bearing installed backwards causing unloading of angular contact type bearings or filling notch bearings

Common bearing symptoms

Solution code	
	Excessive heat
21 22 23 24 25 26	Sealing conditions Housing seals are too tight or are rubbing against another component other than the shaft Multiple seals in housing Misalignment of housing seals Operating speed too high for contact seals in bearing Seals not properly lubricated, i.e. felt seals not oiled Seals oriented in the wrong direction and not allowing grease purge
	Excessive noise
1	Metal-to-metal contact Oil film too thin for operating conditions
1	Temperature too high Speed very slow
3	Insufficient quantity of lubrication • Never lubricated bearing • Leakage from worn or improper seals • Leakage from incompatibility
12	Rolling elements skidding Inadequate loading to properly seat rolling elements Lubricant too stiff
	Contamination
27 28 29	Solid particle contamination entering the bearing and denting the rolling surfaces Solids left in the housing from manufacturing or previous bearing failures Liquid contamination reducing the lubricant viscosity
	Looseness
30 31 32 33 34	Inner ring turning on shaft because of undersized or worn shaft Outer ring turning in housing because of oversized or worn housing bore Locknut is loose on the shaft or tapered sleeve Bearing not clamped securely against mating components Too much radial / axial internal clearance in bearings
35 36 37 38 39 27 40 41 1,2,3,4	Surface damage Rolling surfaces are dented from impact or shock loading Rolling surfaces are false-brinelled from static vibration Rolling surfaces are spalled from fatigue Rolling surfaces are spalled from surface initiated damage Static etching of rolling surface from chemical/liquid contamination Particle denting of rolling surfaces from solid contamination Fluting of rolling surfaces from electric arcing Pitting of rolling surfaces from moisture or electric current Wear from ineffective lubrication Smearing damage from rolling element skidding

Common bearing symptoms

Solution code				
	Excessive noise			
	Rubbing			
23	Housing seals are misaligned causing rubbing, i.e. insufficient clearance in labyrinth seals			
42 32	Locknut tabs are bent and are rubbing against bearing seals or cage Adapter sleeve not properly clamped and is turning on the shaft			
33	Spacer rings are not properly clamped and are turning on the shart			
	Excessive vibration			
	Metal-to-metal contact			
12	Rolling elements skidding			
	Inadequate loading to properly seat rolling elements			
	Lubricant too stiff			
	Contamination			
27	Solid particle contamination entering the bearing and denting the rolling surfaces			
28	Solids left in the housing from manufacturing or previous bearing failures			
	Looseness			
30	Inner ring turning on shaft because of undersized or worn shaft			
31	Outer ring turning in housing because of oversized or worn housing bore			
	Surface damage			
35	Rolling surfaces are dented from impact or shock loading			
36	Rolling surfaces are false-brinelled from static vibration			
37	Rolling surfaces are spalled from fatigue			
38 39	Rolling surfaces are spalled from surface initiated damage Static etching of rolling surface from chemical/liquid contamination			
27	Particle denting of rolling surfaces from solid contamination			
40	Fluting of rolling surfaces from electric arcing			
41	Pitting of rolling surfaces from moisture or electric current			
1, 2, 3, 4	Wear from ineffective lubrication			
12	Smearing damage from rolling element skidding			
	Excessive shaft movement			
	Looseness			
30	Inner ring loose on shaft because of undersized or worn shaft			
31	Outer ring excessively loose in housing because of oversized or worn housing bore			
33	Bearing not properly clamped on shaft / in housing			
	Surface damage			
27	-			
37 38	Rolling surfaces are spalled from fatigue Rolling surfaces are spalled from surface initiated damage			
1, 2, 3, 4	Wear from ineffective lubrication			
_, _, 0, .				
	Design			
5	Wrong bearing clearance selected for application, i.e. too much endplay in bearing			

Common bearing symptoms

Solution code	
	Excessive torque to rotate shaft
	Preloaded bearing
6, 7	Excessive shaft and housing fits
8	Excessive out-of-round condition of shaft or housing causing egg-shaped condition
8	Excessive out-of-round condition of shaft or housing
	Bearing is pinched in warped housing
9	Excessive drive-up on tapered seat
10	Large temperature difference between shaft and housing (housing is much cooler than shaft)
11 5	Shaft material expands more than bearing steel (stainless steel shaft) Wrong clearance selected for replacement bearing, i.e. preloaded bearing instead of clearance bearing
J	
	Sealing drag
21	Housing seals are too tight or are rubbing against another component other than the shaft
22 23	Multiple seals in housing Misalignment of housing seals
25	Seals not properly lubricated, i.e. felt seals not oiled
	Surface damage
37	Rolling surfaces are spalled from fatigue
38 40	Rolling surfaces are spalled from surface initiated damage Fluting of rolling surfaces from electric arcing
40	
	Design
43	Shaft and/or housing shoulders are out of square
44	Shaft shoulder too large and is rubbing against seals/shields

Solution code	Condition	Practical solution
1	Wrong type of lubricant	Review application to determine the correct base oil viscosity grade (VG) and NLGI required for the specific operating conditions. Reference page 87 of this catalog for specific lubrication guidelines. Metal-to-metal contact can lead to excessive heat and premature wear, ultimately leading to more noise.
2	Wrong lubrication system	Review the bearing speed and operating temperature to determine if grease, static oil, circulating oil, oil mist, or jet oil is required. Example: bearing may be operating too fast for static oil and may require the cooling effects of circulating oil. Consult the equipment manufacturer for specific requirements or the bearing manufacturer. Also reference the speed rating values provided in the manufacturer's product guide. The SKF values can be found in the Interactive Engineering Catalog: www.skf.com/portal/skf/home/products.
3	Insufficient lubrication	Static oil level should be at the center of the bottommost rolling element when the equipment is not rotating. Ensure the housing is vented properly to avoid back pressure, which can cause a malfunction of constant oilers. Check seals for wear. Check housing split for leaks and apply a thin layer of gasket cement if necessary. The grease pack should be 100% of the bearing and up to the bottom of the shaft in the housing. If there is very little housing cavity alongside the bearing, then the grease quantity may need to be reduced slightly to avoid overheating from churning. See the Lubrication section starting on page 87.
4	Excessive lubrication	Too much lubrication can cause excessive churning and elevated temperatures. Make sure the oil level is set to the middle of the bottommost rolling element in a static condition. Inspect oil return holes for blockages. For grease lubrication, the bearing should be packed 100% full and the housing cavity should be filled up to the bottom of the shaft. If there is very little housing cavity alongside the bearing, then the grease quantity may need to be reduced slightly to avoid overheating. Make sure grease purging is possible, either through the seals or a drain plug. Make sure the seals are oriented properly to allow excess lubricant purge while keeping contaminant out. See the Lubrication section starting on page 87.

Solution code	Condition	Practical solution
5	Wrong bearing internal clearance selection	Check whether overheated bearing had internal clearance according to original design specification. If more clearance is required for the application, SKF Applications Engineering should be consulted for the effects of additional clearance on the equipment as well as the bearing.
6	Excessive shaft interference fit or oversized shaft diameter	Interference fits will reduce bearing internal clearance. Therefore, the proper fits must be selected based on the application conditions. Using an interference fit on both the shaft and in the housing will more than likely eliminate all internal bearing clearance, resulting in a hot running bearing. Reference page 54 for proper fit tolerances.
7	Excessive housing interference fit or undersized housing bore diameter	Housing interference will reduce bearing internal clearance by compressing the outer ring. Therefore, the proper fits must be selected based on the application conditions. Reference page 55 for proper fit selection. For a rotating inner ring load, an interference fit in the housing will cause the "floating" bearing to become fixed, generating thrust load and excessive heat.
8	Bearing is mounted on/in an out-of-round component	Check the housing bore for roundness and re-machine if necessary. Ensure that the supporting surface is flat to avoid soft foot. Any shims should cover the entire area of the housing base. Make sure the housing support surface is rigid enough to avoid flexing. Also inspect the shaft to ensure that it is not egg shaped. Specific tolerances are provided on page 81. In addition to generating more heat, an egg shaped housing can also cause the outer ring of the bearing to become pinched and restrict its axial expansion if it is the "floating" bearing.

Solution code	Condition	Practical solution
9	Excessive drive-up on tapered seat	Excessive drive-up on a tapered seat will reduce the bearing internal clearance and cause higher operating temperatures and risk of ring fracture. Loosen the locknut and sleeve assembly. Retighten it sufficiently to clamp the sleeve onto the shaft but be sure the bearing turns freely. Use the clearance reduction method for spherical roller bearings (page 18) and the axial drive-up/tightening angle method (page 15) for self-aligning ball bearings. You may also use www.skf.com/mount for mounting instructions.
10	Large temperature difference between shaft and housing	When the shaft is much hotter than the housing, bearing internal clearance is reduced and a preloaded bearing can result, causing high operating temperatures. A bearing with increased internal clearance is recommended for such applications to prevent preloading, e.g. CN to C3, C3 to C4, etc.
11	Shaft material expands more than bearing steel	When the shaft material has a higher coefficient of thermal expansion than the bearing, internal clearance is reduced. Therefore, for certain stainless steel shafting (300 series), either a slightly looser shaft fit is required or a bearing with increased radial internal clearance is required, e.g. CN to C3, C3 to C4, etc. The inverse applies to housing materials with greater expansion rates than bearing steel, e.g. aluminum. A slighter tighter fit may be required to prevent the outer ring from turning when the equipment comes up to equilibrium temperature.
12	Skidding rolling elements as a result of insufficient load	Every bearing requires a minimum load to ensure proper rolling and avoid skidding of the rolling elements. If the minimum load requirements cannot be met, then external spring type devices are required or perhaps a different bearing style with a different internal clearance is required. This problem is more common in pumps with paired angular contact ball bearings when there is a primary thrust in one direction and the back bearing becomes unloaded. The skidding of the rolling elements generates excessive heat and noise. Extremely stiff greases can also contribute to this condition, especially in very cold climates. Reference the SKF Interactive Engineering Catalog at www.skf.com/portal/skf/home/products for specific minimum load values.
13	Bearings are excessively preloaded as a result of adjustment	If the bearings have to be manually adjusted in order to set the endplay in a shaft, over-tightening the adjustment device (locknut) can result in a preloaded bearing arrangement and excessive operating temperatures. In addition to high operating temperatures, increased torque will also result. Ex. taper roller bearings or angular contact ball bearings with one bearing on each end of the shaft. Check with the equipment manufacturer for the proper mounting procedures to set the endplay in the equipment. The use of a dial indicator is usually required to measure the shaft movement during adjustment.

Solution code	Condition	Practical solution
14	Bearings are cross- located and shaft can no longer expand	When bearings are cross located and shaft expansion can no longer occur, thrust loading will be generated between both bearings, causing excessive operating temperature and increased torque. In addition, higher internal loading also occurs, which can lead to premature fatigue spalling. Insert shim between housing and cover flange to relieve axial preloading of bearing. Move the covers in one of the housings outwards and use shims to obtain adequate clearance between the housing cover and the outer ring sideface. Apply an axial spring load on the outer ring, if possible, to reduce axial play of the shaft. Determining the expected shaft growth should help establish how much clearance is required between the bearing outer ring side face and the housing cover. Shims Shims Shims
15	Unbalanced or out-of-balanced condition creating increased loading and heat on bearing	An unbalanced loading condition can generate a rotating outer ring load zone that will significantly increase the operating temperature of the bearing, as well as increasing the load on the bearing. It will also cause vibration and outer ring creeping/turning. Inspect the rotor for a build-up of dirt/contaminant. Rebalance the equipment.
16	Overloaded bearings as a result of changing application parameters. Ex. Going from a coupling to a belt drive	Increasing the external loading on a bearing will generate more heat within the bearing. Therefore, if a design change is made on a piece of equipment, the loading should be reviewed to make sure it has not increased. Examples would be going from a coupling to a sheave, increasing the speed of a piece of equipment, etc. The changes in the performance of the equipment should be reviewed with the original equipment manufacturer.
17	Linear misalignment of shaft relative to the housing is generating multiple load zones and higher internal loads	This type of misalignment will cause an additional load zone within the bearing, assuming it is not a misalignable bearing, and will lead to additional loading and heat generation. The alignment of the equipment should be checked and corrected to the original equipment manufacturer's specifications or within the bearing's misalignment limitations. Linear misalignment misalignment

Solution code	Condition	Practical solution
18	Angular misalignment of shaft relative to the housing is generating a rotating misalignment condition	This type of misalignment refers to a bent shaft, which causes the rolling elements to shift positions across the raceways. This shifting of load zone position causes internal sliding and elevated temperatures. The shaft should be inspected and repaired accordingly. Linear misalignment misalignment
19	Wrong bearing is fixed	Depending upon the type of loading and bearings used in an application, if the radial bearing is accidentally "fixed" and it is not a thrust type bearing, excessive temperatures can result. In addition, in the case of a lightly loaded double row bearing, thrust load can cause unloading of the inactive row and cause smearing damage. Make sure the bearing positions are noted and the new bearings replaced according to the manufacturer's recommendations. If no records are available and the equipment manufacturer is no longer around, then the bearing manufacturer should be consulted to determine the proper bearing orientation.
20	Bearing installed backwards	Separable bearings as well as directional type bearings must be installed in the proper orientation to function properly. Single row angular contact ball bearings as well as taper roller bearings are directional and will separate if installed backwards. Filling notch bearing types such as double row angular contact ball bearings are also directional because of the filling notch. Check the equipment manual or consult with the bearing manufacturer for proper orientation. Filling notch Marking Axial load
21	Housing seals are too tight or are rubbing against another component other than the shaft	Make sure the shaft diameter is correct for the specific spring-type seal being used to avoid excessive friction. Also investigate the mating components next to the seals and eliminate any rubbing that is not appropriate. Make sure the seals are lubricated properly, i.e. felt seals should be soaked in oil prior to installation.
22	Multiple seals in housing	If multiple contact seals are being used to help keep out contamination, increased friction and therefore heat will result. Before adding additional seals to an application, the thermal effects on the bearing and lubricant should be considered in addition to the extra power required to rotate the equipment.

Solution code	Condition	Practical solution
23	Misalignment of housing seals	Any misalignment of the shaft relative to the housing can cause a clearance or gap type seal to rub. This condition can cause elevated temperatures, noise, and wear during the initial run-in period, not to mention compromising the sealing integrity. The alignment should be checked and corrected accordingly.
24	Operating speed too high for contact seals in bearing	If the speed of the equipment has been increased or if a different sealing closure is being used, the bearing should be checked to make sure it can handle the speed. Contact seals will add more heat compared to an open or shielded bearing. The bearing manufacturer should be contacted to ensure that the new operating conditions are within the speed limitations of the bearing.
25	Seals not properly lubricated, i.e. felt seals not oiled	Dry running contact seals can add significant heat to the system. Therefore, make sure the seals are properly lubricated upon start up of new or rebuilt equipment. Normally the lubricant in the housing will get thrown outward towards the seals and automatically lubricate them. Properly lubricated seals will run cooler and will also be more effective at sealing since any gaps between the contacts will be filled with a lubricant barrier. Proper lubrication will also reduce premature wear of the seals.
26	Seals oriented in the wrong direction and not allowing grease purge	Depending upon the requirements of the application, the contact seals may need to be oriented in a specific direction to allow purging of lubricant and keep out contamination, or the opposite in order to prevent oil leakage. Check with the equipment manufacturer to determine the proper orientation of the seals for the equipment. Seal lips that face outward will usually allow purging of excess lubricant and prevent ingress of external contaminants. For SKF Mounted Products, see the mounting instructions section starting on page 38.

Solution code	Condition	Practical solution
27	Solid particle contamination entering the bearing and denting the rolling surfaces	External contamination will cause surface damage to the rolling surfaces and result in increased noise, vibration, and temperature rise in some cases. The seals should be inspected and the relubrication interval may need to be shortened. Supplying smaller quantities of fresh grease on a more frequent basis will help purge contaminated grease from the bearing/housing cavity. Reference the Lubrication section on Page 87 for proper relubrication intervals and avoid over lubricating as this can lead to even a further increase in bearing operating temperature.
28	Solids left in the housing from manufacturing or previous bearing failures	Particle denting can also occur as a result of solids left in the bearing housing from a previous failure. Thoroughly clean the housing before placing a new bearing in it. Remove any burrs and ensure that all machined surfaces are smooth. As with external contamination, internal contamination will also dent the rolling surfaces and result in increased noise, vibration, and temperature.
29	Liquid contamination reducing the lubricant viscosity	Liquid contamination will reduce the viscosity of a lubricant and permit metal-to-metal contact. In addition, corrosive etching of the rolling surfaces can also take place. These conditions will lead to increased temperature, wear, and noise. The housing seals should be checked to ensure that they are capable of preventing the ingress of liquid contamination. The relubrication interval may need to be shortened. Supplying smaller quantities of fresh grease on a more frequent basis will help purge contaminated grease from the bearing/housing cavity.
30	Inner ring turning on shaft because of undersized or worn shaft	When an inner ring turns relative to the shaft, increased noise can occur as well as wear. Proper performance of bearings is highly dependent on correct fits. Most applications have a rotating shaft in which the load is always directed in one direction. This is considered a rotating inner ring load and requires a press fit to prevent relative movement. See page 51 for the proper fitting practice.
31	Outer ring turning in housing because of oversized or worn housing bore	When an outer ring turns relative to the housing, increased noise can occur as well as wear. Proper performance of bearings is highly dependent on correct fits. Most applications have a stationary housing in which the load is always directed in one direction. This is considered a stationary outer ring load and can have a loose fit with no relative movement. See page 51 for the proper fitting practice. An unbalanced shaft load can also lead to a outer ring turning condition, even when the fits are correct. Eliminate the source of the unbalance.

Solution code	Condition	Practical solution
32	Locknut is loose on the shaft or tapered sleeve	A loose locknut or washer on the shaft or adapter sleeve will lead to increased noise, not to mention poor clamping and positioning of the bearing. Make sure the locknut is properly locked with the lockwasher tab when the mounting is completed. See mounting instructions starting on page 11.
33	Bearing not clamped securely against mating components	A bearing that is not properly clamped against its adjacent components will cause increased noise as well as potential problems with the bearing performance. An example would be a pair of angular contact ball bearings that are not properly clamped. This would cause an increase in axial clearance in the bearing pair and potentially lead to skidding damage, noise, and lubrication problems. Not properly clamping the bearing will also effect to positioning of the shaft. Make sure the bearing is properly locked against its shaft shoulders or spacers with its locking device.
34	Too much radial/axial internal clearance in bearings	Too much radial or axial clearance between the raceways and rolling elements can lead to increased noise as a result of the balls/rollers being free to move around once outside the load zone area. The use of springs or wave washers can provide adequate side load to keep the rolling elements loaded at all times. In addition to noise, too much clearance can also detrimentally effect the performance of the bearings by allowing skidding of the rolling elements.
35	Rolling surfaces are dented from impact or shock loading	Impact or shock load will lead to brinelling or denting of the rolling surfaces. This condition will lead to increased noise, vibration, and temperature. Review the mounting procedures and ensure that no impact is passed through the rollers. For example, if the inner ring has a press fit onto the shaft, do not apply pressure to the outer ring side face in order to push the inner ring onto the shaft. Never hammer any part of a bearing when mounting. Always use a mounting sleeve. The source of impact or shock loading needs to be identified and eliminated.

Solution code	Condition	Practical solution
36	Rolling surfaces are false-brinelled from static vibration	Static vibration while the equipment is not rotating will lead to false-brinelling of the rolling surfaces. This damage typically occurs at ball or roller spaced intervals and is predominantly on the raceway surfaces. This common problem leads to noise in equipment that sits idle for longer periods of time next to other equipment that is operating, i.e. back-up equipment. Periodic rotation of the shaft will help minimize the effects of the static vibration. Isolating the equipment from the vibration would be the ideal solution but isn't always realistic.
37	Rolling surfaces are spalled from fatigue	Spalling from fatigue is rare since most bearings rarely reach their design lives (L_{10}) . There is usually another condition that will lead to bearing failure such as contamination, poor lubrication, etc. Review the bearing life calculations based on the application loads and speeds.
38	Rolling surfaces are spalled from surface initiated damage	Surface initiated damage includes conditions such as brinelling from impact, false brinelling from vibration, water etching, particle denting, arcing, etc. These types of conditions create surface disparities that can eventually lead to spalling. Identify the source of the condition and correct accordingly, e.g. eliminate impact through the rolling elements during mounting, replacing seals to prevent ingress of contamination, ground equipment properly, etc.
39	Static etching of rolling surface from chemical/liquid contamination (Water, acids, paints or other corrosives)	Static etching from chemical /liquid contamination typically occurs when the equipment is idle and is most common for grease lubricated bearings. The damage usually occurs at intervals equal to the rolling element spacing. For grease lubrication, more frequent relubrication with smaller quantities of grease will help flush out the contaminated grease. Also, periodic rotation of the shaft is also beneficial in minimizing the static etching damage. Improving the sealing by installing a protective shield and/or flinger to guard against foreign matter would be helpful.
40	Fluting of rolling surfaces from electric arcing	Fluting of the rolling surface is most commonly attributed to passage of electric current across the bearing. However, in some rare cases, a washboard appearance can be the result of static vibration. For electric arcing damage, grounding the equipment properly is the first recommendation. If proper grounding does not correct the problem, then alternative solutions include an insulating sleeve in the housing bore, a bearing with an insulated outer ring (SKF VL0241 suffix), or a hybrid bearing with ceramic rolling elements (SKF HC5 suffix, MRC HYB#1 suffix).
41	Pitting of rolling surfaces from moisture or electric current	Pitting of the rolling surfaces is the result of either corrosive contamination or electric pitting. Both of these conditions will cause increased noise. See solution codes 39 and 40 above.

Solution code	Condition	Practical solution
42	Lockwasher tabs are bent and are rubbing against bearing seals or cage	New locknuts and washers are recommended for new bearing replacements. Old lock washers may have bent tabs that can rub against the bearing cage or seals and generate noise in addition to wear. Used lock washers may also have a damaged locking tab or anti-rotation tab that isn't apparent and may shear off later.
43	Shaft and/or housing shoulders are out of square with the bearing seat	Out of square shaft/housing shoulders can result in increased rotational torque as well as increased friction and heat. See also solution codes 17 and 18. Re-machine parts to obtain correct squareness. Reference page 81.
44	Shaft shoulder is too large and is rubbing against seals/shields	Re-machine the shaft shoulder to clear the seals/shields. Check that the shoulder diameter is in accordance with SKF recommendations shown in the SKF General Catalog.

Bearing damages and their causes

Rolling bearings are one of the most important components in today's high-tech machinery. When bearings fail, costly machine downtime can occur. Selecting the correct bearing for the application is only the first step to help ensure reliable equipment performance. The machine operating parameters such as loads, speed, temperature, running accuracy, and operating requirements are needed to select the correct bearing type and size from a range of products available.

The calculated life expectancy of any bearing is based on five assumptions:


- 1. Good lubrication in proper quantity will always be available to the bearing.
- 2. The bearing will be mounted correctly.
- 3. Dimensions of parts related to the bearing will be correct.
- 4. There are no defects inherent in the bearing.
- 5. Recommended maintenance followed.

If all of these conditions are met, then the only reason for a bearing to fail would be from material fatigue. Fatigue is the result of shear stresses cyclically applied immediately below the load carrying surfaces and is observed as the spalling (or flaking) away of surface metal, as seen in the progression of **Figure 1** through **Figure 3**. The actual beginning of fatigue spalling is usually below the surface. The first sign is a microscopic subsurface crack, which cannot be seen nor can its effects be heard while the machine operates. By the time this subsurface crack reaches proportions shown in Figure 2. the condition should be audible. If the surrounding noise level is too great, a bearing's condition can be evaluated by using a vibration monitoring device, which is typically capable of detecting the spall shown in **Figure 1**. The time between beginning and advanced spalling varies with speed and load, but in any event it is typically not a sudden condition that will cause destructive failure within a matter of hours. Complete bearing failure and consequent damage to machine parts is usually avoided because of the noise the bearing will produce and the erratic performance of the shaft supported by the bearing.


Unfortunately, rarely all five conditions listed above are satisfied, allowing the bearing to achieve its design life. A common mis-

take in the field is to assume that if a bearing failed, it was because it did not have enough capacity. Because of this rationale, many people go through expensive retrofits to increase bearing capacity, and end up with additional bearing failures. Identifying the root cause of the bearing failure is the next step in ensuring reliable equipment performance. One of the most difficult tasks is identifying the primary failure mode and filtering out any secondary conditions that resulted from the primary mode of failure. This section of the Bearing Installation and Maintenance Guide will provide you with the tools to make an initial evaluation of the cause of your bearing problems.


Most bearing failures can be classified into two damage modes: pre-operational and operational. Pre-operational damage modes occur prior to or during bearing installation, while operational damage modes occur during the bearing service period.

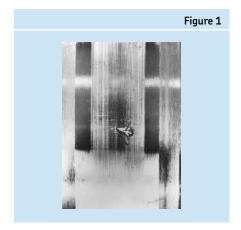

Early fatigue spalling

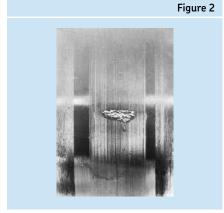

More advanced spalling

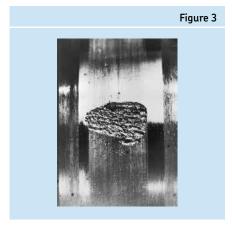

Greatly advanced spalling

Pre-operational damage mode causes


- 1. Incorrect shaft and housing fits.
- 2. Defective bearing seats on shafts and in housings.
- 3. Static misalignment.
- 4. Faulty mounting practice.
- 5. Passage of electric current through the bearing.
- 6. Transportation and storage.

Operational damage mode causes

- 7. Ineffective lubrication.
- 8. Ineffective sealing.
- 9. Static vibration.
- 10. Operational misalignment.
- 11. Passage of electric current through the bearing.

Because of the increasing attention given to rectifying bearing failures, the International Organization for Standardization (ISO) has developed a methodology for classifying bearing failures (ISO Standard 15243-2004E). This standard recognizes six primary failure modes, related to post-manufacturing sustained damage, and identifies the mechanisms involved in each type of failure (ISO terminology will be in *italic*). Most bearing damage can be linked back to the six modes shown below as well as their various subgroups. Most damage resulting

from these mechanisms is readily detected and monitored using vibration analysis and applicable devices. Thus condition monitoring techniques are vital to ensuring that bearings are removed before catastrophic damage occurs, preserving the failure evidence while preventing costly machine damage and loss of operation time.

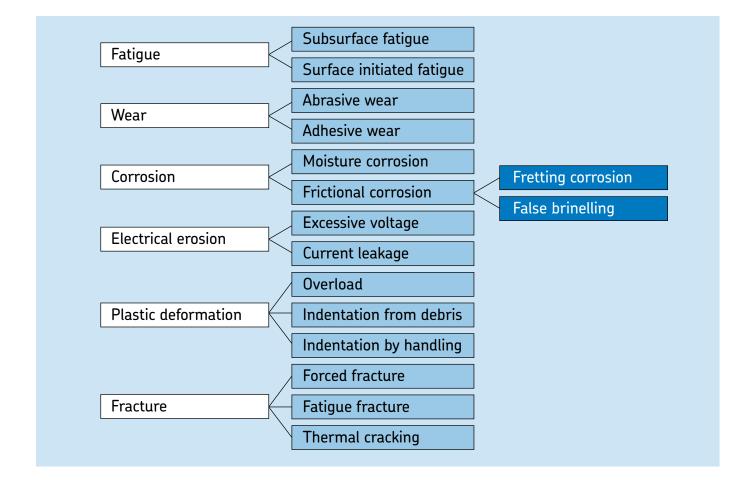

Definitions

Fatigue – a change in the material structure caused by the repeated stresses developed in the contacts between the rolling elements and raceways.

Subsurface fatigue – the initiation of micro-cracks at a certain depth under the surface

Surface initiated fatigue – flaking that originates at the rolling surfaces as opposed to subsurface.

Wear – the progressive removal of material resulting from the interaction of the asperities of two sliding or rolling contacting surfaces during service.

Abrasive wear – wear that occurs as a result of inadequate lubrication or contamination ingress.

Adhesive wear (smearing) – a transfer of material from one surface to another.

Corrosion – a chemical reaction on a metal surface.

Moisture corrosion – the formation of corrosion pits as a result of oxidation of the surfaces in the presence of moisture.

Frictional corrosion (fretting corrosion) – the oxidation and wear of surface asperities under oscillating micro-movements.

Frictional corrosion (false brinelling) – a formation of shallow depressions resulting from micro-movements under cyclic vibrations.

Electrical erosion – the removal of material from the contact surfaces caused by the passage of electric current.

Excessive voltage (electrical pitting) – sparking and localized heating from current passage in the contact area because of ineffective insulation.

Current leakage (electrical fluting) – the generation of shallow craters that develop into flutes that are equally spaced.

Plastic deformation – permanent deformation that occurs when the yield strength of the material is exceeded.

Overload (true brinelling) – the formation of shallow depressions or flutes in the raceways.

Indents from debris – when particles are over-rolled

Indents from handling – when bearing surfaces are dented or gouged by hard, sharp objects.

Fracture – when the ultimate tensile strength of the material is exceeded and complete separation of a part of the component occurs.

Forced fracture – a fracture resulting from a stress concentration in excess of the material's tensile strength.

Fatigue fracture – a fracture resulting from frequently exceeding the fatigue strength limit of the material.

Thermal cracking (heat cracking) – cracks that are generated by high frictional heating and usually occur perpendicular to the direction of the sliding motion.

Loading patterns for bearings

Now that the six bearing failure modes and eleven pre-operational and operational causes have been defined and identified respectively, we can proceed and help you identify the cause of your specific bearing problems. The pattern or load zone produced by the applied load and the rolling elements on the internal surfaces of the bearing can be an indication of the cause of failure. However, to benefit from a study of load zones, one must be able to differentiate between normal and abnormal loading patterns.

Figure 4 and Figure 5 illustrate how an applied radial load of constant direction is distributed among the rolling elements of a

rotating inner ring bearing. The large arrow in the 12 o'clock position represents the applied load and the series of small arrows from 4 o'clock to 8 o'clock represent how the load is shared/supported by the rolling elements in the bearing. The rotating ring will have a rotating 360° load zone while the stationary outer ring will show a constant or stationary load zone of approximately 150°.


Figure 6 and Figure 7 illustrate how an applied load of constant direction is distributed among the rolling elements of a rotating outer ring bearing. The large arrow in the 12 o'clock position represents the applied load and the series of small arrows from 10 o'clock to 2 o'clock represent how the load is shared/supported by the rolling elements in the bearing. The rotating outer ring will have a rotating 360° load zone

while the stationary inner ring will show a constant or stationary load zone of approximately 150°. These load zone patterns are also expected when the inner ring rotates and the load also rotates in phase with the shaft (i.e. imbalanced or eccentric loads). Even though the inner ring is rotating, its load zone is stationary relative to the inner ring and vice versa for the outer ring.


Figure 8 illustrates the effect of thrust load on a deep groove ball bearing load zone pattern. In addition, it also shows the effects of an excessive thrust load condition which forces the ball set to roll up towards the shoulder edge. Excessive thrust load is one condition where the load zones are a full 360° on both rings.

Figure 9 illustrates a combination of thrust and radial load on a deep groove ball


Load distribution within a bearing

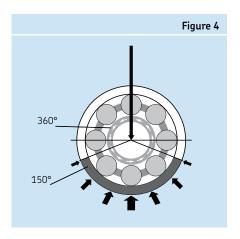


Normal load zone inner ring rotating relative to load

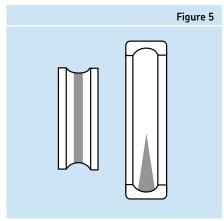



Outer ring rotating load zone, e.g. boat trailer wheel

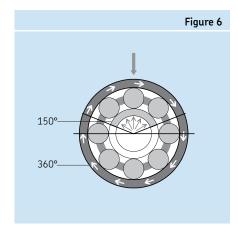

Normal load zone outer ring rotating relative to load or load rotating in phase with inner ring

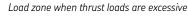

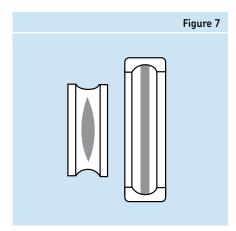

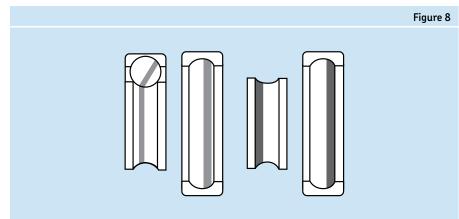


bearing. This produces a load zone pattern that is somewhere in between the two as shown. When a combined load exists, the load zone of the inner ring is slightly off center and the length of the load zone of the outer is greater than that produced by just radial load, but not necessarily 360°. For double row bearings, a combined load condition will produce load zones of unequal length. The thrust-carrying row will have a longer stationary load zone. If the thrust load is of sufficient magnitude, one row of rolling elements can become completely unloaded.

Figure 10 illustrates an internally preloaded bearing that is supporting primarily radial load. Both rings are loaded through 360°, but the pattern will usually be wider in the stationary ring where the applied load is combined with the internal preload. This condition can be the result of excessive interference fits on the shaft and in the housing. If the fits are too tight, the bearing can become internally preloaded by compressing the rolling elements between the two rings. Another possible cause for this condition is an excessive temperature difference between the shaft and housing. This too will significantly reduce the bearing internal clearance. Different shaft and housing materials having different thermal expansion coefficients can also contribute to this clearance reduction condition. A discussion of fitting practices appears on page 51.


Figure 11 illustrates the load zone found in a bearing that is radially pinched. The housing bore that the bearing was mounted into was initially out-of-round or became out-of-round when the housing was bolted to a non-flat surface. In this case, the outer ring shows two load zones. However, two or more load zones are possible in some cases depending upon the chuck that holds the housing during machining. An example would be a 3-point out-of-round condition. Multiple load zones will dramatically increase the bearing operating temperature as well as the internal loads.

Figure 12 illustrates the load zone produced when the outer ring is misaligned relative to the shaft axis. This condition can occur when the shaft deflects or if the bearings are in separate housings that do not have concentric housing bores.


Load zone when thrust loads are excessive

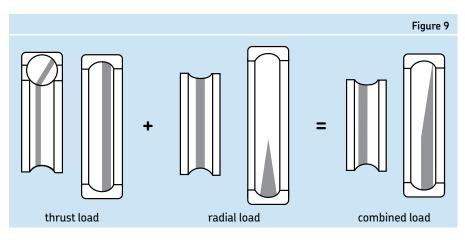


Load zone from internally preloaded bearing supporting radial load

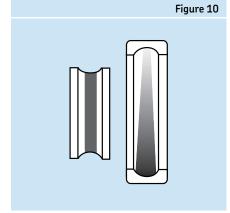

Load zones produced by out-of-round housing pinching outer ring

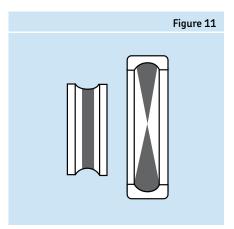

Load zone when outer ring is misaligned relative to shaft axis (e.g. shaft deflection)

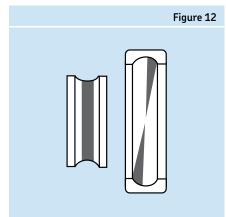

Load zones when inner ring is misaligned relative to shaft axis (e.g. bent shaft)

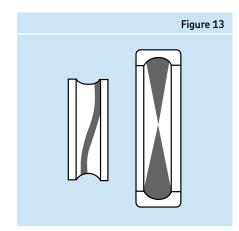


Figure 13 illustrates the load zone produced when the inner ring is misaligned relative to the shaft axis. This condition can occur when the shaft is bent and generates what is referred to as a dynamic misalignment condition.

Being familiar with the basic load zone patterns and descriptions, the following damage mode causes should be more meaningful. As mentioned earlier, most bearing failures can be classified into two damage modes: pre-operational and operational. Pre-operational damage modes that occur prior to or during bearing installation, are discussed first.

Pre-operational damage mode causes

Incorrect shaft and housing fits.

If an incorrect fit is used, bearing damage can occur in several forms: fretting corrosion, cracked rings, spinning rings on their seats, reduced bearing capacity, damage from impact because of difficult mounting, parasitic loads, and excessive operating temperatures from preloading. Therefore, selection of the proper fit is critical to ensure that the bearing performs according to its intended use.


If a bearing ring rotates relative to the load direction, an interference fit is required. The degree of interference or tightness is governed by the type of bearing, magnitude of load, and speed. Typically, the heavier the applied load, the higher the required press fit. If a bearing ring is stationary relative to the load direction, it is typically fitted with

clearance or has what is referred to as a loose fit. The recommended fitting tolerances are shown in the "Shaft and housing fits" section of this catalog found on page 51.

The presence of shock load or continuous vibration calls for heavier interference fit of the ring that rotates relative to the load. In the case of a ring with a rotating load zone, lightly loaded rings, or rings that operate at extremely slow speeds may use a lighter fit or, in some cases, a slip fit. Sometimes, it is impossible to assemble a piece of equipment if the proper fitting practices are used. The bearing manufacturer should be consulted in those cases for an explanation of the potential problems that may be encountered.

Consider two examples. In an automobile front wheel, the direction of the load is constant, i.e. the pavement is always exerting an upward force on the wheel. Thus, the rotating outer rings or cups have an interference fit in the wheel hub while the stationary inner rings have a loose fit on the

Scoring or inner ring bore caused by "creep"

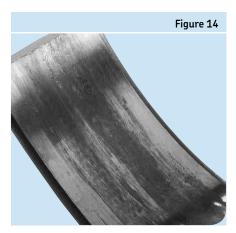

Smearing caused by contact with the shaft shoulder while bearing ring rotated



Wear due to "creep"



axle spindle. On the other hand, the bearings of a conventional electric motor have their outer rings stationary relative to the load and have a loose housing fit but the inner rings rotate relative to the load and are mounted with an interference fit. There are some cases where it appears necessary to mount both inner and outer rings of a bearing with interference fits due to a combination of stationary and rotating loads or loads of undetermined amounts. Such cases are designed with bearings that can allow axial expansion within the bearing itself rather than through the bearing seat. This mounting would consist of a cylindrical roller bearing, or CARB, at one end of the shaft and a shaft locating bearing at the other end.

Some examples of poor fitting follow. Figure 14 shows the bore surface of an inner ring that has been damaged by relative movement between itself and an undersized shaft while rotating under a constant direction load. This relative move-

ment, called creep, can result in the adhesive smearing, polishing, and fretting corrosion shown. An improper shaft interference fit can allow creep and the damage is not always confined to the bore surface, but can have its effect on the side faces of the ring as shown in **Figure 15**. Wear between a press fitted ring and its seat is an accumulative damage. The initial adhesive wear accelerates and produces more wear, the ring loses adequate support, develops cracks [fatigue fracture], and the wear products become foreign matter that abrasively wear and debris dent the bearing internally.

Housing fits that are unnecessarily loose allow the outer ring to creep or turn resulting in wear and / or polishing of the bearing OD and housing bore. **Figure 16** is a good example of such looseness.


Excessive interference fits result in *forced* fractures by inducing dangerously high hoop stresses in the inner ring. **Figure 17** and **Figure 18** illustrate inner rings that cracked

because of excessive interference fit.

Figure 17 is a deep groove ball bearing that was mounted on a cylindrical bearing seat and Figure 18 is a spherical roller bearing that was driven too far up a tapered seat.

The fretting corrosion in Figure 17 covers a large portion of the surface of both the inner ring bore and the journal and was the result of the ring looseness generated by an excessive fit force fracture.

Inner ring fractured due to excessive hoop stress which then caused fretting

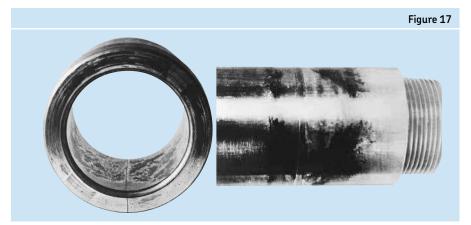

Axial cracks caused by an excessive interference fit



Failure due to defective shaft or housing seats

The calculated life expectancy of a rolling bearing presupposes that its comparatively thin rings will be fitted on shafts or in housings that are as geometrically true as modern machine shop techniques can produce. Unfortunately, there are mitigating factors that produce shaft and housing seats that are deformed, i.e. tapered, out-of-round, out-of-square, or thermally distorted. While the Incorrect shaft and housing fit section dealt with poorly selected fits, this section focuses on poorly formed bearing seats and the damage they can cause.

When the contact between a bearing and its seat is not proper, small movements due to ring flexing can produce *fretting corrosion* as shown in **Figure 19** and **Figure 20**.

Fretting corrosion is the mechanical wearing of surfaces other than rolling contact, resulting from movement that produces oxidation or rust colored appearance. The spalling and fracture seen in **Figure 19** was caused by the uneven support associated with the fretting. In the case of **Figure 19**, fretting corrosion led to spalling (surface initiated fatigue) and a fatigue fracture. Fretting corrosion is common in applications where machining of the seats is accurate but because of service conditions, the seats deform under load. This type of fretting corrosion on the outer ring does not, as a rule, detrimentally affect the life of the bearing.

Figure 21 shows the condition that resulted when a cylindrical roller bearing outer ring was not fully supported, resulting

in a surface initiated fatigue. The impression made on the bearing 0.D. by a turning chip left in the housing when the bearing was installed is seen in the left hand view. Subsequently, the entire load was concentrated over a much smaller load zone then the normal 150° load zone. Premature raceway spalling resulted as seen in the right-hand view, i.e. the 0D chip mark is on the 0.D. of the outer ring with the spalling. On both sides of the spalled area there is fragment denting (indentation from debris), which occurred when spalling fragments were trapped between the rollers and the raceway.


Wear due to fretting corrosion



Advanced wear and cracking due to fretting corrosion




Fatigue from chip in housing bore

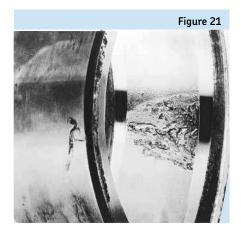

Cracks caused by faulty housing fit



Mirror view shows how raceway is affected by out-of-round housing

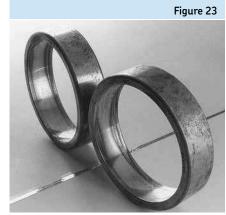

Spalling from parasitic thrust



Bearing seats that are concave, convex, or tapered cause a bearing ring to make poor contact across its width. The ring therefore deflects under load and *fatigue fractures* commonly appear circumferentially along the raceway. Cracks caused by faulty contact between a ring and a poorly formed housing are shown in **Figure 22**.

Figure 23 is a mirror picture of a selfaligning ball bearing outer ring mounted in an out-of-round housing bore. The stationary outer ring was pinched in two places – 180° apart - resulting in preload at these two locations. The preload generated excessive forces and heat and rendered the lubricant ineffective, resulting in *adhesive wear*.

Static misalignment


Misalignment is a common source of overheating and/or premature spalling. Misalignment occurs when an inner ring is seated against a shaft shoulder that is not square with the journal seat, when a housing shoulder is out-of-square with the housing bore, and when two housing bores are not concentric or coaxial. A bearing ring can be misaligned when not pressed fitted properly against its shoulder and left cocked on its seat. Likewise, bearing outer rings in slip-fitted housings that are cocked across their opposite corners can also result in misalignment. Using self-aligning bearings does not necessarily cure some of the foregoing misalignment faults. For example, when the inner ring of a self-aligning

bearing is not square with its shaft seat, it will wobble as it rotates. This condition is referred to as a dynamic misalignment and results in smearing and early fatigue. When a normally floating outer ring is cocked in its housing across corners, it can become axially held in its housing and not float properly with the shaft, resulting in parasitic thrust. The effect of parasitic thrust creates an overload that results in excessive forces and temperature, rendering the lubricant inadequate and resulting in adhesive wear.

Figure 24 shows the result of such thrusting in a self-aligning ball bearing.

Ball thrust bearings suffer early fatigue when mounted on supports that are not perpendicular because only one short section (*arc*) of the stationary ring carries the

Smearing in a ball thrust bearing

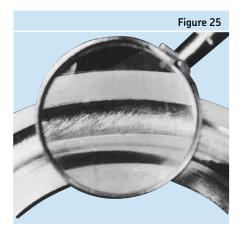

Fatigue caused by edge loading



Advanced spalling caused by edge-loading




Fatigue caused by impact damage during handling or mounting



Smearing caused by excessive force in mounting



Smearing, enlarged 8X from Figure 29

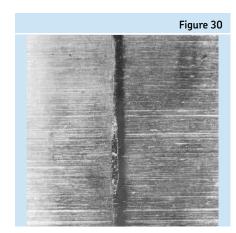

entire load. When the rotating ring of the ball thrust bearing is mounted on an outof-square shaft shoulder, the ring wobbles as it rotates. The wobbling rotating ring loads only a small portion of the stationary ring and causes early fatigue. Figure 25 illustrates "skid" smearing (adhesive wear) within a ball thrust bearing when the two rings are either not parallel to each other or if the load is insufficient at the operating speed. If the rings are parallel to each other but the speed is too high in relation to the load, centrifugal force causes the balls to spin instead of roll at their contact with the raceway and subsequent skidding (adhesive wear) results. Smearing from misalignment will be localized in one zone of the stationary ring whereas smearing from gyroscopic forces will be evenly distributed around both rings.

Where two housings supporting the same shaft do not have a common center line, only self-aligning ball or roller bearings will be able to function without inducing bending

moments. Cylindrical and taper roller bearings can accommodate only very small misalignments – even if crowned – and if appreciable, edge loading results, a source of premature fatigue. Edge loading from housing misalignment was responsible for the spalling in the bearing ring shown in Figure 26. Advanced spalling due to the inner ring deflection misalignment is seen on the inner ring and a roller of the tapered roller bearing in Figure 27. Tables 7 through 9 (beginning on page 57) provide guidelines for the proper tolerancing of shaft and housing components to prevent the above described fitting and form issues.


Faulty mounting practices

Premature fatigue and other failures are often due to abuse and neglect before and during mounting. Prominent among causes of early fatigue is the presence of foreign matter in the bearing and its housing during operation. The effect of trapping a chip between the O.D. of the bearing and the bore of the housing was shown in **Figure 15**. Impact damage during handling, mounting, storage, and/or operation results in brinell depressions that become the start of premature fatigue. An example of this is shown in **Figure 28**, where the spacing of spalling, caused by *overload plastic deformation*, corresponds to the normal distance between the balls.


Cylindrical roller bearings are easily damaged during mounting, especially when the shaft-mounted inner ring is assembled into the stationary outer ring and roller set.

Figure 29 shows such axial indentation by handling caused by the rollers sliding forcibly across the inner ring during assembly. Here again the spacing of the damage is equally spaced with respect to the normal distance between rollers. One of the smeared streaks in Figure 29 is shown enlarged 8X in Figure 30.

Spalling from excessive thrust

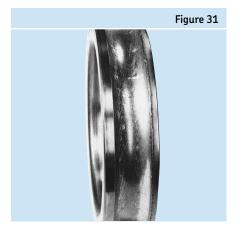

Electric pitting on surface of spherical outer raceway caused by passage of relatively large

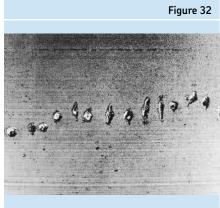

Electric pitting on surface of spherical roller caused by passage of relatively large current



Bearings subjected to loads greater than those calculated to arrive at the life expectancy, will fatigue prematurely. Unanticipated parasitic loads can arise from faulty mounting practice. An example of parasitic load can be found in the procedure of mounting the front wheel of a mining truck. If the locknut is not backed off after the specific torque to seat the bearing is applied, parasitic load may result. Another example would be any application where a bearing should be free in its housing, but because of pinching or cocking, it cannot move with thermal expansion. Figure 31 shows the effect of a parasitic thrust load. The damaged area is not in the center of the ball groove as it should be, but is high on the shoulder of the groove.

Passage of excessive electric voltage through bearings (pre-operational)


In certain machinery applications, there is the possibility that electric potential will pass through a bearing seeking ground. For example, when repairing a shaft, excessive voltage potentials can result from improperly grounding the welding equipment so that the resulting current passes through the bearing to ground. As electricity arcs from the bearing rings to the rolling elements severe damage occurs. Figure 32 and Figure 33 show such excessive voltage (arc welding) damage on the raceway and roller surfaces of a rotating spherical roller bearing. Although this type of damage is classified as pre-operational, this type of damage typically occurs during operation.

Transportation and storage damage

Damages typically associated with transportation include brinelling (overload) from shock loading or false-brinelling from vibration. Shock loading from improper handling of the equipment results in brinelling damage at ball/roller spaced intervals. Such overload marks increase noise and vibration depending upon the severity of the damage. Since a brinell is the result of an impact, the original grinding lines are still intact and visible under magnification. Figure 34 is a 100X magnification of a brinell mark.

False-brinelling damage also occurs at ball/roller spaced intervals as shown in **Figure 35**. However, since it is caused by vibration, when looked at under magnification, the grinding lines are no longer present, as shown in **Figure 36**. False brinelling will also lead to increased noise and vibration depending upon the severity.

Example of true brinelling-100X

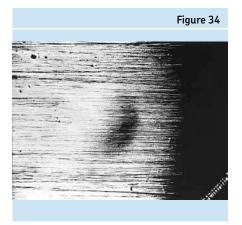

False brinelling caused by vibration with bearing stationary



Example of false brinelling-100X

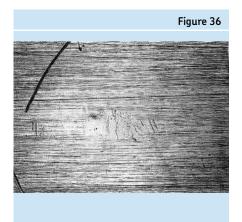


Figure 37

Progressive stages of spalling caused by inadequate lubrication

Operational damage mode causes


Ineffective lubrication

One of the primary assumptions made in the calculated life expectancy of a bearing is that of adequate lubrication, i.e. lubricant in the correct quantity and type. All bearings require lubrication for reliable operation. The lubricant separates the rolling elements, cage and raceways, in both the rolling and the sliding regions of contact. Without effective lubrication, metal-to-metal contact occurs between the rolling elements and the raceways, causing wear of the internal rolling surfaces.

The term "lubrication failure" is too often taken to imply that there was no oil or grease in the bearing. While this does happen occasionally, a bearing damage analysis is normally not that simple. Many cases suffer from insufficient lubricant viscosity, excessive lubricant viscosity, overlubrication, contamination of the lubricant and inadequate quantity of lubrication. Thus a thorough examination of the lubricant's

properties, the amount of lubricant applied to the bearing, and the operating conditions are pertinent to any lubrication damage analysis.

When lubrication is ineffective, abrasive and adhesive wear surface damage results. This damage progresses rapidly to failures that are often difficult to differentiate from a failure due to material fatigue or spalling. Spalling will occur and often destroy the evidence of inadequate lubrication. However, if caught soon enough, indications that pinpoint the real cause of the short bearing life can be found. Stages of abrasive wear due to inadequate lubrication are shown in Figure 37. The first visible indication of trouble is usually a fine roughening or waviness on the surface. Later, fine cracks develop, followed by spalling. If there is insufficient heat removal, the temperature may rise high enough to cause discoloration and softening of the hardened bearing steel. This happened to the bearing shown in Figure 38.

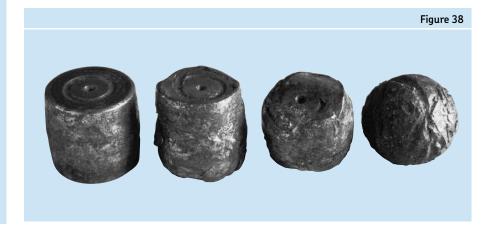

Discoloration and softening of metal caused by inadequate lubrication and excessive heat


In some cases, inadequate lubrication initially appears as a highly glazed or glossy surface (abrasive wear), which, as damage progresses, takes on a "frosty" appearance (adhesive wear) and eventually spalls (surface initiated fatigue). An example of a highly glazed surface is shown in **Figure 39**.

In the frosting stage, it is sometimes possible to feel the "nap" of fine slivers of metal pulled from the bearing raceway by the rolling element. The frosted area will feel smooth in one direction, but have distinct roughness in the other. As metal is pulled


from the surface, pits appear and frosting advances to pulling as shown in **Figure 40**.

Another form of surface damage is called smearing (adhesive wear). It occurs when two surfaces slide and the lubricant cannot prevent adhesion of the surfaces. Minute pieces of one surface are torn away and re-welded to either surface. Examples are shown in **Figures 41** through **44**. Areas subject to sliding friction such as locating flanges and the ends of rollers in a roller bearing are usually the first parts to be affected.


Glazing by inadequate lubrication

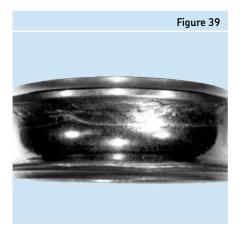

Effects of rollers pulling metal from the bearing raceway (frosting)

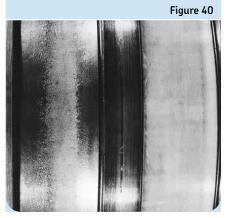


Smearing on spherical roller end

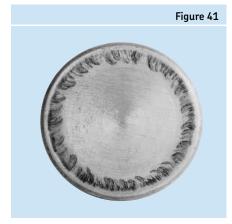


Smearing on spherical roller caused by ineffective lubrication



Smearing on cage pockets caused by ineffective lubrication

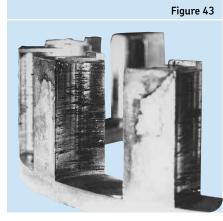

Smearing on inner ring of spherical roller bearing

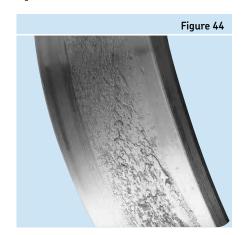

Another type of smearing is referred to as "skid-smearing". This condition occurs when rolling elements slide as they pass from the unloaded to the loaded zone in bearings that may have insufficient load, a lubricant that is too stiff, excessive clearance, and or insufficient lubrication in the load zone. Figure 45 exhibits patches of skid-smearing, one in each row of a spherical roller bearing.


Wear of the bearing as a whole also results from inadequate lubrication. **Figure 46** and **Figure 47** illustrate such damage.

Figure 48 shows a large bore tapered roller bearing that failed due to an insufficient flow of circulating oil. The area between the guide flange and the large end of the roller is subjected to sliding motion, which as mentioned previously, is the first area to be effected during periods of inadequate lubrication. The heat generated at the flange caused the discoloration of the bearing and resulted in some of the rollers being welded to the guide flange. Information on how to select the proper oil viscosity can be found in the Lubrication section of this catalog on page 88 or at the Calculations section, on the "Services" page of www.skf.com.

Ineffective sealing

Bearing manufacturers realize the damaging effects of dirt and take extreme precautions to deliver clean bearings. Freedom from abrasive matter is so important that some bearings are assembled in air-conditioned clean rooms. **Figure 49** shows the inner ring of a bearing where large, tough, soft foreign matter (such as steel or paper debris) was trapped between the raceway and the rollers causing *plastic deformation* depressions known as particle denting. When spalling debris causes this condition,

Skid smearing on spherical outer raceway

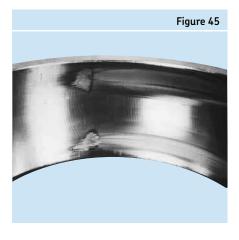


Grooves caused by wear due to inadequate lubrication




Grooves caused by wear due to inadequate lubrication



Roller welded to rib because of ineffective lubrication

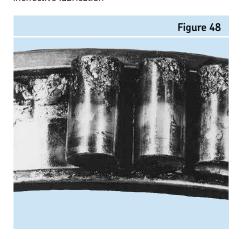

Fragment denting

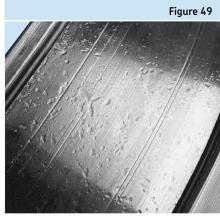

Advanced abrasive wear



it is typically called fragment denting. Each of these small dents is the potential start of premature fatigue. Small hard particles of foreign matter cause *abrasive wear*, and when the original internal geometry is changed significantly, the calculated life expectancy will not be achieved. In addition to reduced life, the accuracy of the bearing is greatly reduced, which can also cause equipment problems with positioning. Dramatic examples of abrasive wear and moisture corrosion, both due to ineffective sealing, are shown in **Figure 50** and **Figure 51**.

Figure 52 shows a deep groove ball bearing where the balls have worn to such an extent due to abrasive particles that they no longer support the cage, allowing it to rub on the lands of both rings.


In addition to abrasive matter, corrosive agents should be excluded from bearings as well. Water, acid, and many cleaning agents deteriorate lubricants resulting in corrosion. Acids form in the lubricant in the presence of excessive moisture and etch the surface black as shown in **Figures 53** through **55**.

The corroded areas on the rollers of **Figure 56** occurred while the bearing was not rotating. A combination of abrasive contamination and vibration in the rolling bearing can be seen in the wavy pattern shown in **Figure 57**. When the waves are more closely spaced, the pattern is called fluting and appears similar to cases that will be shown in section "Passage of electric current through the bearing" on page 133.


Advanced abrasive wear




Advanced abrasive wear

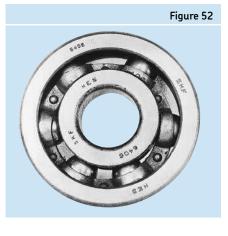

Rust on end of roller caused by moisture in lubricant

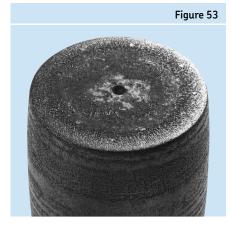

Corrosion streaks caused by water in the lubricant while the bearing rotated

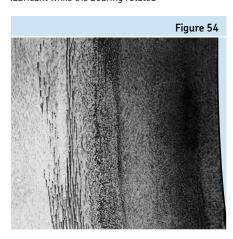

Corrosion of roller surface caused by formation of acids in lubrication with some moisture pres-



Corrosion on roller surface caused by water in lubricant while bearing was standing still



Static vibration

As with those damages that occur during transportation and storage, bearings do not have to be rotating to be damaged in an application. In cases where a vital piece of equipment has a back-up unit standing by, damage from transient vibrations is caused by moving machinery. Depending on the proximity of the idle unit to the operating one(s), vibrations created from the running equipment cause the rolling elements in the bearing of the static machine to vibrate. These movements of the rolling elements on the raceway create a condition referred to as false brinelling, a wearing away of the raceway surface in an oblong or circular shape. When the stand-by equipment is finally put into service, the bearings are usually noisy and require replacement.


Operational misalignment

Misalignments that occur during operation are indicated by the bearing similarly to those produced by static misalignment; i.e. load zones that are not parallel to the raceway grooves. Although these causes can in some instances be detected prior to operation (as is the case of a permanently bent shaft), detection is not always possible. Additional causes of operational misalignment are shafts which deflect due to a loading condition change during operation, such as in belt re-tensioning or situations where a radial imbalance creates shaft deflections at operating speed.

As mentioned earlier in the "Loading patterns for bearings" section, static and dynamic misalignment have two different effects on bearings. Static is a one-time misalignment that occurs and remains constant throughout the operation of the equipment. An example would be a shaft that is deflected under load. The axis of the

inner ring is constant relative to the outer ring and therefore the loading pattern shown in **Figure 12** (page 121) would occur. This condition causes higher internal loads as well as increased temperatures because of the additional load zone in the outer ring. However, in the case of a dynamic misalignment, the rotational axis of the inner ring is constantly changing relative to the outer ring and therefore the loading pattern shown in Figure 13 (page 121) would occur. An example would be a permanently bent shaft. As the horizontal shaft rotates, the inner ring of the bearing moves from side to side through each revolution. This condition causes the same increase in internal loads and operating temperatures as a static misalignment, but in addition sliding friction is introduced into the bearing and additional heat and wear can occur.


False brinelling caused by vibration in presence of abrasive dirt while bearing was rotating

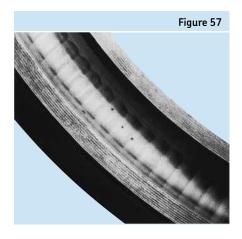

Fluting on raceway of ball bearing caused by prolonged passage of relatively small electric current



Fluting on surface of spherical roller caused by prolonged passage of electric current

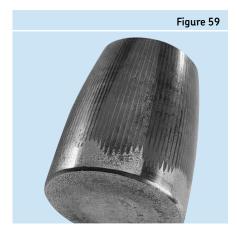

Passage of electric current through the bearing

Passage of excessive voltage during preoperation was discussed in the section "Passage of excessive electric voltage through bearings (pre-operational)" on page 127 and was basically limited to improper grounding during welding. However, one possible way for electric currents to develop is by static electricity emanating from charged belts or from manufacturing processes involving leather, paper, cloth or rubber. This current will pass through the shaft and through the bearing to ground. When the current bridges the lubrication film between the rolling elements and raceways, microscopic arcing results. This produces very localized and extreme temperatures that melt the crossover point. The overall damage to the bearing is in proportion to the number and size of individual damage points.

Electrical erosion fluting due to current leakage occurs when these moderate voltage small currents arc over during prolonged periods and the microscopic pits accumulate drastically. The result is shown in **Figures 58** though **60**. This condition can


Fluting on inner raceway

occur in ball or roller bearings. Flutes can develop considerable depth, producing noise and vibration during operation and eventual fatigue. Individual electric marks, pits, and fluting have been produced in test bearings. Both alternating and direct current can cause *electric erosion*, but through different mechanisms.

Other than the obvious fluting pattern on the rings and rollers of the bearings shown below, there is one other sign of current leakage that can occur. A darkened gray matte discoloration of the rolling elements and a very fine darkened gray matte discolored load zone can potentially point to an electric discharge problem. The remainder of the bearing surfaces are normal and do not exhibit any discoloration. **Figure 61** is an example of a ball from a standard deep groove ball bearing and a ball that has been exposed to electric discharge. See SKF INSOCOAT® and Hybrid bearings for solutions to arcing problems at www.skf.com.

Arcing damage ball versus standard ball

Figure 60

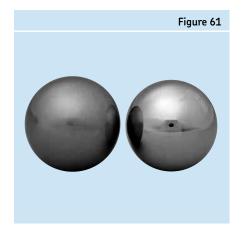

SKF damage analysis service

Bearing damage analysis provides insight into equipment operation and bearing damage. Evidence needs to be collected and interpreted correctly to establish exactly what occurred and to reveal what was responsible for it. Knowledge and experience are required to separate useful information from false or misleading clues. This is why SKF offers professional damage analysis support.

A standard damage analysis establishes the likely cause of bearing damage based on visual examination and a limited application review. A Bearing Damage Analysis report, containing conclusions and recommendations to prevent future failures, is issued to the customer by SKF Engineers. Observations that led to the conclusions are documented in the report along with photographs of significant evidence. The reports draw upon SKF's extensive bearing failure knowledge and application experience.

Advanced damage analysis support is also available through SKF. The technical competence and capabilities of the SKF North American Technical Center (NATC) can be used to support high level bearing failure investigations. SKF Engineers couple the NATC's findings with a detailed application review to provide the most conclusive report possible on the bearing damage and potential solutions.

Please contact you local SKF Authorized Distributors for further information on bearing analysis.

Additional resources

Maintenance and lubrication products

SKF develops and markets maintenance tools, lubricants and lubricators to optimize mounting, dismounting and lubrication of bearings. The product assortment includes mechanical tools, heaters, oil injection equipment, instruments, lubricants and lubricators.

Mechanical tools

Mechanical tools are used mainly for mounting and dismounting small and medium-sized bearings. The SKF range comprises tools for the installation and removal of bearings and locking devices.

- Hook and impact spanners
- Lock nut spanners and axial lock nut sockets
- · Bearing fitting tools
- Jaw pullers

Jaw pullers

- Strong back pullers
- Internal and blind pullers

Lubricants and lubricators

The formulation of all SKF bearing greases is based on extensive research, grease performance testing and field experience. SKF developed many of the internationally accepted bearing-related grease testing parameters. For correct lubricant application, a range of lubrication equipment is available from SKF.

- Greases
- Grease guns and pumps
- Grease meter
- SYSTEM 24[®] single point automatic lubricator
- SYSTEM MultiPoint® automatic lubricator
- Oil leveller

Hydraulic tools

A variety of hydraulic tools is available to mount and dismount bearings in a safe and controlled manner. The SKF oil injection method enables easy working while the SKF Drive-up Method provides accurate results.

- Hydraulic nuts
- Hydraulic pumps and oil injectors
- Hydraulic accessories

Instruments

To realize maximum bearing life, it is important to determine the operating condition of machinery and their bearings. With the SKF measuring instrument range, critical environmental conditions can be analyzed to achieve optimum bearing performance.

- Tachometers
- Thermometers
- Electronic stethoscope
- Oil check monitor
- Alignment instruments and shims
- Thermal cameras

Bearing heaters

A fast and very efficient way to heat a bearing for mounting is to use an induction heater. These heaters, which only heat metallic components, control bearing temperature safely and accurately, to minimize the risk of bearing damage caused by excessive heat.

- Induction heaters
- Portable induction heaters
- Hot plates
- Heating devices to remove inner rings
- Gloves

For additional information on SKF Maintenance Products, please visit www.mapro.skf. com or order catalog MP/P1 03000.



Hydraulic pumps





Shaft alignment tool

SKF Training Solutions®

Training to get more from your machines

Delivering the highest quality goods at the best value requires highly skilled employees and optimum machine reliability. Meeting increasingly stringent safety and environmental regulations can also affect your operational costs. These factors make maximizing machine reliability and maintenance costs crucial. But training your team on these critical skills as they juggle daily tasks is difficult at best. With SKF Training Solutions (STS) courses from SKF, it's never been easier.

World-class maintenance and reliability instruction

SKF offers a comprehensive suite of STS training courses designed to help plants reduce machinery problems and achieve maximum reliability and productivity. Offered by skill level and structured to reflect the SKF Asset Efficiency Optimization workflow process, the training covers most aspects of machine maintenance and reliability, from bearing basics and lubrication to maintenance strategy and asset management.

Why SKF for reliability maintenance training?

Because SKF Training Solutions courses are backed by 100 years of experience and knowledge of rotating machine reliability that is unmatched in the world. Close working partnerships with our clients have given us a unique and intimate understanding of the processes and challenges specific to every major industry, from paper, power and petroleum, to metals, mining and food processing. And as a technical partner to original equipment manufacturers worldwide, we likely have had a role in the design of machinery in your plant.

This extensive expertise forms both our Asset Efficiency Optimization workflow concept and our comprehensive training courses, which cover every aspect of machine reliability, from the shop floor to executive offices. No matter what industry you're in or what machinery you use, SKF can show you how to maintain and manage your assets more productively.

Training options

SKF Training Solutions (STS) can work with you to arrange a training program that is convenient for you. From asset management to basic maintenance skills, STS can develop a solution for you and your team. We have a full schedule of training courses held at a variety of locations across the country—or we can bring our classes to you!

STS classroom

Traditional STS classroom courses are offered at the full-time SKF training center located in Lansdale, PA — approximately 20 miles outside of Philadelphia. Courses held in Lansdale are at the SKF USA Inc. headquarters. Courses are also offered at SKF Solution Factory locations in Houston, TX, Birmingham, AL and Cleveland, OH.

STS regional classroom

STS public courses are also offered regionally across the country at locations that vary from year to year. If there is not a course scheduled in your neighborhood, or if you have several plant locations in a certain area, we can arrange a regional class for your part of the country.

On-site classroom courses

All STS classroom courses can be held on-site in your plant at any time. On-site training brings the instructor and the expertise directly into your plant so you can apply the training directly to your equipment.

On-site customized training

If you have a training need that doesn't fit a particular STS course or program descrip-









tion, the STS can create a custom training program for you. For employee skills, process or equipment training, STS specialists will perform job, task and skills analysis to determine training needs, develop course materials and delivery methods and implement the training on your schedule. Custom courses can be taught by a qualified STS instructor, or we can train your trainer to teach the material supplied by the STS.

Performance support

Periodic training enhances employee performance and ensures that the most current practices are being properly applied in the field. STS Performance Support systems can be used for instructor/mentored training, self-directed training, and for training needs assessments. Complete packages consist of tools, demonstration units, comprehensive instructions for proper use and application, and assessment testing procedures. Packages are tailored to client's specific machinery types and maintenance practices. Contact STS and we will evaluate your needs and design a performance support system to meet your training requirements.



SmartStart[™] on-site product start-up training

SmartStart is an on-site product start-up service that focuses on a specific product and is designed to get that product up and running, your employees trained, and your program implemented quickly and effectively. The training takes the form of mentoring rather than classroom instruction, and the site instructor will offer guidance in applicable product and/or database optimization and functionality.

SiteMentor on-site training

Training can be brought directly to your employees at your site through the Site-Mentor program. Designed as an extension of the typical classroom instruction offered by the STS, the program places an STS instructor and/or technical expert side-by-side with your employees to train them in the specific skills they need in bearings, precision skills or condition monitoring. Class size is typically limited to maximize hands-on participation for all students. While at your site, the STS instructor will also assess maintenance skills and practices, and identify other improvement opportunities and training needs.

Testing and certification

SKF Training Solutions is pleased to announce that most courses will now include a certification test. Upon passing, the individual will become SKF Certified in the specific course taken. Your SKF certificate will include the course number and course name.

Participants who chose not to take the test or who do not pass the test will receive a certificate of attendance.

SKF Training Solutions Online

Learn at your own place and pace

The online area of STS offers an expanding range of e-learning courses covering a range of topics. This enables self-paced learning to be enjoyed by the participant at the time and place that best suits their situation.

Tutor support

Our "ask the expert" functionality provides the learner with direct access to our extensive network of subject matter experts, ensuring maximum effectiveness of the learning experience.

Certification

On completion of the course the learner can take a test and receive a certificate in the mail.

Structured learning path

These e-learning courses are an integral part of STS's extensive training portfolio. They are designed to complement the higher level courses that are delivered by our specialist training staff. Like STS's face-to-face training, STS Online courses are structured according to the five facets of SKF's Asset Efficiency Optimization (AEO) process.

To learn more about all the training opportunities with STS contact your local SKF representative.

Reliability and services

SKF has been a leader and innovator in bearing technology since 1907. The evolution of SKF expertise in machine reliability stems from the very nature of bearings and their applications. SKF's understanding of a bearing's performance in an application requires an equally extensive knowledge of the machines and the processes. The thorough understanding of machine components, systems and related processes, enables SKF to create and provide realistic solutions for optimum machine and process reliability and productivity.

SKF provides a single source for a complete productivity solution. The goal is to help customers reduce total machine maintenance related costs, improve mechanical available, enhance productivity and strengthen profitability. Whatever the requirements, SKF offers the knowledge, products and services needed to achieve specific business goals.

The Asset Efficiency

OptimizationTM concept The Asset Efficiency OptimizationTM (AEO) concept from SKF picks up where most plant asset management programs typically stop. Using this concept enables a plant to produce the same amount for less cost, or to produce more for the same costs. It is a system for organizing and applying assets - from personnel to machinery - bringing together knowledge and technology to achieve the greatest return on investment.

By applying the power of SKF's product and service solutions, you can benefit from a program that assists in achieving your organization's overall business objectives. These include reduced costs, greater productivity, better utilization of resources, and as a result, increased bottom line profitability (Diagram 1).

SKF technology and service solutions

The following summarizes the most important products and services that SKF Reliability Systems offers to provide solutions to the real-life application conditions. For detailed information on the SKF Reliability Systems program please refer to publication: 5160 E "The Guide to Asset Efficiency OptimizationTM for Improved Profitability" or visit www.skf.com/us/services to see the latest information on strategies and services.

Assessment

An assessment can include one or all of the following areas.

- Determination of current situation
- Maintenance
- Supply and stores processes
- Predictive maintenance

Maintenance strategy

SKF can help to establish a comprehensive maintenance strategy, designed to make sure that productivity, as well as safety and integrity issues, receive the attention they require. Diagram 1 illustrates the range and ranking of maintenance practices.

Maintenance engineering

Maintenance engineering is putting the strategy to work and includes, for example, the implementation of a "Computerized Maintenance Management System" (CMMS) with all the data and process information needed to achieve maintenance strategy goals.


Supply process

This service is an integral part of increasing profitability by reducing transaction costs, releasing capital tied up in spare inventory and making sure that the right spares are available when needed.

Proactive Reliability Maintenance

Following the Proactive Reliability
Maintenance process helps to provide best
return on plant assets. It addresses failures
and implements the processes necessary to
prevent recurrence. The SKF Proactive
Reliability process is based on four key
steps:

- Predictive maintenance,
- Diagnostics and Root Cause Analysis (RCA)
- Key performance indicators
- Periodic operational reviews

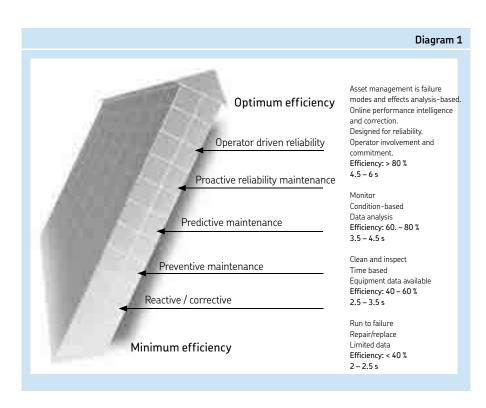

Machine maintenance

SKF has developed its most comprehensive service program for rotating equipment to drive machine maintenance in the most cost-effective ways. This program includes products and services such as:

- Precision maintenance
- Lubrication management
- Reliability engineering
- Bearing root cause analysis
- Machine reliability enhancements
- Bearing installation

Machine improvement

To remain competitive, plants must keep pace with new machine technologies. SKF can help to keep pace – without the need to invest in new machines. Recommendations can include one, or a combination of actions:

- Bearing, seals, & automated lubrication system upgrades
- Machine health monitoring technology upgrades
- Rebuild, repairs and re-design
- Refurbishment of bearings
- Precision maintenance practices & process improvements

Rotating Equipment Performance (REP) Programs

An REP program brings together all areas of expertise offered by SKF, establishing a continuous process of maintenance monitoring, analysis and improvement. It provides a planned skills transfer program



for maintenance personnel, and technology upgrades where required.

Machine Health monitoring

As a leading supplier of machine health monitoring products, SKF offers a complete range - from hand-held data collectors/ analyzers to online surveillance and wireless systems. These products provide an interface with condition monitoring analysis software and other plantwide systems

@ptitude Industrial Decision Support System

The @ptitude Industrial Decision Support System from SKF is a knowledge management system that incorporates today's most advanced technologies to integrate data from multiple sources into an easy to use reliability maintenance application. It enhances the user ability to make the right decision at the right time, providing a structured approach to capturing and applying knowledge. A key element of the @ptitude system is its online, web-enabled asset management knowledge bank:

@ptitudeXchange subscribers have access to articles, technical handbooks, white papers, best practices and benchmarking information, interactive decision-support



programs and an information network for expert advice and services.

SKF Machine Health Reporting Program

A partnership — you collect the data, SKF analyzes it The SKF Machine Health Reporting Program is a partnership offering that can help your plant enjoy many of the benefits of a comprehensive predictive maintenance program — without the need to invest in condition monitoring equipment or specialized data analysis training that a PdM program requires. SKF instructs your maintenance personnel how to use SKF technology to capture machine health data during their normal duties. Collected data is transmitted to SKF online, then analyzed by an experienced SKF Reliability Specialist who identifies problems and recommends actions to avoid unplanned downtime.

Program highlights

The SKF Machine Health Reporting Program allows your team to tap into decades of SKF predictive maintenance and rotating machinery expertise, even as it enables them to focus on more production-related activities. For a monthly fee based on the number of machines you choose to monitor, the program delivers many benefits.

Highlights include:

- SKF provides a state-of-the-art technology and on-site training
- Your own people collect the machine health data
- SKF Reliability Specialists manage your machine health data using cloud based software applications
- SKF analyzes your data and publishes monthly Machine Health Reports on a private web page
- SKF calls to alert you to urgent machinery health conditions
- SKF keeps your program on track with periodic visits



© 2018 SKF USA Inc. Publication 140-710 (8M/BR 7/2019) Version 7/2019